

PROBLEM SUMMARY

Sample Rating Trend

WEAR




COOLER FEEDER

Component **Hydraulic System**

ATF (--- GAL)

COMPONENT CONDITION SUMMARY



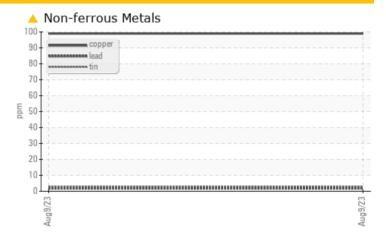

RECOMMENDATION

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC T	TEST RESULTS
---------------	--------------

Sample Status				ABNORMAL	
Copper	ppm	ASTM D5185(m)	>20	4 99	
Particles >4µm		ASTM D7647	>5000	17089	
Particles >6µm		ASTM D7647	>1300	△ 5598	
Particles >14μm		ASTM D7647	>160	440	
Particles >21µm		ASTM D7647	>40	<u> 108</u>	
Oil Cleanliness		ISO 4406 (c)	>19/17/14	21/20/16	

Customer Id: REIBLI Sample No.: WC0750567 Lab Number: 02575374 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com


RECOMMENDED ACTIONS				
Action	Status	Date	Done By	Description
Change Filter			?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.
Resample			?	We recommend an early resample to monitor this condition.
Alert			?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.
Information Required			?	Please specify the brand, type, and viscosity of the oil on your next sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.
Filter Fluid			?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

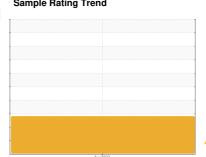

WEAR



Hydraulic System

COOLER FEEDER

ATF (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

Copper ppm levels are noted. All other component wear rates are normal.

Contamination

There is a moderate amount of particulates (2 to 100 microns in size) present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

				Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0750567		
Sample Date		Client Info		09 Aug 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	7		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>20	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	2		
Copper	ppm	ASTM D5185(m)		<u> </u>		
Tin	ppm	ASTM D5185(m)	>20	3		
Antimony	ppm	ASTM D5185(m)	720	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium		ASTM D5185(m)		0		
•	ppm	. ,		-		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		71		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		2		
Calcium	ppm	ASTM D5185(m)		213		
Phosphorus	ppm	ASTM D5185(m)		669		
Zinc	ppm	ASTM D5185(m)		19		
Sulfur	ppm	ASTM D5185(m)		1008		
Lithium	ppm	ASTM D5185(m)		1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	2		
Sodium	ppm	ASTM D5185(m)	7.0	2		
Potassium	ppm	ASTM D5185(m)	>20	0		
		. , ,				
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<u>17089</u>		
Particles >6µm			>1300	<u>^</u> 5598		
Particles >14µm		ASTM D7647	>160	<u>440</u>		
Particles >21µm		ASTM D7647	>40	<u> </u>		
Particles >38µm		ASTM D7647	>10	2		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u> </u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2



OIL ANALYSIS REPORT

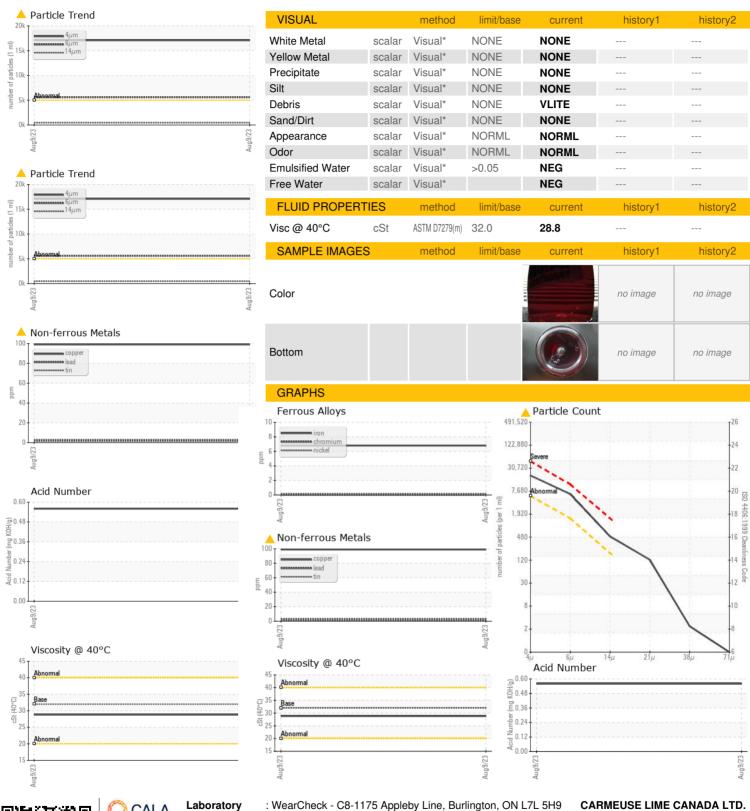



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

Test Package : IND 2

: WC0750567

: 02575374 : 5620425

Received Diagnosed Diagnostician

: 11 Aug 2023 : 14 Aug 2023

: Kevin Marson

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

CA POR 1B0 Contact: Jeffrey Mooney jeffrey.mooney@carmeusena.com T: (705)849-2201

BOX 1690,, HWY 17 EAST

F: (705)849-2355

BLIND RIVER, ON