




PROBLEM SUMMARY

Sample Rating Trend

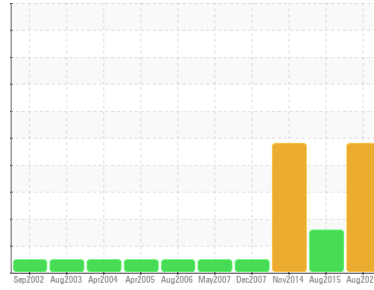

DIRT




Machine Id
BROWNING 25SMT25 #4A SCREW (S/N 525594)

Component
Reduction Gear

Fluid
MOBIL MOBILGEAR SHC 220 (9 LTR)

COMPONENT CONDITION SUMMARY

● Silicon (ppm)

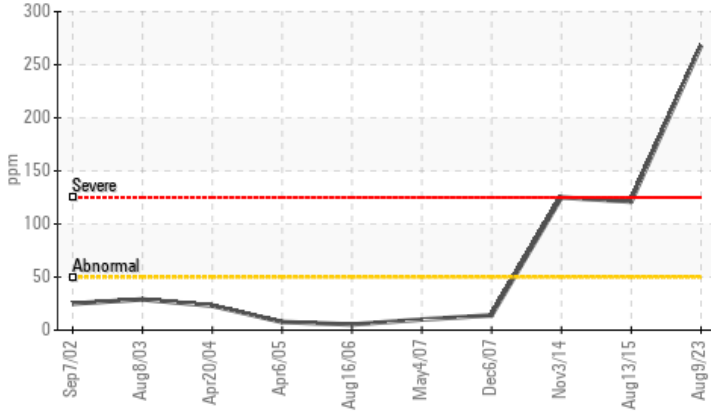

RECOMMENDATION

We advise that you check all areas where dirt can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	ABNORMAL	SEVERE
Silicon	ppm	ASTM D5185(m)	>50	● 268	▲ 121	● 125

Customer Id: REIBLI
 Sample No.: WC0795503
 Lab Number: 02575486
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
 Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check Breathers	---	---	?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.
Check Dirt Access	---	---	?	We advise that you check all areas where dirt can enter the system.
Filter Fluid	---	---	?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.

HISTORICAL DIAGNOSIS

13 Aug 2015 Diag: Wes Davis

DIRT



We advise that you check all areas where dirt can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition. All component wear rates are normal. There is a moderate concentration of dirt present in the oil. The water content is negligible. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



03 Nov 2014 Diag: Kevin Marson

DIRT



We advise that you check all areas where dirt can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition. All component wear rates are normal. High concentration of dirt present in the oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



06 Dec 2007 Diag:

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The condition of oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

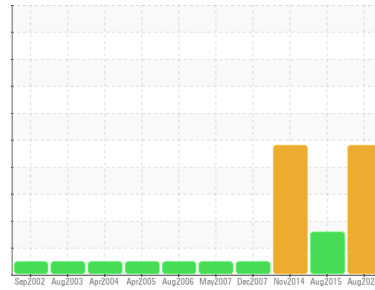

DIRT



Machine Id
BROWNING 25SMT25 #4A SCREW (S/N 525594)

Component
Reduction Gear

Fluid
MOBIL MOBILGEAR SHC 220 (9 LTR)

DIAGNOSIS

Recommendation

We advise that you check all areas where dirt can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

High concentration of dirt present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0795503	WC938376	WC925161
Sample Date	Client Info		09 Aug 2023	13 Aug 2015	03 Nov 2014
Machine Age	hrs	Client Info	0	13104	8435
Oil Age	hrs	Client Info	0	13104	8435
Oil Changed	Client Info		Not Changed	Not Changd	Not Changed
Sample Status			SEVERE	ABNORMAL	SEVERE

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		23	22	5
Iron	ppm	ASTM D5185(m) >150	54	20	12
Chromium	ppm	ASTM D5185(m) >10	1	<1	<1
Nickel	ppm	ASTM D5185(m) >10	<1	<1	0
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m) >25	<1	<1	0
Lead	ppm	ASTM D5185(m) >100	0	<1	0
Copper	ppm	ASTM D5185(m) >50	<1	<1	<1
Tin	ppm	ASTM D5185(m) >10	0	0	0
Antimony	ppm	ASTM D5185(m) >5	0	0	0
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	<1

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	1	<1	<1
Barium	ppm	ASTM D5185(m)	0	<1	<1
Molybdenum	ppm	ASTM D5185(m)	0	<1	0
Manganese	ppm	ASTM D5185(m)	<1	<1	<1
Magnesium	ppm	ASTM D5185(m)	<1	0	<1
Calcium	ppm	ASTM D5185(m)	13	2	2
Phosphorus	ppm	ASTM D5185(m)	455	426	403
Zinc	ppm	ASTM D5185(m)	11	<1	3
Sulfur	ppm	ASTM D5185(m)	1786	1822	1807
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS





	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >50	268	121	125
Sodium	ppm	ASTM D5185(m)	0	<1	0
Potassium	ppm	ASTM D5185(m) >20	0	0	<1

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	1.09	0.928	0.61




OIL ANALYSIS REPORT

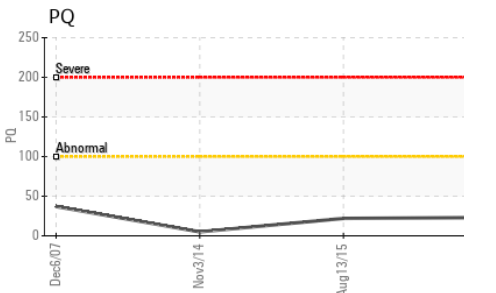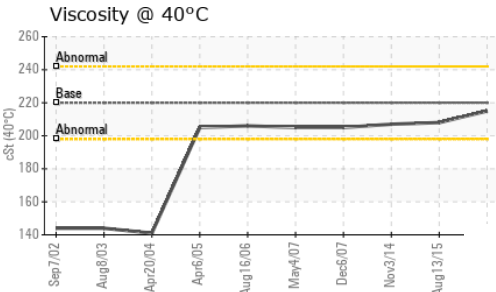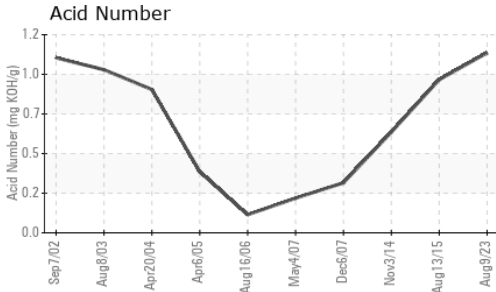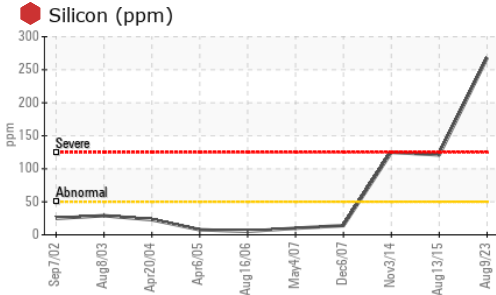






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	LIGHT	NONE
Debris	scalar	Visual*	NONE	VLITE	VLITE
Sand/Dirt	scalar	Visual*	NONE	VLITE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	220	215	208

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

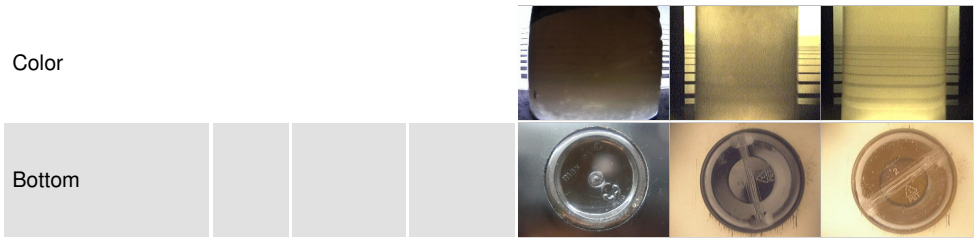

GRAPHS

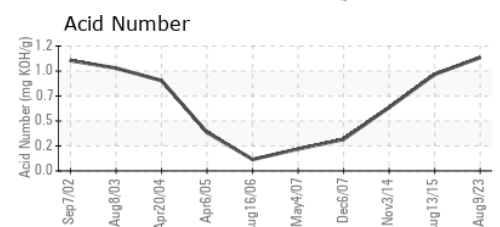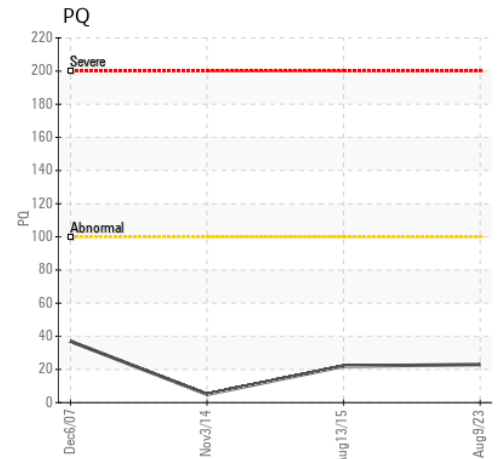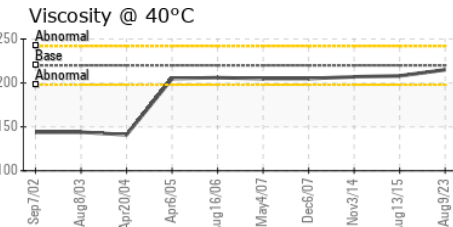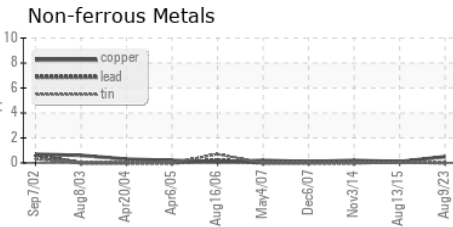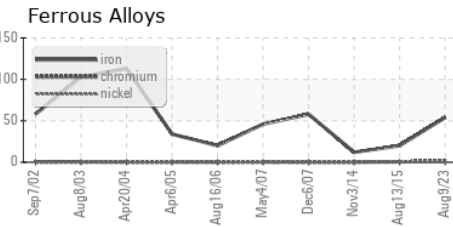

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
 Sample No. : WC0795503
 Lab Number : 02575486
 Unique Number : 5620537
 Test Package : IND 2 (Additional Tests: TAN Man)

CARMEUSE LIME CANADA LTD.
 BOX 1690., HWY 17 EAST
 BLIND RIVER, ON
 CA P0R 1B0
 Contact: Rejean Baillargeon
 rejean.baillargeon@carmeuse.ca
 T: (705)849-2201
 F: (705)849-2355

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.