

# **PROBLEM SUMMARY**


# GFL 122 Arrow Road - C13100 Machine Id AG178

Component
Hydraulic System

NOT GIVEN (--- GAL)

# Sample Rating Trend ISO Anglo23

# COMPONENT CONDITION SUMMARY

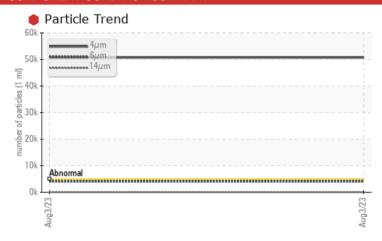

# RECOMMENDATION

This is a baseline read-out on the submitted sample. ( Customer Sample Comment: IND2-ICP KV AN KF )

PROBLEMATIC TEST RESULTS									
Sample Status			SEVERE						
Particles >4µm	ASTM D7647	>5000	<b>50750</b>						
Particles >6µm	ASTM D7647	>1300	<b>4132</b>						
Oil Cleanliness	ISO 4406 (c)	>19/17/14	<b>23/19/12</b>						

Customer Id: CHECOB Sample No.: E30000185 Lab Number: 02576358 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Tatiana Sorkina +1 (800)263-3939 tsorkina@e360s.ca

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

# RECOMMENDED ACTIONS

There are no recommended actions for this sample.

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

# GFL 122 Arrow Road - C13100

**AG178** 

Component **Hydraulic System** 

**NOT GIVEN (--- GAL)** 

# Sample Rating Trend

# DIAGNOSIS

# Recommendation

This is a baseline read-out on the submitted sample. ( Customer Sample Comment: IND2-ICP KV AN KF)

## Wear

{not applicable}

# Contamination

Particles >4µm and oil cleanliness are severely high. Particles >6µm are abnormally high.


# **Fluid Condition**

{not applicable}

		<u>-</u>		Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		E30000185		
Sample Date		Client Info		03 Aug 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	3		
Chromium	ppm	ASTM D5185(m)	>20	1		
Nickel	ppm	ASTM D5185(m)	>20	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	5		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		6		
Calcium	ppm	ASTM D5185(m)		57		
Phosphorus	ppm	ASTM D5185(m)		365		
Zinc	ppm	ASTM D5185(m)		433		
Sulfur	ppm	ASTM D5185(m)		824		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<1		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Water	%	ASTM D6304*	>0.05	0.003		
ppm Water	ppm	ASTM D6304*	>500	26.8		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>50750</b>		
Particles >6µm		ASTM D7647	>1300	<b>4132</b>		
Particles >14µm		ASTM D7647	>160	40		
Particles >21µm		ASTM D7647		7		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	23/19/12		



# **OIL ANALYSIS REPORT**

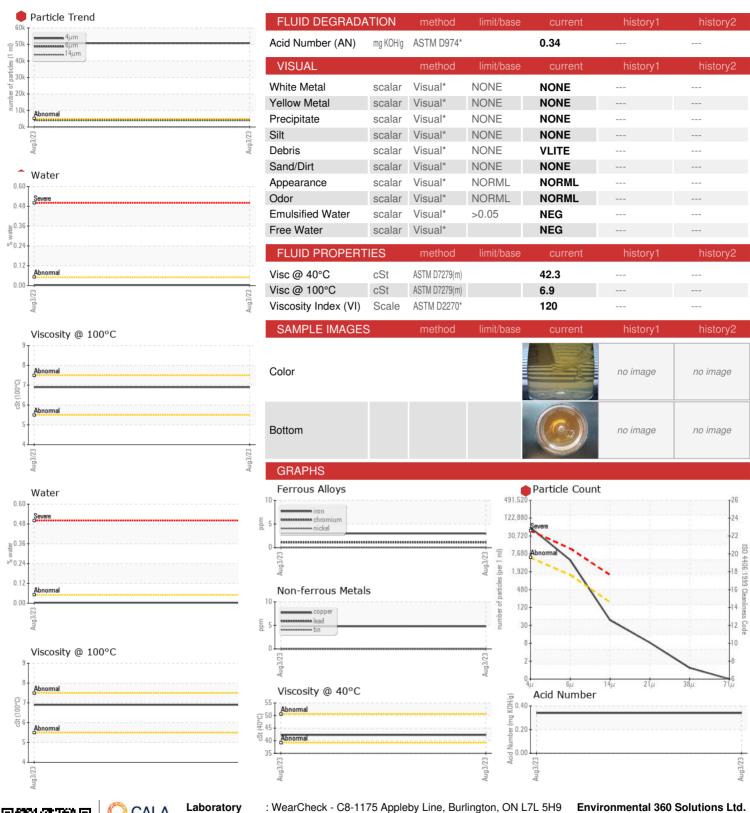



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: E30000185

: 02576358

Received : 16 Aug 2023 Diagnosed : 22 Aug 2023 Diagnostician : Tatiana Sorkina

: 5629418 Test Package : IND 2 (Additional Tests: KF, KV100, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Environmental 360 Solutions Ltd.

Submitted By: Tatiana Sorkina

640 Victoria Street Cobourg, ON **CA K9A 5H5** Contact: Fred Kosseim fkosseim@e360s.ca T: (905)372-2251

F: (905)372-1658