




# OIL ANALYSIS REPORT

Sample Rating Trend

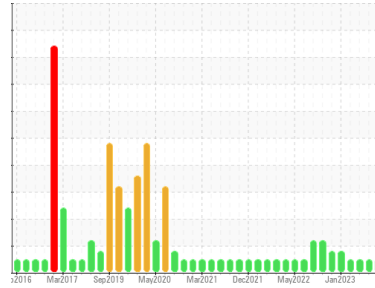

**NORMAL**



Machine Id  
**NEW FLYER 1209**  
 Component  
**Diesel Engine**  
 Fluid  
**SAFETY-KLEEN PERFORMANCE PLUS XHD-7 15W40 (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0830093</b>	WC0811621	WC0791404
Sample Date	Client Info		<b>16 Aug 2023</b>	04 Jul 2023	05 Apr 2023
Machine Age	kms	Client Info	<b>819389</b>	812037	794055
Oil Age	kms	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method		<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>75	<b>14</b>	16	14
Chromium	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	0	<1
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>15	<b>2</b>	2	2
Lead	ppm	ASTM D5185(m)	>25	<b>1</b>	2	<1
Copper	ppm	ASTM D5185(m)	>100	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		<b>1</b>	<1	<1
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>58</b>	58	59
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)		<b>952</b>	957	943
Calcium	ppm	ASTM D5185(m)		<b>1004</b>	1061	1056
Phosphorus	ppm	ASTM D5185(m)		<b>1016</b>	1062	1049
Zinc	ppm	ASTM D5185(m)		<b>1145</b>	1203	1160
Sulfur	ppm	ASTM D5185(m)		<b>2449</b>	2473	2519
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	<b>3</b>	3	2
Sodium	ppm	ASTM D5185(m)		<b>1</b>	2	1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0

## INFRA-RED


	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>6	<b>0.7</b>	0.7	0.5
Nitration	Abs/cm	ASTM D7624*	>20	<b>8.4</b>	9.3	8.7
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>23.0</b>	23.1	22.2

## FLUID DEGRADATION

	method	limit/base	current	history1	history2	
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>17.8</b>	20.2	15.7











# OIL ANALYSIS REPORT

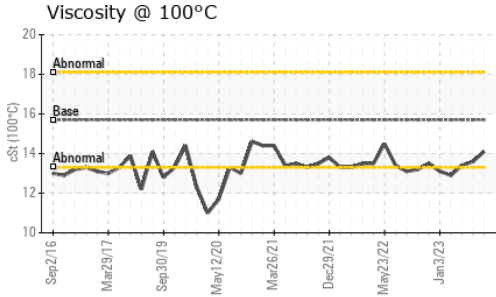

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.7	14.1	13.6

## GRAPHS

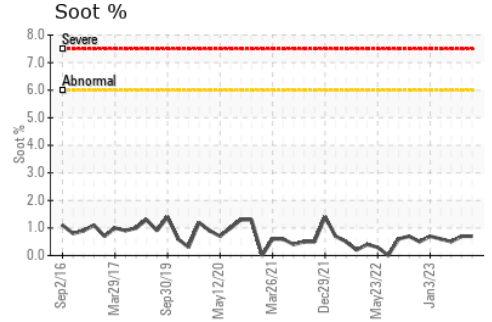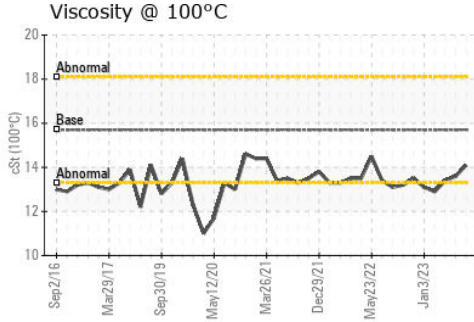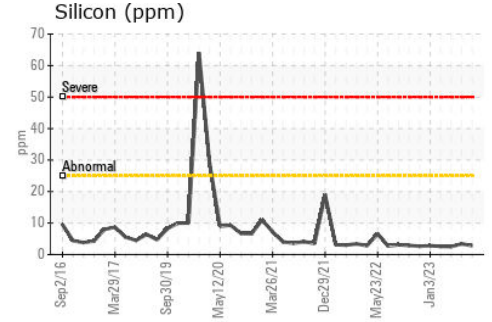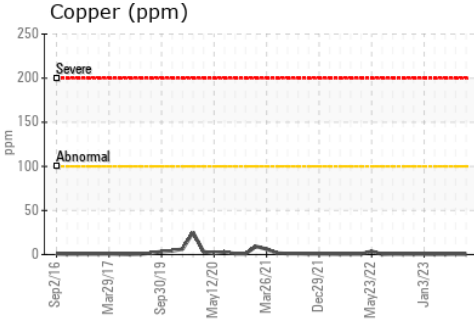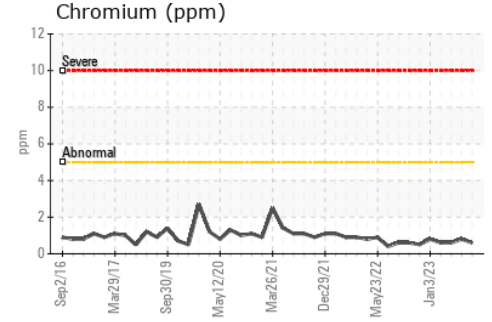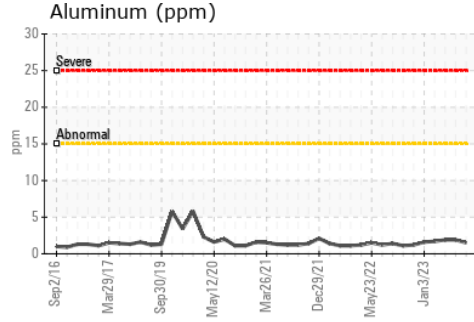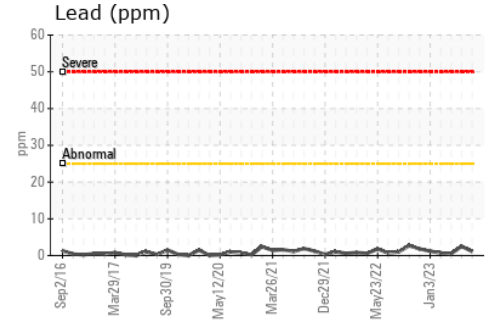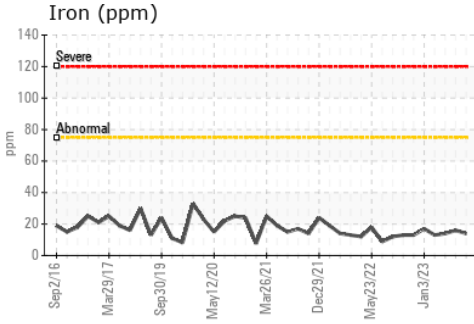

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0830093      **Received** : 22 Aug 2023  
**Lab Number** : 02577403      **Diagnosed** : 22 Aug 2023  
**Unique Number** : 5630463      **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

**CITY OF HAMILTON**  
 2200 UPPER JAMES., MOUNTAIN TRANSIT STOREROOM  
 MOUNT HOPE, ON  
 CA L0R 1W0  
 Contact: Jeff Parr  
 jeff.parr@hamilton.ca  
 T: (905)546-2424  
 F: (905)679-4502

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.