

PROBLEM SUMMARY

Sample Rating Trend

ISO




Gas Compression V650221 GTC 2

Component **Turbine**

MOBIL JET OIL II (--- LTR)

COMPONENT CONDITION SUMMARY

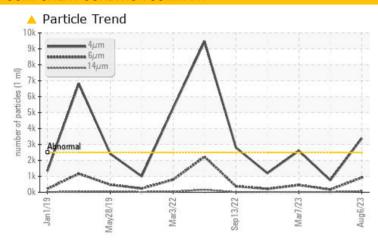

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS							
Sample Status			ATTENTION	NORMAL	ATTENTION		
Particles >4µm	ASTM D7647	>2500	4 3384	755	2606		
Particles >6μm	ASTM D7647	>640	<u> </u>	169	454		
Oil Cleanliness	ISO 4406 (c)	>18/16/13	19/17/13	17/15/11	1 9/16/11		

Customer Id: EXXSTJ Sample No.: PP13907152 Lab Number: 02577524 Test Package: MAR 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.
Information Required			?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS

02 Jun 2023 Diag: Kevin Marson

NORMAL



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



07 Mar 2023 Diag: Kevin Marson

ISO



We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is a light amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



11 Dec 2022 Diag: Kevin Marson

NORMAL




Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

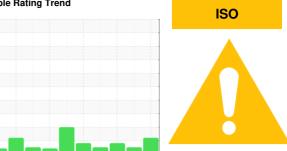

Gas Compression V650221 GTC 2

Turbine

MOBIL JET OIL II (--- LTR)

Recommendation

DIAGNOSIS

We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a light amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Jan2019	May2019 Mar2022	Sep2022 Mar2023	Aug2023	
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PP13907152	PP13874958	PP13843574
Sample Date		Client Info		06 Aug 2023	02 Jun 2023	07 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	NORMAL	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>15	0	0	0
Chromium	ppm	ASTM D5185(m)	>4	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>10	0	0	0
Lead	ppm	ASTM D5185(m)		0	0	0
Copper	ppm	ASTM D5185(m)	>5	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>5	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		0	0	0
Calcium	ppm	ASTM D5185(m)		0	<1	0
Phosphorus	ppm	ASTM D5185(m)		2760	3389	2830
Zinc	ppm	ASTM D5185(m)		1	1	<1
Sulfur	ppm	ASTM D5185(m)		1	0	<1
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	1	1	1
Sodium	ppm	ASTM D5185(m)		2	2	2
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>2500	△ 3384	755	<u>^</u> 2606
Particles >6µm		ASTM D7647	>640	<u>\$\text{4}\$ 921</u>	169	454
Particles >14μm		ASTM D7647	>80	76	15	13
Particles >21μm		ASTM D7647	>20	28	5	5
Particles >38μm		ASTM D7647	>4	4	0	0
Particles >71μm		ASTM D7647	>3	1	0	0
Oil Cleanliness		ISO 4406 (c)	>18/16/13	1 9/17/13	17/15/11	<u> </u>
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)



OIL ANALYSIS REPORT





CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: PP13907152 02577524 : 5630584

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received Diagnosed

: 22 Aug 2023 : 23 Aug 2023

Diagnostician : Kevin Marson

Test Package : MAR 2 (Additional Tests: PrtCount, TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

ExxonMobil Canada East Ltd.

Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow St. John's, NL **CA A1C 6K3**

Contact: Liam Maher liam.m.maher@exxonmobil.com

T: (709)273-3729