


OIL ANALYSIS REPORT





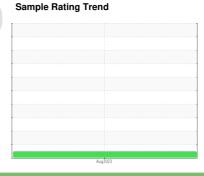

Recommendation

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DIESEL ENGINE OIL SAE 40. Please confirm.

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

•			,	Aug2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0800061		
Sample Date		Client Info		10 Aug 2023		
Machine Age	hrs	Client Info		323		
Oil Age	hrs	Client Info		7		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
-uel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>100	2		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>2	0		
Titanium	ppm	ASTM D5185(m)	>2	<1		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>25	1		
_ead	ppm	ASTM D5185(m)	>40	0		
Copper	ppm	ASTM D5185(m)	>330	<1		
Γin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
/anadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	372		
Barium	ppm	ASTM D5185(m)	10	0		
Molybdenum	ppm	ASTM D5185(m)	100	79		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	450	387		
Calcium	ppm	ASTM D5185(m)	3000	1433		
Phosphorus	ppm	ASTM D5185(m)	1150	1062		
Zinc	ppm	ASTM D5185(m)	1350	1168		
Sulfur	ppm	ASTM D5185(m)	4250	2806		
_ithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	6		
Sodium	ppm	ASTM D5185(m)	>216	2		
Potassium	ppm	ASTM D5185(m)	>20	2		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0		
Nitration	Abs/cm	ASTM D7624*	>20	4.3		
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.6		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	13.7		



OIL ANALYSIS REPORT

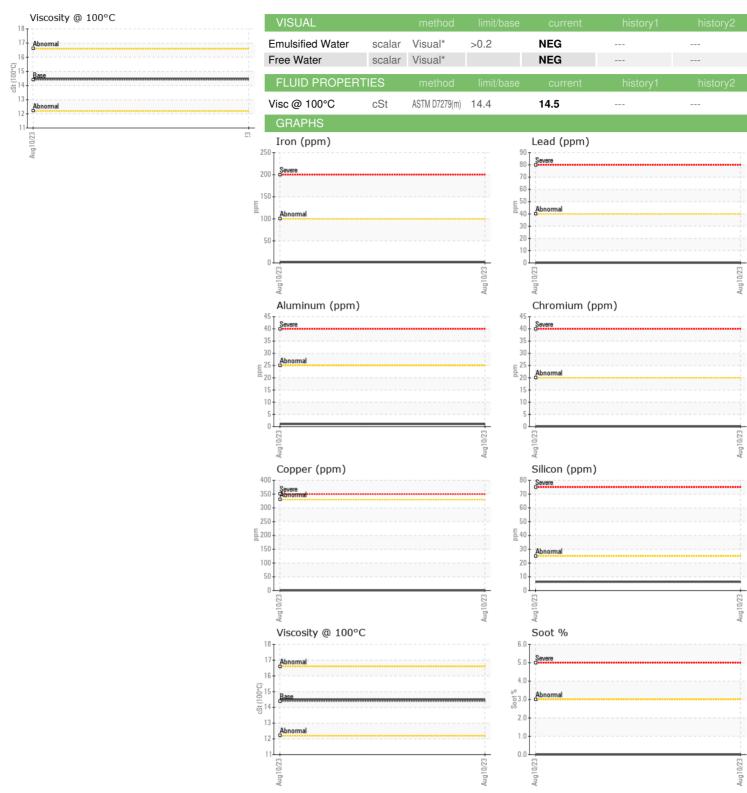





Laboratory Test Package : MOB 1

Sample No. Lab Number **Unique Number**

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0800061 : 02578427 : 5631487

Received Diagnosed Diagnostician

: 25 Aug 2023 : 25 Aug 2023 : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Standby Generator Service Inc

785 Westney Rd S #3 Ajax, ON **CA L1S 7G1** Contact: Jennifer info@standbygenerator.ca

> T: (905)428-0523 F: (905)428-7584