

PROBLEM SUMMARY

Sample Rating Trend

VISCOSITY




RAYTHEON YYZ RSE

Component

Reduction Gear

MOBIL SHC 629 (100 LTR)

COMPONENT CONDITION SUMMARY

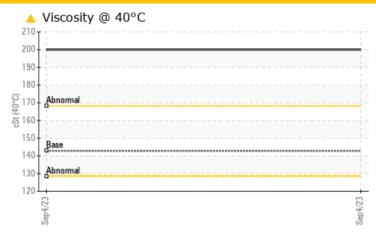

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status		ABNORMAL								
Visc @ 40°C	cSt	ASTM D7279(m)	142.8	<u>^</u> 200						

Customer Id: NAV605MIS Sample No.: WC785046 Lab Number: 02580521 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

VISCOSITY

RAYTHEON YYZ RSE

Component

Reduction Gear

MOBIL SHC 629 (100 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moor

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

Viscosity of sample indicates oil is within ISO 220 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
SAMPLE INFORMA	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC785046		
Sample Date		Client Info		04 Sep 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0		
Iron	ppm	ASTM D5185(m)	>150	1		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>100	0		
Copper	ppm	ASTM D5185(m)	>50	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		480		
Zinc	ppm	ASTM D5185(m)		3		
Sulfur	ppm	ASTM D5185(m)		28		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	21		
	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
FLUID DEGRADAT	TION	method	limit/base	current	history1	history2


0.53

Acid Number (AN)

mg KOH/g ASTM D974*



OIL ANALYSIS REPORT

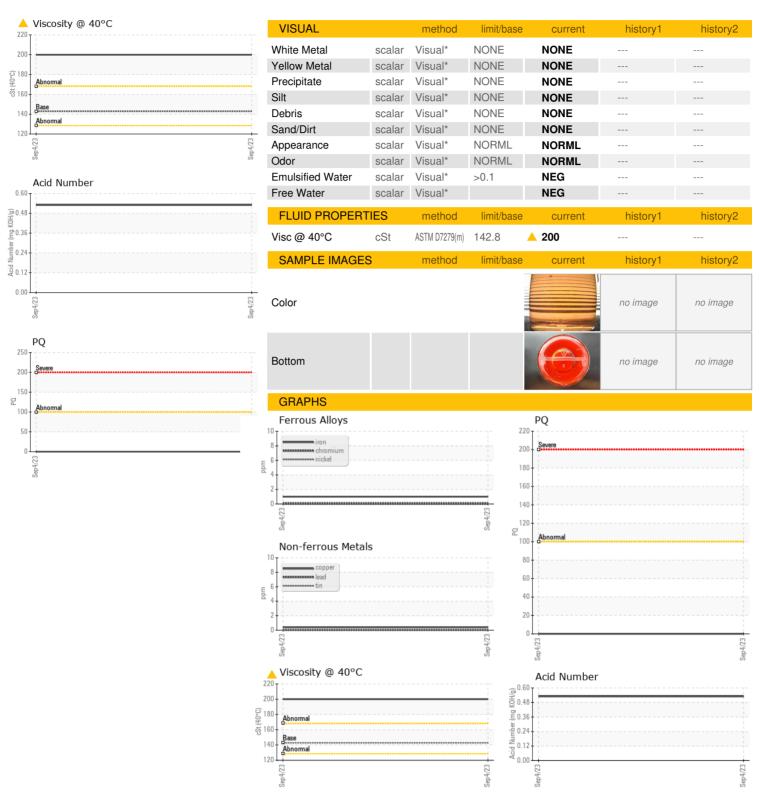



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: WC785046

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : 02580521

Received Diagnosed : 5633581

: 06 Sep 2023 : Kevin Marson Diagnostician

: 05 Sep 2023

Test Package : IND 2 (Additional Tests: TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

NAV CANADA

6110 MIDFIELD ROAD MISSISSAUGA, ON **CA L4W 2P7** Contact: Pat Soscia

pat.soscia@navcanada.ca T: (905)676-7540 F: (905)676-4654