




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**



Machine Id  
**NEW FLYER 1435**  
 Component  
**Natural Gas Engine**  
 Fluid  
**VALVOLINE PREMIUM BLUE 9200 15W40 (--- GAL)**

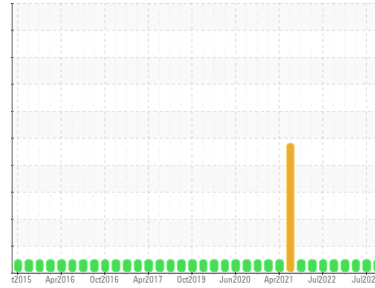

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0830295</b>	WC0830144	WC0811506
Sample Date	Client Info		<b>13 Oct 2023</b>	19 Jul 2023	20 Apr 2023
Machine Age	kms	Client Info	<b>569965</b>	550036	531656
Oil Age	kms	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >50	<b>13</b>	13	10
Chromium	ppm	ASTM D5185(m) >4	<b>&lt;1</b>	1	<1
Nickel	ppm	ASTM D5185(m) >2	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)	<b>0</b>	<1	1
Silver	ppm	ASTM D5185(m) >3	<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m) >9	<b>2</b>	2	2
Lead	ppm	ASTM D5185(m) >30	<b>3</b>	4	5
Copper	ppm	ASTM D5185(m) >35	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m) >4	<b>&lt;1</b>	<1	<1
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	<b>7</b>	8	11
Barium	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	<b>61</b>	59	56
Manganese	ppm	ASTM D5185(m)	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	<b>948</b>	956	867
Calcium	ppm	ASTM D5185(m)	<b>1426</b>	1398	1380
Phosphorus	ppm	ASTM D5185(m)	<b>791</b>	818	780
Zinc	ppm	ASTM D5185(m)	<b>1001</b>	978	912
Sulfur	ppm	ASTM D5185(m)	<b>2069</b>	2048	2055
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >+100	<b>4</b>	5	5
Sodium	ppm	ASTM D5185(m)	<b>4</b>	6	5
Potassium	ppm	ASTM D5185(m) >20	<b>0</b>	<1	1

## INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	<b>0</b>	0	0
Nitration	Abs/cm	ASTM D7624*	<b>&gt;20</b>	14.1	13.3
Sulfation	Abs/.1mm	ASTM D7415*	<b>&gt;30</b>	27.7	25.4

## FLUID DEGRADATION


	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	<b>&gt;25</b>	24.6	21.9

## VISUAL

	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	<b>&gt;0.1</b>	NEG	NEG
Free Water	scalar	Visual*	<b>NEG</b>	NEG	NEG











# OIL ANALYSIS REPORT

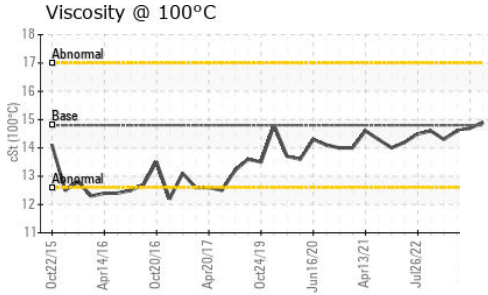

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	14.8	<b>14.9</b>	14.7	14.6

## GRAPHS

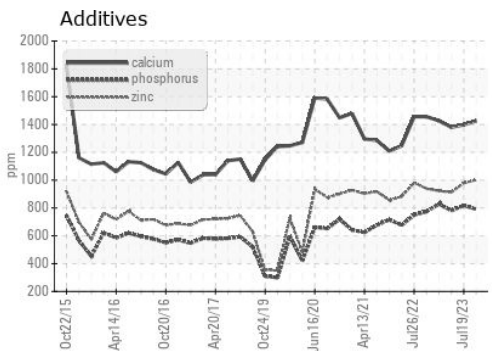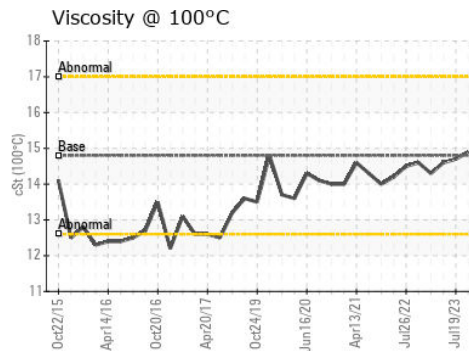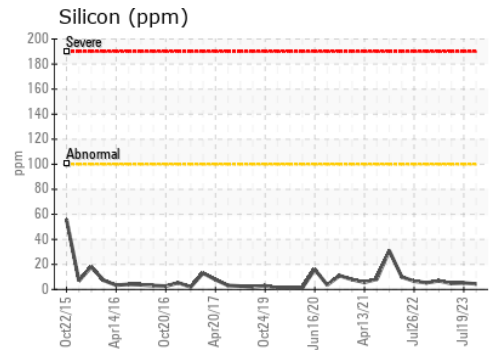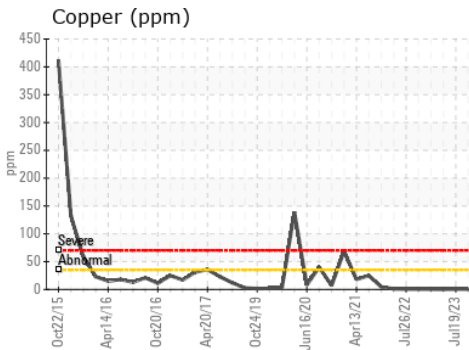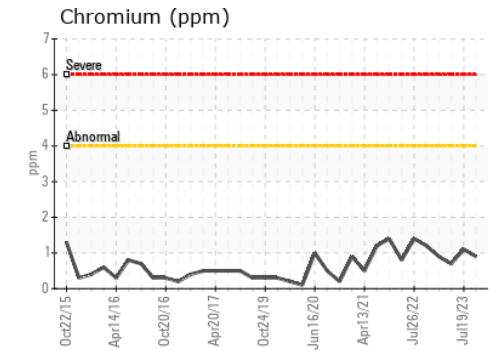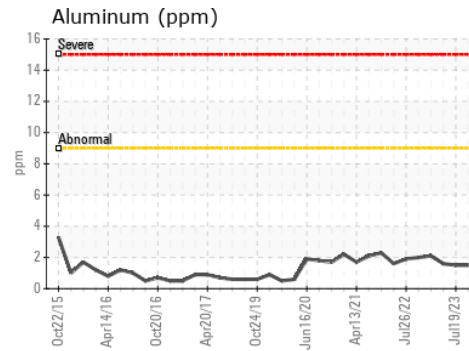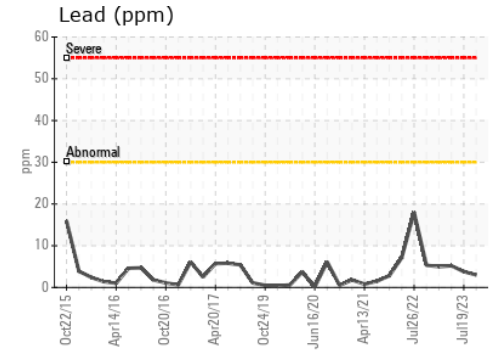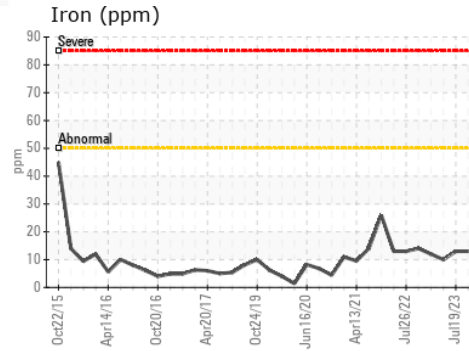

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
 Sample No. : WC0830295 Received : 18 Oct 2023  
 Lab Number : 02589915 Diagnosed : 18 Oct 2023  
 Unique Number : 5658981 Diagnostician : Wes Davis  
 Test Package : MOB 1

**CITY OF HAMILTON**  
 2200 UPPER JAMES., MOUNTAIN TRANSIT STOREROOM  
 MOUNT HOPE, ON  
 CA L0R 1W0  
 Contact: Jeff Parr  
 jeff.parr@hamilton.ca  
 T: (905)546-2424  
 F: (905)679-4502

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.