

BAY 16 SLT


PLANT 5

PROBLEM SUMMARY

Sample Rating Trend ISO

Component 2 Hydraulic System Fluid COMMERCIAL OIL LUBRIKO AW 46 (100 LTR)

COMPONENT CONDITION SUMMARY

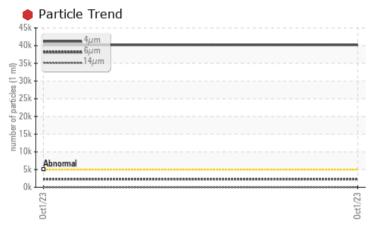

RECOMMENDATION

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please specify the component make and model with your next sample.

PROBLEMATIC TEST RESULTS									
Sample Status			SEVERE						
Particles >4µm	ASTM D7647	>5000	• 40201						
Particles >6µm	ASTM D7647	>1300	A 2303						
Oil Cleanliness	ISO 4406 (c)	>19/17/14	2 3/18/10						

Customer Id: TAYSTO Sample No.: WC0754620 Lab Number: 02589992 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			
Resample			?	Resample in 30-45 days to monitor this situation.			
Information Required			?	Please specify the component make and model with your next sample.			
Check Breathers			?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.			
Check Seals			?	Check seals and/or filters for points of contaminant entry.			

HISTORICAL DIAGNOSIS



PLANT 5

OIL ANALYSIS REPORT

Sample Rating Trend



BAY 16 SLT

2 Hydraulic System

COMMERCIAL OIL LUBRIKO AW 46 (100 LTR)

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0754620		
Sample Date		Client Info		01 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	7		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>10	<1		
Lead	ppm	ASTM D5185(m)	>10	<1		
Copper	ppm	ASTM D5185(m)	>75	5		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		2		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		9		
Calcium	ppm	ASTM D5185(m)		51		
Phosphorus	ppm	ASTM D5185(m)		268		
Zinc	ppm	ASTM D5185(m)		350		
Sulfur	ppm	ASTM D5185(m)		871		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	<1		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	0		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	40201		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>160	7		
Particles >21µm		ASTM D7647	>40	2		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	e 23/18/10		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.47		
3:29:35) Bev: 1	5 0				Submitted By: N	Aatthew Fischer

Report Id: TAYSTO [WCAMIS] 02589992 (Generated: 10/19/2023 08:29:35) Rev: 1

Submitted By: Matthew Fischer



Acid Number

0.50


(B/HOX Ê0.3


Pio 0.1


뗩

OIL ANALYSIS REPORT

VISUAL

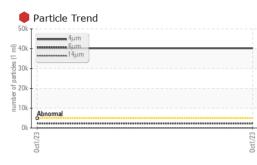

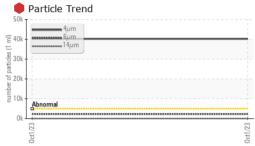

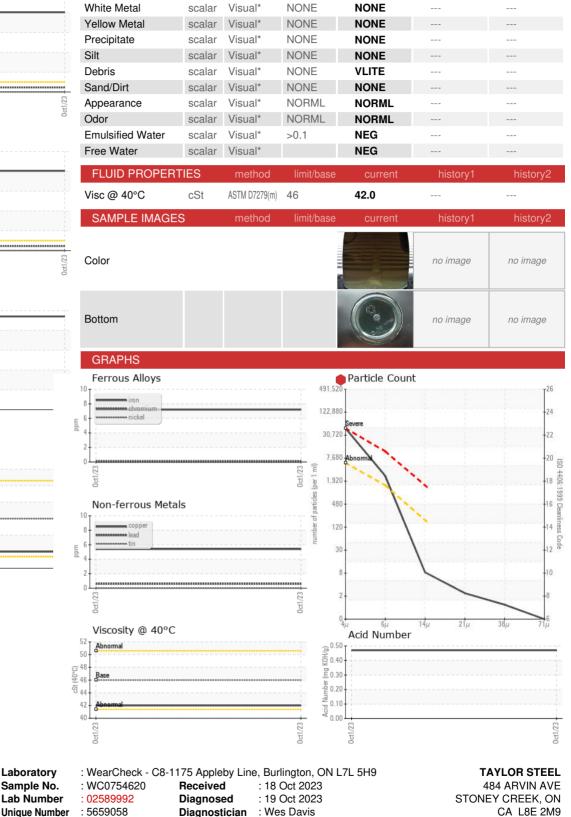

0.00 Viscosity @ 40°C 52 50 4 ()-0+ 46 ŝ 42 40 0ct1/23

> Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Submitted By: Matthew Fischer

Contact: George Campanaro

gcampanaro@taylorsteel.com

Page 4 of 4

T: (905)662-4925

F: (905)662-4928

CALA

ISO 17025:2017 Accredited

Laboratory

Laboratory

Sample No.

Lab Number