




PROBLEM SUMMARY

Sample Rating Trend

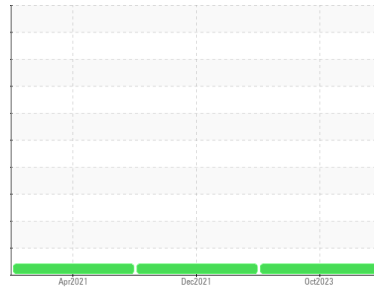


VISCOSITY



Machine Id
GENERAL ELECTRIC LLP#10 MOTOR (S/N 266905)
 Component
Bottom Bearing
 Fluid
PETRO CANADA TURBOFLO R&O 32 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Viscosity @ 40°C

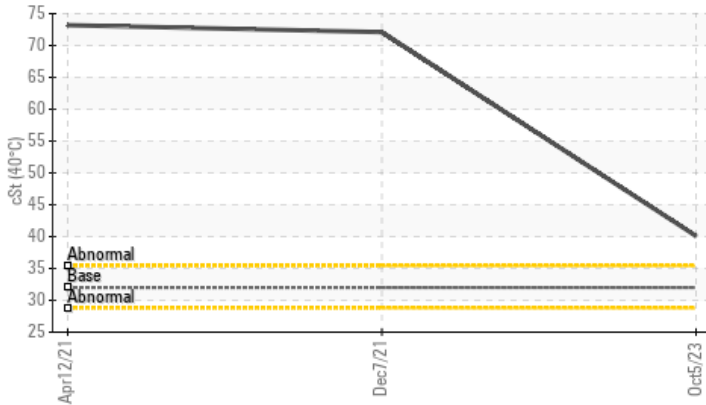

RECOMMENDATION

Resample at the next service interval to monitor.
 NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	ABNORMAL	ABNORMAL		
Visc @ 40°C	cSt	ASTM D7279(m)	32.0	▲ 40.1	▲ 72.1	▲ 73.2

Customer Id: ONT118MIS
 Sample No.: WC0862786
 Lab Number: 02590038
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
 Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Information Required	---	---	?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS

07 Dec 2021 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 68 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



12 Apr 2021 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 68 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report






OIL ANALYSIS REPORT

Sample Rating Trend

VISCOSITY



Machine Id
GENERAL ELECTRIC LLP#10 MOTOR (S/N 266905)
 Component
Bottom Bearing
 Fluid
PETRO CANADA TURBOFLO R&O 32 (--- GAL)

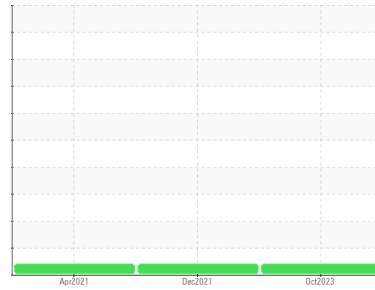

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.
 NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

Viscosity of sample indicates oil is within ISO 46 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0862786	WC0647446	WC0576417
Sample Date	Client Info	05 Oct 2023	07 Dec 2021	12 Apr 2021
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	Not Changd
Sample Status		ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

method	limit/base	current	history1	history2
PQ	ASTM D8184*	0	0	0
Iron	ppm	ASTM D5185(m) >20	<1	<1
Chromium	ppm	ASTM D5185(m) >20	0	0
Nickel	ppm	ASTM D5185(m) >20	<1	0
Titanium	ppm	ASTM D5185(m)	0	0
Silver	ppm	ASTM D5185(m)	<1	<1
Aluminum	ppm	ASTM D5185(m) >20	0	<1
Lead	ppm	ASTM D5185(m) >20	7	13
Copper	ppm	ASTM D5185(m) >20	<1	<1
Tin	ppm	ASTM D5185(m) >20	0	0
Antimony	ppm	ASTM D5185(m)	0	0
Vanadium	ppm	ASTM D5185(m)	0	0
Beryllium	ppm	ASTM D5185(m)	0	0
Cadmium	ppm	ASTM D5185(m)	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	<1
Barium	ppm	ASTM D5185(m)	<1	0
Molybdenum	ppm	ASTM D5185(m)	0	0
Manganese	ppm	ASTM D5185(m)	0	0
Magnesium	ppm	ASTM D5185(m)	0	0
Calcium	ppm	ASTM D5185(m) 0	5	<1
Phosphorus	ppm	ASTM D5185(m) 4	9	5
Zinc	ppm	ASTM D5185(m) 0	9	3
Sulfur	ppm	ASTM D5185(m)	173	131
Lithium	ppm	ASTM D5185(m)	<1	<1

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	4	2
Sodium	ppm	ASTM D5185(m)	0	0
Potassium	ppm	ASTM D5185(m) >20	0	<1


FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974* 0.15	0.07	0.08




OIL ANALYSIS REPORT


▲ Viscosity @ 40°C

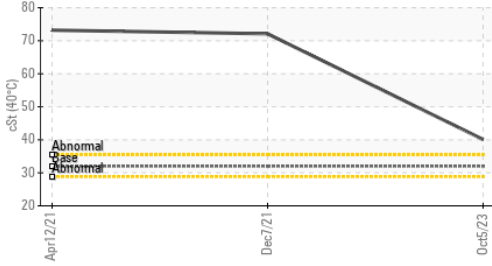

Acid Number

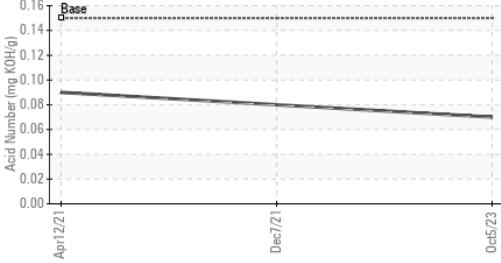


PQ

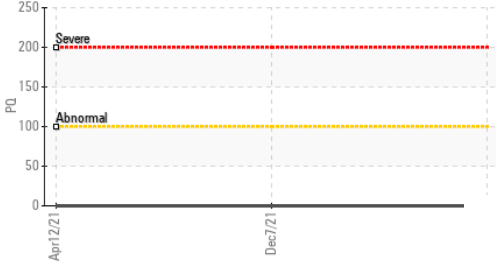






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	32.0 ▲ 40.1	▲ 72.1	▲ 73.2

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

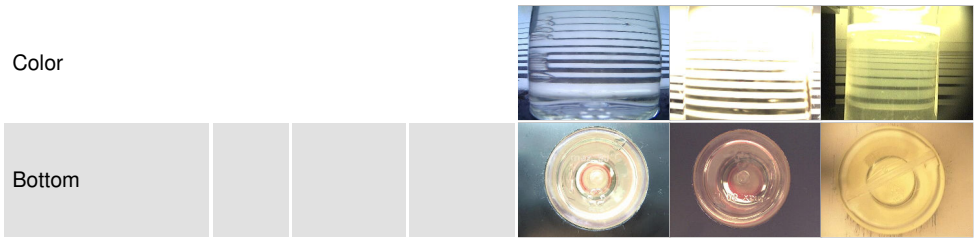

GRAPHS

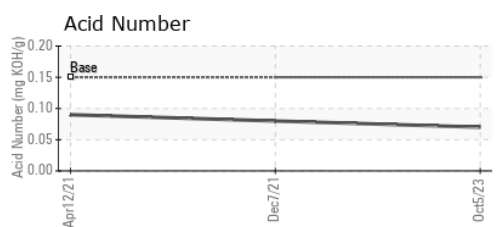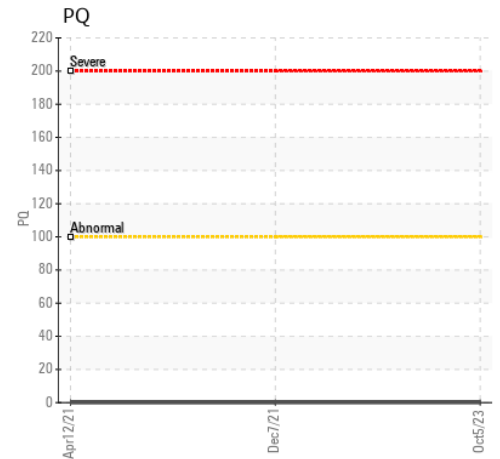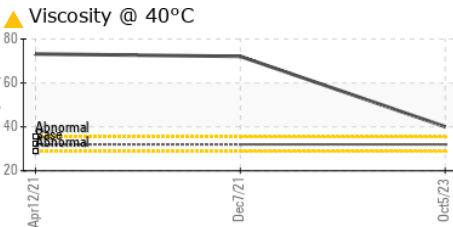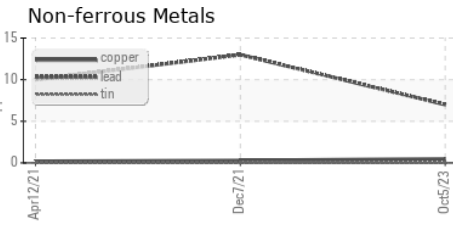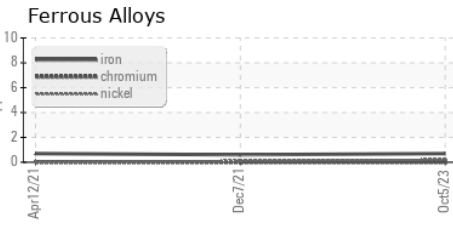

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0862786 **Received** : 18 Oct 2023
Lab Number : 02590038 **Diagnosed** : 19 Oct 2023
Unique Number : 5659104 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: TAN Man)

ONTARIO CLEAN WATER AGENCY
 1180 LAKESHORE RD. W, SOUTH PEEL FACILITIES - LORNE PARK
 MISSISSAUGA, ON
 CA L5E 1W6
 Contact: Radu Silaghi
 rsilaghi@ocwa.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: