




PROBLEM SUMMARY

Sample Rating Trend


ISO

Area
Hydraulic System in Plant [412789629]
 Machine Id
Hock Cutter #1 - Maximo #6139 - 1000029254
 Component
Hydraulic System
 Fluid
TOTAL FINA NEVASTANE FG AW 46 (10 GAL)

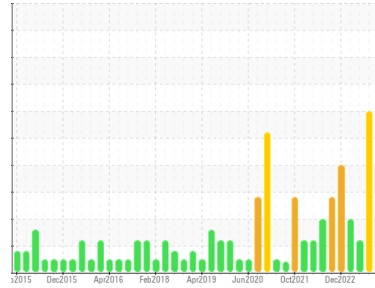

COMPONENT CONDITION SUMMARY

Particle Trend

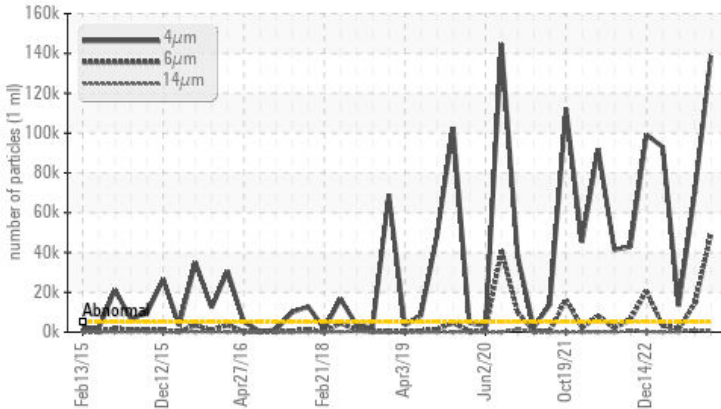

RECOMMENDATION

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation.

PROBLEMATIC TEST RESULTS

Sample Status			SEVERE	SEVERE	ABNORMAL
Particles >4µm	ASTM D7647	>5000	🔴 138717	🔴 70357	🟡 13371
Particles >6µm	ASTM D7647	>1300	🔴 49256	🔴 14549	🟡 1519
Particles >14µm	ASTM D7647	>160	🟡 388	🟡 1167	92
Oil Cleanliness	ISO 4406 (c)	>19/17/14	🔴 24/23/16	🔴 23/21/17	🟡 21/18/14

Customer Id: CARGUE
 Sample No.: WC0882212
 Lab Number: 02601062
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
 Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	Resample in 30-45 days to monitor this situation.
Check Breathers	---	---	?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.
Check Seals	---	---	?	Check seals and/or filters for points of contaminant entry.

HISTORICAL DIAGNOSIS

31 Aug 2023 Diag: Kevin Marson

ISO



We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. All component wear rates are normal. There is a high amount of particulates (2 to 100 microns in size) present in the oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



30 May 2023 Diag: Kevin Marson

ISO



We recommend you service the filters on this component. Confirm the source of the lubricant being utilized for top-up/fill. We recommend an early resample to monitor this condition. The fluid was specified as TOTAL FINA NEVASTANE FG AW 46, however, a fluid match indicates that this fluid is ISO 46 R&O Hydraulic Oil. Please confirm the oil type and grade on your next sample. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. Additive levels indicate the addition of a different brand, or type of oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report



19 Mar 2023 Diag: Kevin Marson

ISO



Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. All component wear rates are normal. Particles >4µm and oil cleanliness are severely high. Particles >6µm are abnormally high. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

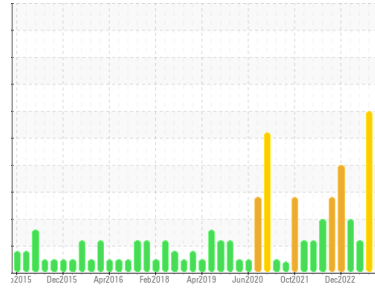

ISO



Area
Hydraulic System in Plant [412789629]
 Machine Id
Hock Cutter #1 - Maximo #6139 - 1000029254
 Component
Hydraulic System
 Fluid
TOTAL FINA NEVASTANE FG AW 46 (10 GAL)

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0882212	WC0812005	WC0807883
Sample Date	Client Info		24 Nov 2023	31 Aug 2023	30 May 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			SEVERE	SEVERE	ABNORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.05	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>20	9	4	2
Chromium	ppm	ASTM D5185(m)	>20	1	<1	0
Nickel	ppm	ASTM D5185(m)	>20	<1	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	0	<1
Lead	ppm	ASTM D5185(m)	>20	<1	0	0
Copper	ppm	ASTM D5185(m)	>20	1	<1	<1
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		<1	<1	0
Barium	ppm	ASTM D5185(m)		<1	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		0	0	0
Calcium	ppm	ASTM D5185(m)		<1	<1	0
Phosphorus	ppm	ASTM D5185(m)		97	97	95
Zinc	ppm	ASTM D5185(m)		17	19	6
Sulfur	ppm	ASTM D5185(m)		484	460	438
Lithium	ppm	ASTM D5185(m)		<1	<1	<1





CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>15	6	4	3
Sodium	ppm	ASTM D5185(m)		<1	<1	0
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	138717	70357	13371
Particles >6µm	ASTM D7647	>1300	49256	14549	1519
Particles >14µm	ASTM D7647	>160	388	1167	92
Particles >21µm	ASTM D7647	>40	27	346	31
Particles >38µm	ASTM D7647	>10	0	11	2
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	24/23/16	23/21/17	21/18/14

OIL ANALYSIS REPORT

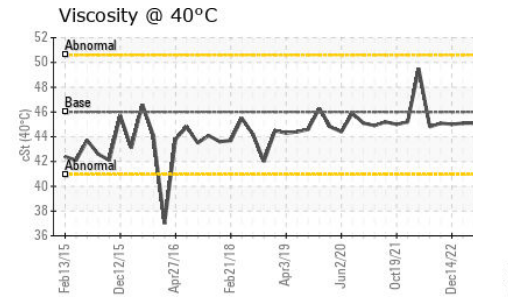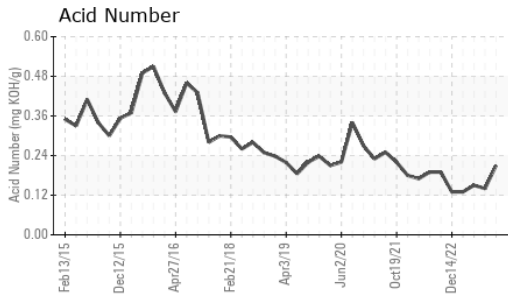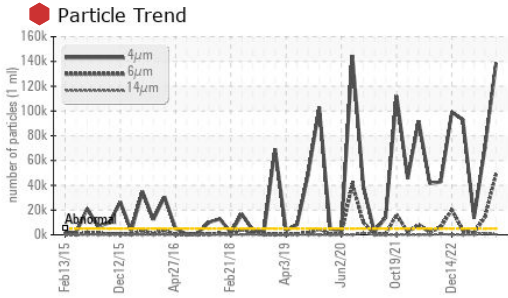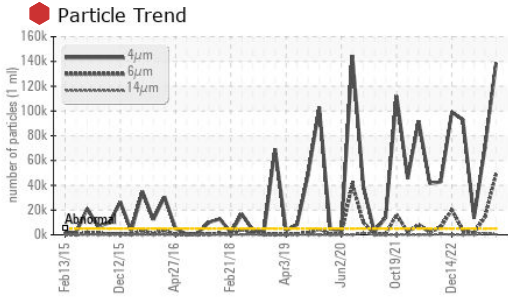


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.21	0.14	0.15





VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	VLITE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46	46.4	44.9	45.1

SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------

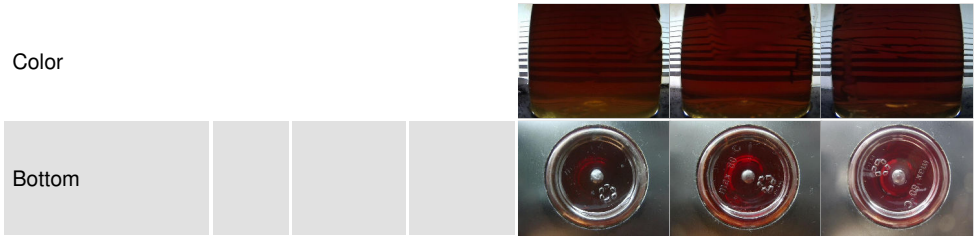

GRAPHS

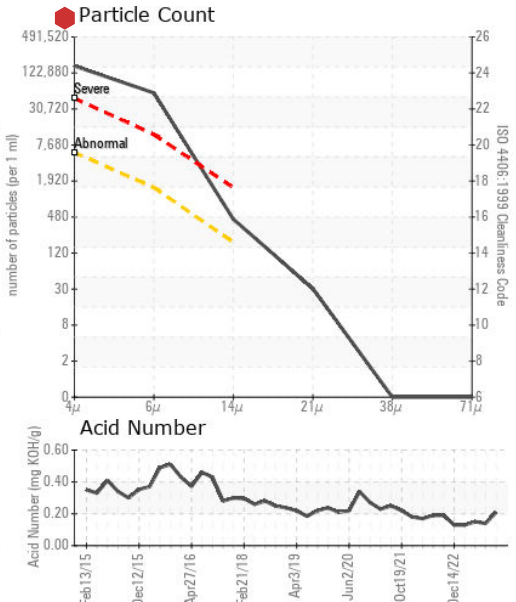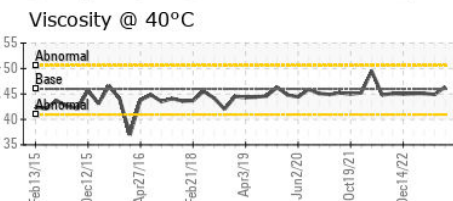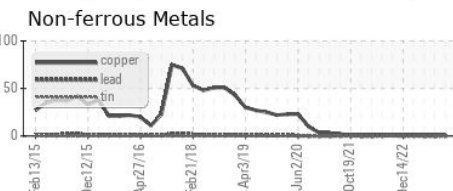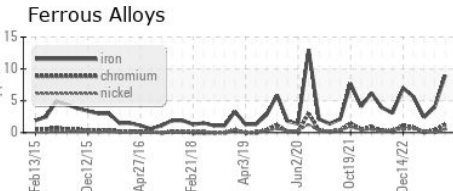

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0882212 **Received** : 05 Dec 2023
Lab Number : **02601062** **Diagnosed** : 07 Dec 2023
Unique Number : 5694147 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: TAN Man)

Cargill Meat Solutions
 165 Dunlop Drive
 Guelph, ON
 CA N1L 1P4
 Contact: Jakub Posluszny
 jakub_posluszny@cargill.com
 T: (519)823-5200
 F: (519)823-5893

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.