

OIL ANALYSIS REPORT

Sample Rating Trend

VISCOSITY

#1 Boiler Feed Pump Variable Speed Drive (S/N 43200-P -1)

Speed Reducer

ESSO NUTO H ISO 46 (650 LTR)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition.

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code.

Fluid Condition

Viscosity of sample indicates oil is within ISO 68 range, advise investigate. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

1 1 1																																	
1 1 1																																	
10.0																																	
1																																	
111																																	
10.00																																	
5355																																	
1000																																	
10.0																																	
COOK																																	
100																																	
1000																																	
E .																																	
-																																	
																ı	v	ď															
1																П		г															
			•													1		г	٠,	ï	٠,	ï											
888	11	ė.	ш	i	ń	ė	ò	'n	ï	Ť	Ť	Ť	Ť	Ť	'n	1		k	Н	h	١	h	'n	ï	Ť	Ť	Ť	Ť	Ť	ń	'n	Ť	١
12003	Ц	200	Ц	Ц	or20		I	1	120	Ī	I	1	I	1	00	l	1	I	1 p2	I	1	I	M:	Ļ	I	I	Ī	1	1	02	1	Ī	J

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0831829	WC0774118	WC0714808
Sample Date		Client Info		10 Jul 2023	17 Jan 2023	06 Sep 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>150	2	<1	<1
Chromium	ppm	ASTM D5185(m)	>10	0	0	0
Nickel	ppm	ASTM D5185(m)	>10	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	<1	<1
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>100	<1	0	<1
Copper	ppm	ASTM D5185(m)	>50	3	3	3
Tin	ppm	ASTM D5185(m)	>10	0	<1	0
Antimony	ppm	ASTM D5185(m)	>5	0	<1	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	2	<1	<1
Barium	ppm	ASTM D5185(m)	0	<1	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	5	<1	<1	<1
Calcium	ppm	ASTM D5185(m)	50	49	50	55
Phosphorus	ppm	ASTM D5185(m)	330	324	348	350
Zinc	ppm	ASTM D5185(m)	410	405	407	414
Sulfur	ppm	ASTM D5185(m)	2700	3349	2529	2549
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	2	<1	<1
Sodium	ppm	ASTM D5185(m)		1	<1	1
Potassium	ppm	ASTM D5185(m)	>20	0	0	<1
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	83626	9341	7328
Particles >6μm		ASTM D7647	>5000	<u> </u>	1461	1074
Particles >14µm		ASTM D7647	>640	145	77	32
Particles >21µm		ASTM D7647	>160	11	20	7
Particles >38µm		ASTM D7647	>40	0	0	1
Particles >71µm		ASTM D7647	>10	0	0	0
0'' 0' "		100 1100 ()	01110110		00110110	0011=110


ISO 4406 (c) >21/19/16 **424/22/14**

Oil Cleanliness

20/18/13



OIL ANALYSIS REPORT

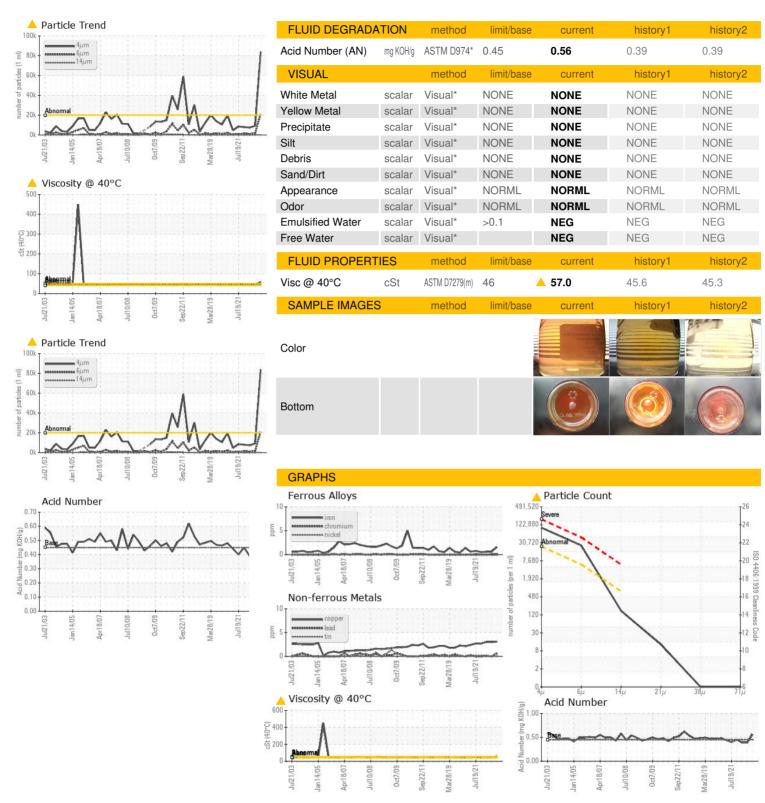



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: WC0831829

: 02604141 : 5697226

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved : 19 Dec 2023 Diagnosed

: 21 Dec 2023 Diagnostician : Kevin Marson

Test Package : IND 2 (Additional Tests: TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Ontario Power Generation ATIKOKAN T.G.S., BOX 1900

ATIKOKAN, ON CA POT 1C0 Contact: Dale Anthony

dale.anthony@opg.com T:

F: (807)597-1198

Report Id: ONTATI [WCAMIS] 02604141 (Generated: 12/21/2023 17:13:01) Rev: 1