

PROBLEM SUMMARY

Sample Rating Trend

VISCOSITY


ЭX

ROTARY AIR LOCK SILO #2 GEARBOX

Component **Gearbox**

MOBIL SHC 629 (--- GAL)

COMPONENT CONDITION SUMMARY

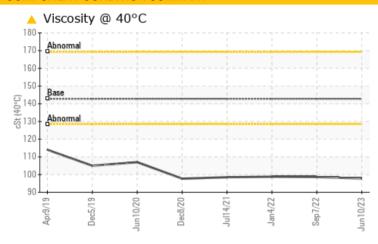

RECOMMENDATION

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Visc @ 40°C	cSt	ASTM D7279(m)	142.8	97.8	△ 98.6	△ 98.8

Customer Id: ONTATI Sample No.: WC0822020 Lab Number: 02604240 Test Package: IND 1

To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Information Required			?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS

07 Sep 2022 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The condition of the oil is acceptable for the time in service.



04 Jan 2022 Diag: Kevin Marson

VISCOSITY



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The condition of the oil is acceptable for the time in service.



14 Jul 2021 Diag: Kevin Marson

VISCOSITY



Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is no indication of any contamination in the oil. Viscosity of sample indicates oil is within ISO 100 range, advise investigate. This plus the additive levels indicates that this is not the same brand, or type of oil as reported. The condition of the oil is acceptable for the time in service.





OIL ANALYSIS REPORT

Sample Rating Trend

VISCOSITY

Machine Id

ROTARY AIR LOCK SILO #2 GEARBOX

Component

Gearbox

MOBIL SHC 629 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

Viscosity of sample indicates oil is within ISO 100 range, advise investigate. The condition of the oil is acceptable for the time in service.

		Apr2019 D	lec2019 Jun2020 Dec20	20 Jul2021 Jan2022 Sep2022	Jun2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0822020	WC0706919	WC0647151
Sample Date		Client Info		10 Jun 2023	07 Sep 2022	04 Jan 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	17	16	16
Chromium	ppm	ASTM D5185(m)	>15	0	0	<1
Nickel	ppm	ASTM D5185(m)	>15	0	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<1	0	<1
Lead	ppm	ASTM D5185(m)	>100	<1	0	0
Copper	ppm	ASTM D5185(m)	>200	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>25	0	0	0
Antimony	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		6	7	7
Barium	ppm	ASTM D5185(m)		<1	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)		0	0	0
Calcium	ppm	ASTM D5185(m)		3	3	4
Phosphorus	ppm	ASTM D5185(m)		820	917	903
Zinc	ppm	ASTM D5185(m)		12	12	12
Sulfur	ppm	ASTM D5185(m)		850	838	969
Lithium	ppm	ASTM D5185(m)		11	12	12
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	16	16	18
Sodium	ppm	ASTM D5185(m)		<1	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<1	0	<1




OIL ANALYSIS REPORT

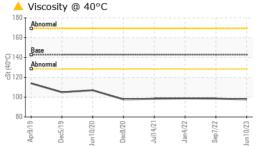

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	142.8	△ 97.8	▲ 98.6	▲ 98.8
SAMPLE IMAGES	3	method	limit/base	current	history1	history2
Color						

GRAPHS

Bottom

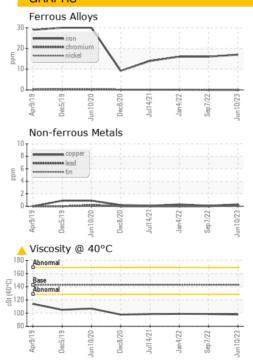



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number

Unique Number : 5697325

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0822020 : 02604240

Recieved : 19 Dec 2023 Diagnosed

: 19 Dec 2023 Diagnostician : Kevin Marson

Test Package : IND 1 To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Ontario Power Generation ATIKOKAN T.G.S., BOX 1900 ATIKOKAN, ON

CA POT 1C0 Contact: Dale Anthony dale.anthony@opg.com

F: (807)597-1198

Report Id: ONTATI [WCAMIS] 02604240 (Generated: 12/19/2023 15:35:06) Rev: 1

Page 4 of 4