

# **OIL ANALYSIS REPORT**

## Sample Rating Trend


# **WATER**



# Ottawa General Hosp. #7 **CARRIER 3405Q71735**

Chiller

**CASTROL AIRCOL SW 68 (--- GAL)** 

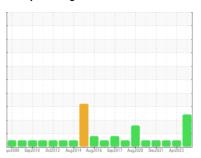



### DIAGNOSIS

#### Recommendation

If not recently done change any filter driers to reduce moisture level. We recommend an early resample to monitor this condition.

Tin ppm levels are noted. Bearing wear is indicated. All other component wear rates are normal.

#### Contamination

The elevated moisture content is associated with POE oils which are hygroscopic, and can absorb moisture from sampling and processing.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

7 00 ( GAL)		pr2008 Sep20	10 Oct2012 Aug2014 Au	g2016 Sep2017 Aug2020 Dec2021	Apr2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0001320	GTT11417	GTT11418
Sample Date		Client Info		10 Jul 2023	05 Apr 2023	05 Jul 2022
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	<1	<1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
Nickel	ppm	ASTM D5185(m)		0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>2	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>8	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>4	<b>3</b>	<1	<1
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	0		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	0	0		
Calcium	ppm	ASTM D5185(m)	0	0		
Phosphorus	ppm	ASTM D5185(m)	800	1883		
Zinc	ppm	ASTM D5185(m)	5	2	<1	<1
Sulfur	ppm	ASTM D5185(m)	10	0		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	16		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	0		
ppm Water	ppm	ASTM D6304*	>100	▲ 305	143	63
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
	1/011/	A OTA A DOZ 4+		0.00	0.000	0.045

Acid Number (AN)

mg KOH/g ASTM D974\* 0.05

0.022

0.08

0.015



# **OIL ANALYSIS REPORT**

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68	61.0		
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image
GRAPHS						



Sample No. : GTT0001320 Recieved : 28 Dec 2023 : 05 Jan 2024 : 02605658 Lab Number Diagnosed Unique Number : 5698743 Diagnostician : Bill Quesnel

Mississauga, ON CA L4W 4X3 Test Package : IND 2 (Additional Tests: KV40) Contact: Brian Raymundo To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26. Brian.Raymundo@carrier.com

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

F:

Report Id: GTT0000224 [WCAMIS] 02605658 (Generated: 01/08/2024 08:21:51) Rev: 1

T:

**Carrier Commerical Service** 

C/O Conduent Div of Carrier Canada, 1-2740 Matheson Blvd