

OIL ANALYSIS REPORT

Sample Rating Trend






Praxair #1 T1500 **CARRIER 2999J59819**

Chiller

CASTROL AIRCOL SW 68 (--- GAL)

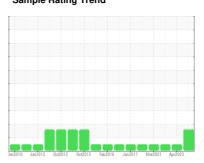



DIAGNOSIS

Recommendation

If not recently done change any filter driers to reduce moisture level. We recommend an early resample to monitor this condition.

All component wear rates are normal.

Contamination

There is a moderate concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORM	MOITAN	method	limit/base	current	history1	history2
		Client Info	minu bass	GTT0001365	GTT10225	GTT10226
Sample Number Sample Date		Client Info		14 Jun 2023	05 Apr 2023	07 Dec 2021
Machine Age	hrs	Client Info		0	05 Apr 2023	07 Dec 2021
Oil Age	hrs	Client Info		0		
Oil Changed	1115	Client Info		N/A	N/A	N/A
Sample Status		Ciletit iiiio		ABNORMAL	NORMAL	NORMAL
·				ABNORMAL	NONWAL	NONIVIAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	0	<1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
Nickel	ppm	ASTM D5185(m)		0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>2	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>8	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>4	0	<1	<1
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	0		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	0	0		
Calcium	ppm	ASTM D5185(m)	0	0		
Phosphorus	ppm	ASTM D5185(m)	800	1837		
Zinc	ppm	ASTM D5185(m)	5	<1	<1	<1
Sulfur	ppm	ASTM D5185(m)	10	0		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	2		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	0		
ppm Water	ppm	ASTM D6304*	>100	<u>^</u> 271	65	100
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.05	0.06	0.030	0.007



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68	64.3		
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



Sample No. : GTT0001365 Recieved : 28 Dec 2023 : 02605668 Lab Number Diagnosed : 06 Jan 2024 Unique Number : 5698753 Diagnostician : Bill Quesnel

Mississauga, ON CA L4W 4X3 Test Package : IND 2 (Additional Tests: KV40) Contact: Brian Raymundo To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26. Brian.Raymundo@carrier.com T:

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

F:

Report Id: GTT0000224 [WCAMIS] 02605668 (Generated: 01/08/2024 08:23:15) Rev: 1

Carrier Commerical Service

C/O Conduent Div of Carrier Canada, 1-2740 Matheson Blvd