



OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Area
MINI EXCAVATION ERIC BONIN INC [02610059]
Machine Id
TAKEUCHI TB240R 124007551

Component
Hydraulic System
Fluid
PANOLIN HLP SYNTH 46 (79 LTR)



DIAGNOSIS

Recommendation

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une faible concentration (<5.0%) d'huile minérale présente dans le fluide. La propreté du système est acceptable pour votre objectif de propreté ISO 4406. La teneur en eau est négligeable. La propreté du système et du fluide est acceptable.

Fluid Condition

Le AN est acceptable pour ce fluide. L'état de l'huile permet d'en prolonger l'utilisation.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC	---	---
Sample Date	Client Info		12 Jan 2024	---	---
Machine Age	hrs	Client Info	5	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			NORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	0	---
Chromium	ppm	ASTM D5185(m)	>10	0	---
Nickel	ppm	ASTM D5185(m)	>10	<1	---
Titanium	ppm	ASTM D5185(m)		0	---
Silver	ppm	ASTM D5185(m)		0	---
Aluminum	ppm	ASTM D5185(m)	>10	<1	---
Lead	ppm	ASTM D5185(m)	>10	0	---
Copper	ppm	ASTM D5185(m)	>75	<1	---
Tin	ppm	ASTM D5185(m)	>10	0	---
Antimony	ppm	ASTM D5185(m)		0	---
Vanadium	ppm	ASTM D5185(m)		0	---
Beryllium	ppm	ASTM D5185(m)		0	---
Cadmium	ppm	ASTM D5185(m)		0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	<1	---
Barium	ppm	ASTM D5185(m)	0	0	---
Molybdenum	ppm	ASTM D5185(m)	0	0	---
Manganese	ppm	ASTM D5185(m)	0	0	---
Magnesium	ppm	ASTM D5185(m)	0	<1	---
Calcium	ppm	ASTM D5185(m)	0	<1	---
Phosphorus	ppm	ASTM D5185(m)	1700	1633	---
Zinc	ppm	ASTM D5185(m)	0	1	---
Sulfur	ppm	ASTM D5185(m)	1350	1457	---
Lithium	ppm	ASTM D5185(m)		<1	---

CONTAMINANTS






	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	<1	---
Sodium	ppm	ASTM D5185(m)		0	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---
Water	%	ASTM D6304*	>0.05	0.027	---
ppm Water	ppm	ASTM D6304*	>500	278	---

INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*		0	---
Nitration	Abs/cm	ASTM D7624*		4.1	---
Sulfation	Abs/.1mm	ASTM D7415*		155.1	---
Mineral Oil Content	%	ASTM D7418*	<5.0%	<5.0	---



OIL ANALYSIS REPORT

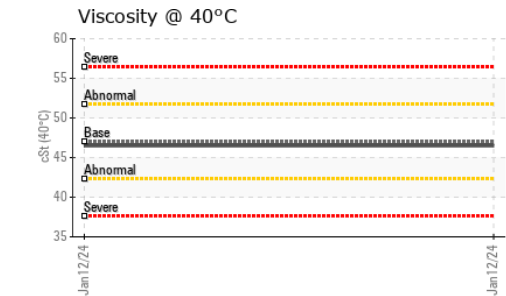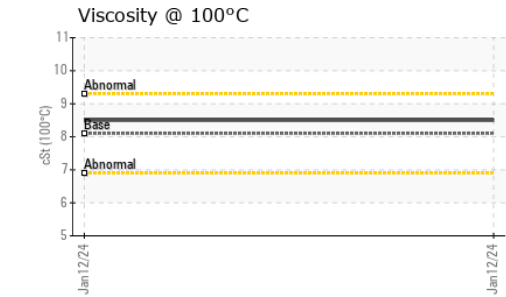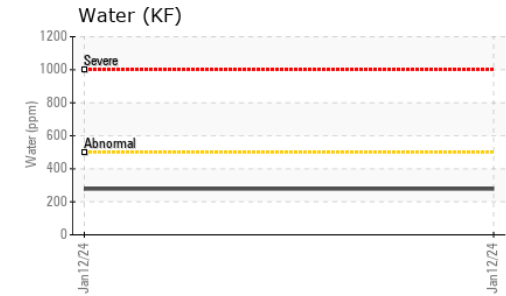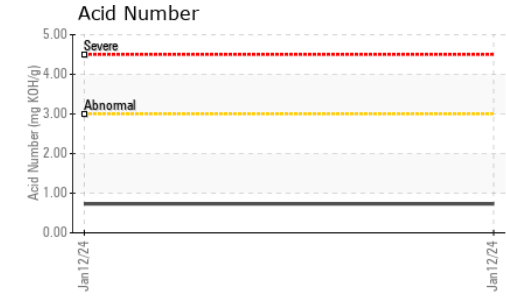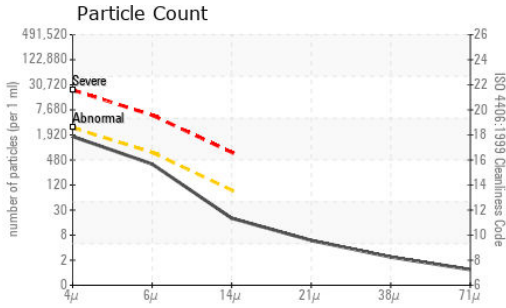

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>2500	1543	---	---
Particles >6µm	ASTM D7647	>640	337	---	---
Particles >14µm	ASTM D7647	>80	17	---	---
Particles >21µm	ASTM D7647	>20	5	---	---
Particles >38µm	ASTM D7647	>4	2	---	---
Particles >71µm	ASTM D7647	>3	1	---	---
Oil Cleanliness	ISO 4406 (c)	>18/16/13	18/16/11	---	---

FLUID DEGRADATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm ASTM D7414*		154.8	---	---
Acid Number (AN)	mg KOH/g ASTM D974*		0.73	---	---

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar Visual*	NONE	NONE	---	---
Yellow Metal	scalar Visual*	NONE	NONE	---	---
Precipitate	scalar Visual*	NONE	NONE	---	---
Silt	scalar Visual*	NONE	NONE	---	---
Debris	scalar Visual*	NONE	NONE	---	---
Sand/Dirt	scalar Visual*	NONE	NONE	---	---
Appearance	scalar Visual*	NORML	NORML	---	---
Odor	scalar Visual*	NORML	NORML	---	---
Emulsified Water	scalar Visual*	>0.05	NEG	---	---
Free Water	scalar Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D7279(m)	47.0	46.5	---	---
Visc @ 100°C	cSt ASTM D7279(m)	8.1	8.5	---	---
Viscosity Index (VI)	Scale ASTM D2270*	146	161	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
 Sample No. : WC
 Lab Number : **02610060**
 Unique Number : 5711146
 Test Package : MOB 2 (Additional Tests: TAN Man)

Received : 19 Jan 2024
 Tested : 22 Jan 2024
 Diagnosed : 22 Jan 2024 - Bill Quesnel

Envirolin Canada
 520 rue Adanac
 Quebec, QC
 CA G1C 7B7
 Contact: Patrick Levesque
 patrick.levesque@envirolin.com
 T: (418)623-1216
 F: (418)660-8889

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.



MINERAL OIL CONTENT REPORT

PASS




Area
MINI EXCAVATION ERIC BONIN INC [02610059]
 Machine Id
TAKEUCHI TB240R 124007551
 Component
Hydraulic System
 Fluid
PANOLIN HLP SYNTH 46 (79 LTR)


SPECTRAL ANALYSIS

		method	limit/base	current	history1	history2
Zinc	ppm	ASTM D5185(m)	0	1	---	---
Mineral Oil Content	%	ASTM D7418*	<5.0%	<5.0	---	---


FT-IR - Esters I

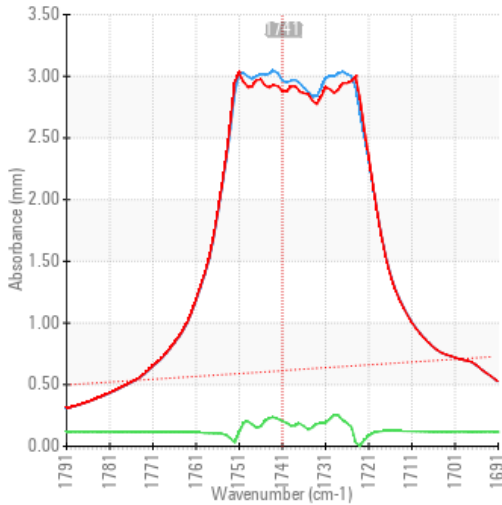

FT-IR - Esters II

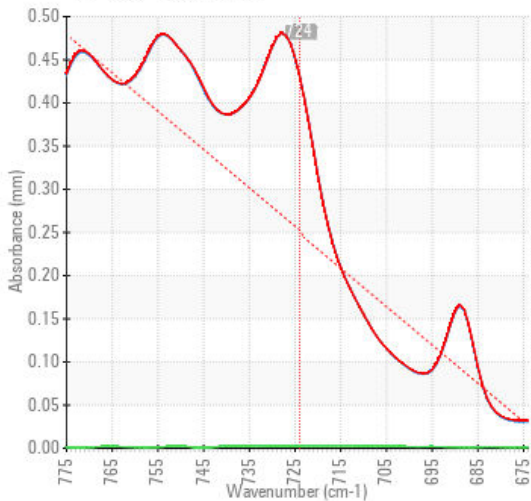

FT-IR Spectrum (Absorbance)

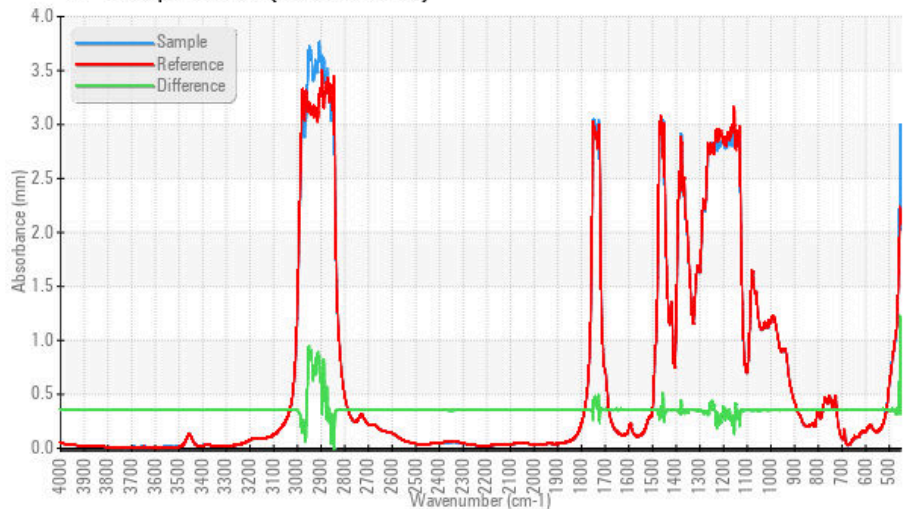

ISO 17025:2017
 Accredited
 Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC
Lab Number : 02610060
Unique Number : 5711146
Test Package : MOB 2 (Additional Tests: TAN Man)
Received : 19 Jan 2024
Tested : 22 Jan 2024
Diagnosed : 22 Jan 2024 - Bill Quesnel

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

EnviroLin Canada

520 rue Adanac
 Quebec, QC
 CA G1C 7B7
 Contact: Patrick Levesque
 patrick.levesque@envirolin.com
 T: (418)623-1216
 F: (418)660-8889

This page left intentionally blank