


OIL ANALYSIS REPORT



ORIN CONTRACTORS

Component **Swing Drive**

PETRO CANADA 30W (

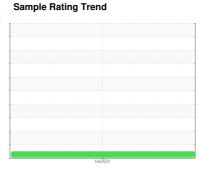



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The condition of the oil is acceptable for the time in service.

(GAL)			Feb 2024			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0899392		
Sample Date		Client Info		29 Feb 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.25	NEG		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>1200	81		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
_ead	ppm	ASTM D5185(m)	>50	0		
Copper	ppm	ASTM D5185(m)	>50	4		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		229		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		56		
Calcium	ppm	ASTM D5185(m)		81		
Phosphorus	ppm	ASTM D5185(m)		1022		
Zinc	ppm	ASTM D5185(m)		83		
Sulfur	ppm	ASTM D5185(m)		17063		
_ithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>100	10		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

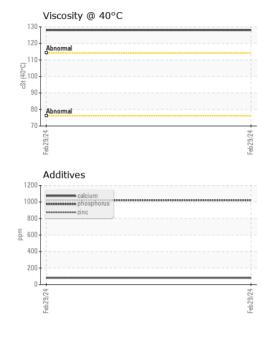

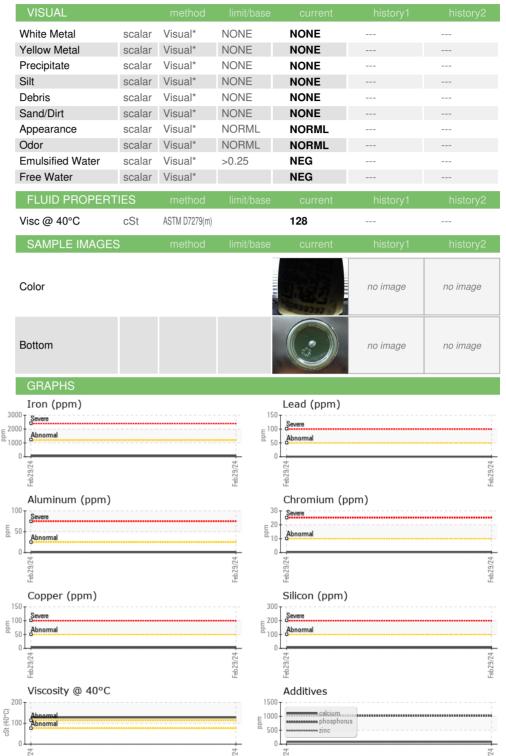



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number : 02621168

: WC0899392

Received **Tested** Unique Number : 5746287 Diagnosed

: 11 Mar 2024 : 11 Mar 2024

: 11 Mar 2024 - Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. 100 MACINTOSH BLVD VAUGHAN, ON

CA L4K 4P3 Contact: Service Team service.team@roni.ca

Test Package : MOBCE (Additional Tests: Visual) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: