



OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Area
SOCIÉTÉ DES TRAVERSIERS DU QUÉBEC [02591887]

Machine Id
HPU

Component
Hydraulic System

Fluid
PANOLIN HLP SYNTH 32 (--- LTR)



DIAGNOSIS

Recommendation

Nous recommandons le remplacement des filtres de ce composant. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation. Veuillez préciser la marque et le modèle du composant lors du prochain échantillon.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une quantité modérée de particules (de 4 à 14 microns) dans l'huile. Il y a une faible concentration (<5.0%) d'huile minérale présente dans le fluide. La teneur en eau est négligeable. La propreté du système est supérieure à la limite acceptable pour votre objectif de propreté ISO 4406.

Fluid Condition

Le AN est acceptable pour ce fluide. l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0893432	---	---
Sample Date	Client Info		10 Mar 2024	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1	---
Chromium	ppm	ASTM D5185(m)	>10	<1	---
Nickel	ppm	ASTM D5185(m)	>10	<1	---
Titanium	ppm	ASTM D5185(m)		0	---
Silver	ppm	ASTM D5185(m)		0	---
Aluminum	ppm	ASTM D5185(m)	>10	<1	---
Lead	ppm	ASTM D5185(m)	>10	0	---
Copper	ppm	ASTM D5185(m)	>75	<1	---
Tin	ppm	ASTM D5185(m)	>10	0	---
Antimony	ppm	ASTM D5185(m)		0	---
Vanadium	ppm	ASTM D5185(m)		0	---
Beryllium	ppm	ASTM D5185(m)		0	---
Cadmium	ppm	ASTM D5185(m)		0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	0	---
Barium	ppm	ASTM D5185(m)	0	0	---
Molybdenum	ppm	ASTM D5185(m)	0	0	---
Manganese	ppm	ASTM D5185(m)	0	0	---
Magnesium	ppm	ASTM D5185(m)	0	<1	---
Calcium	ppm	ASTM D5185(m)	5	6	---
Phosphorus	ppm	ASTM D5185(m)	1500	1322	---
Zinc	ppm	ASTM D5185(m)	0	41	---
Sulfur	ppm	ASTM D5185(m)	1450	1641	---
Lithium	ppm	ASTM D5185(m)		<1	---

CONTAMINANTS






	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	1	---
Sodium	ppm	ASTM D5185(m)		<1	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---
Water	%	ASTM D6304*	>0.05	0.019	---
ppm Water	ppm	ASTM D6304*	>500	191	---

INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*		0	---
Nitration	Abs/cm	ASTM D7624*		3.6	---
Sulfation	Abs/.1mm	ASTM D7415*		154.5	---
Mineral Oil Content	%	ASTM D7418*	<5.0%	<5.0	---



OIL ANALYSIS REPORT

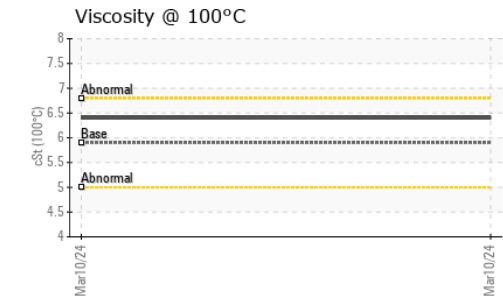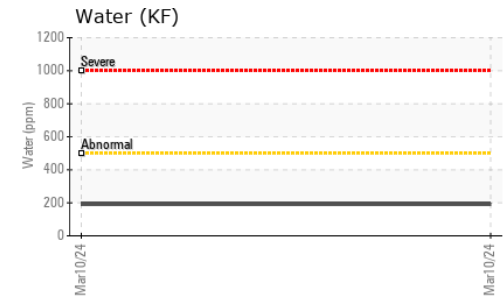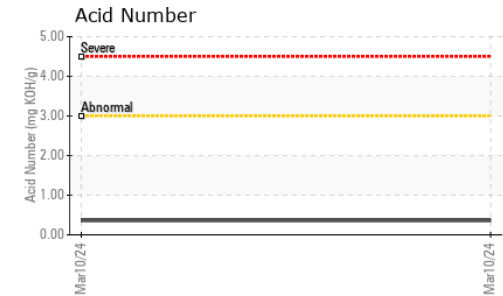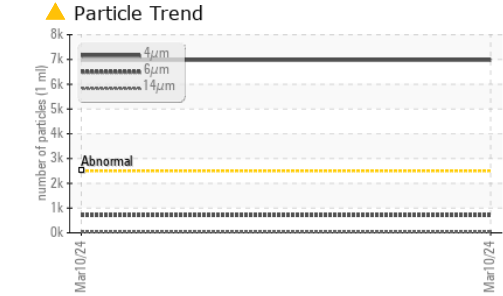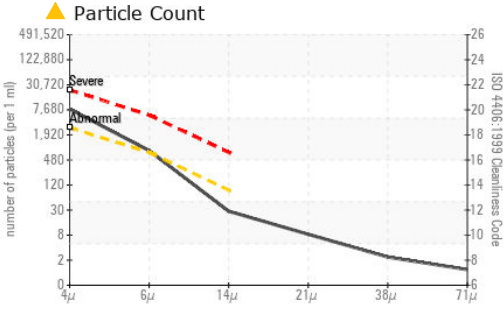

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0893432 **Received** : 11 Mar 2024
Lab Number : **02621279** **Tested** : 12 Mar 2024
Unique Number : 5746398 **Diagnosed** : 12 Mar 2024 - Bill Quesnel
Test Package : MOB 2 (Additional Tests: TAN Man)



To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>2500	▲ 6977	---	---
Particles >6µm	ASTM D7647	>640	● 707	---	---
Particles >14µm	ASTM D7647	>80	25	---	---
Particles >21µm	ASTM D7647	>20	7	---	---
Particles >38µm	ASTM D7647	>4	2	---	---
Particles >71µm	ASTM D7647	>3	1	---	---
Oil Cleanliness	ISO 4406 (c)	>18/16/13	▲ 20/17/12	---	---

FLUID DEGRADATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm ASTM D7414*		146.9	---	---
Acid Number (AN)	mg KOH/g ASTM D974*		0.36	---	---

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar Visual*	NONE	NONE	---	---
Yellow Metal	scalar Visual*	NONE	NONE	---	---
Precipitate	scalar Visual*	NONE	NONE	---	---
Silt	scalar Visual*	NONE	NONE	---	---
Debris	scalar Visual*	NONE	NONE	---	---
Sand/Dirt	scalar Visual*	NONE	NONE	---	---
Appearance	scalar Visual*	NORML	NORML	---	---
Odor	scalar Visual*	NORML	NORML	---	---
Emulsified Water	scalar Visual*	>0.05	NEG	---	---
Free Water	scalar Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D7279(m)	30.6	32.6	---	---
Visc @ 100°C	cSt ASTM D7279(m)	5.9	6.4	---	---
Viscosity Index (VI)	Scale ASTM D2270*	140	152	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image



MINERAL OIL CONTENT REPORT

PASS



Area
SOCIETE DES TRAVERSIERS DU QUEBEC [02591887]

Machine Id
HPU


Component
Hydraulic System

Fluid
PANOLIN HLP SYNTH 32 (--- LTR)


SPECTRAL ANALYSIS

		method	limit/base	current	history1	history2
Zinc	ppm	ASTM D5185(m)	0	41	---	---
Mineral Oil Content	%	ASTM D7418*	<5.0%	<5.0	---	---


FT-IR - Esters I

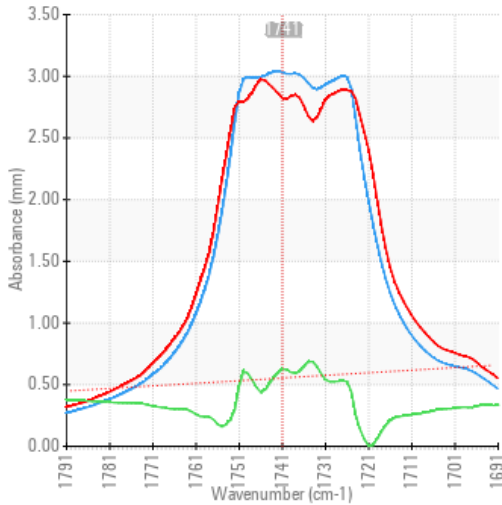

FT-IR - Esters II

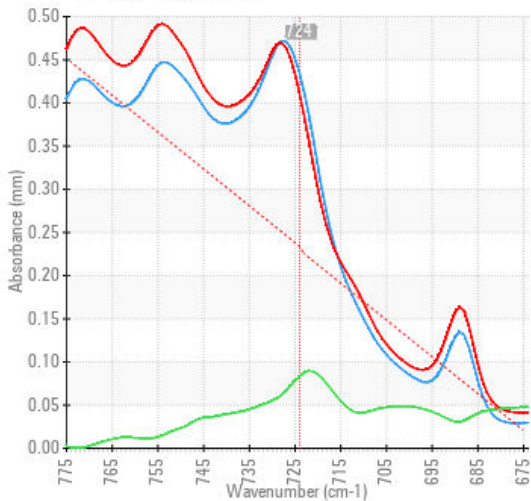

FT-IR Spectrum (Absorbance)

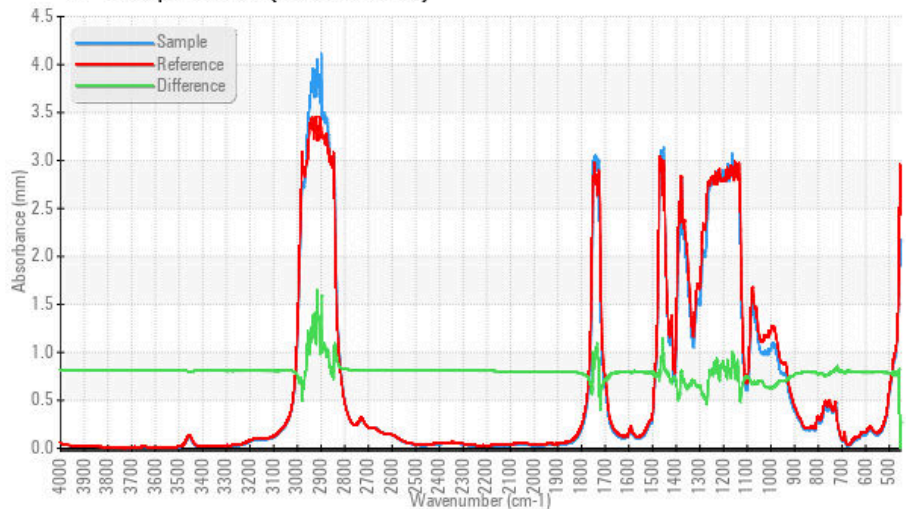

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0893432 **Received** : 11 Mar 2024
Lab Number : 02621279 **Tested** : 12 Mar 2024
Unique Number : 5746398 **Diagnosed** : 12 Mar 2024 - Bill Quesnel
Test Package : MOB 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

Envirolin Canada

520 rue Adanac
Quebec, QC
CA G1C 7B7

Contact: Patrick Levesque
patrick.levesque@envirolin.com

T: (418)623-1216
F: (418)660-8889

This page left intentionally blank