




PROBLEM SUMMARY

Machine Id SR1-6 Component Gearbox GEAR OIL ISO 150 (--- GAL)



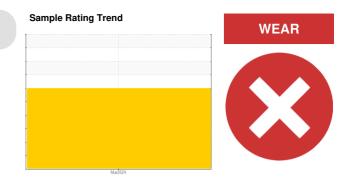

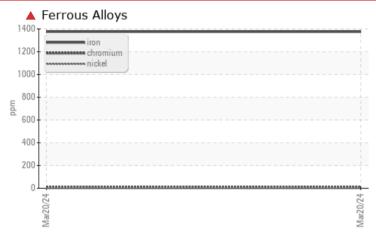

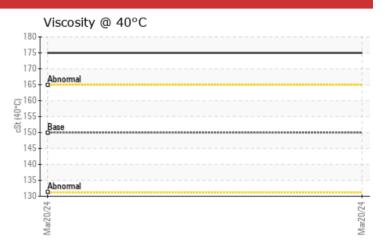

RECOMMENDATION

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL ISO 150. Please confirm. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS								
Sample Status				SEVERE				
Iron	ppm	ASTM D5185(m)	>200	1375				

Customer Id: EMFMIS Sample No.: WC0909081 Lab Number: 02623854 Test Package: IND 1

To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	We recommend that you drain the oil from the component if this has not already been done.			
Resample			?	We recommend an early resample to monitor this condition.			
Alert			?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.			
Information Required			?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



SR1-6 Component

Machine Id

Gearbox

GEAR OIL ISO 150 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL ISO 150. Please confirm. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Iron ppm levels are severe. The low ferrous density (PQ) index indicates the wear metal levels are due to corrosion.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The oil viscosity is higher than typical. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

		-		Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0909081		
Sample Date		Client Info		20 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		40		
Iron	ppm	ASTM D5185(m)	>200	1375		
Chromium	ppm	ASTM D5185(m)	>15	8		
Nickel	ppm	ASTM D5185(m)	>15	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	0		
Lead	ppm	ASTM D5185(m)	>100	0		
Copper	ppm	ASTM D5185(m)	>200	2		
Tin	ppm	ASTM D5185(m)	>25	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	50	12		
Barium	ppm	ASTM D5185(m)	15	5		
Molybdenum	ppm	ASTM D5185(m)	15	0		
Manganese	ppm	ASTM D5185(m)		16		
Magnesium	ppm	ASTM D5185(m)	50	0		
Calcium	ppm	ASTM D5185(m)	50	5		
Phosphorus	ppm	ASTM D5185(m)	350	289		
Zinc	ppm	ASTM D5185(m)	100	12		
Sulfur	ppm	ASTM D5185(m)	12500	13070		
Lithium	ppm	ASTM D5185(m)		1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	4		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	0		



OIL ANALYSIS REPORT

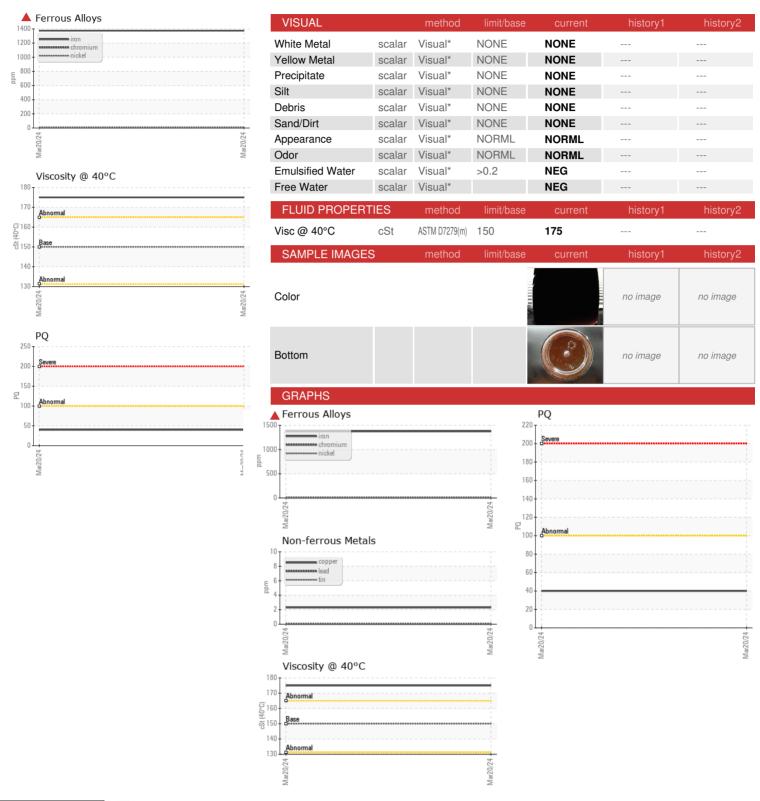



CALA ISO 17025:2017 Accredited Laboratory

Laboratory

Sample No. Lab Number Unique Number : 5748973

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0909081 : 02623854

Diagnosed Test Package : IND 1 (Additional Tests: PQ)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

: 21 Mar 2024

: 21 Mar 2024

: 21 Mar 2024 - Kevin Marson

Received

Tested

EMF ELECTRICAL SERVICES

2690 SLOUGH STREET MISSISSAUGA, ON **CA L4T 1G3** Contact: Wilson

Wilson@emfelectrical.ca T: (905)405-8836