


OIL ANALYSIS REPORT

ORIN CONTRACTORS **216**

Component

Left Gearbox

PETRO CANADA ENDURATEX EP 150 (--- GAL)

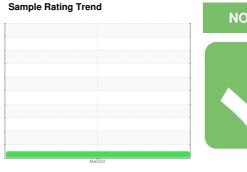



Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition


Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

GAL)				Mar2024		
SAMPLE INFORM	//ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0899459		
Sample Date		Client Info		12 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	33		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	2		
Lead	ppm	ASTM D5185(m)	>50	0		
Copper	ppm	ASTM D5185(m)	>200	3		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	55	245		
Barium	ppm	ASTM D5185(m)	0	<1		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	2	4		
Calcium	ppm	ASTM D5185(m)	6	10		
Phosphorus	ppm	ASTM D5185(m)	250	918		
Zinc	ppm	ASTM D5185(m)	3	17		
Sulfur	ppm	ASTM D5185(m)	7500	15383		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	26		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

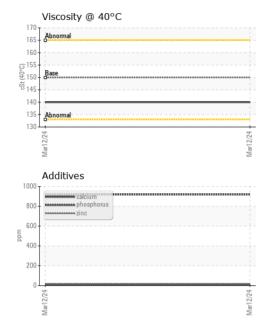

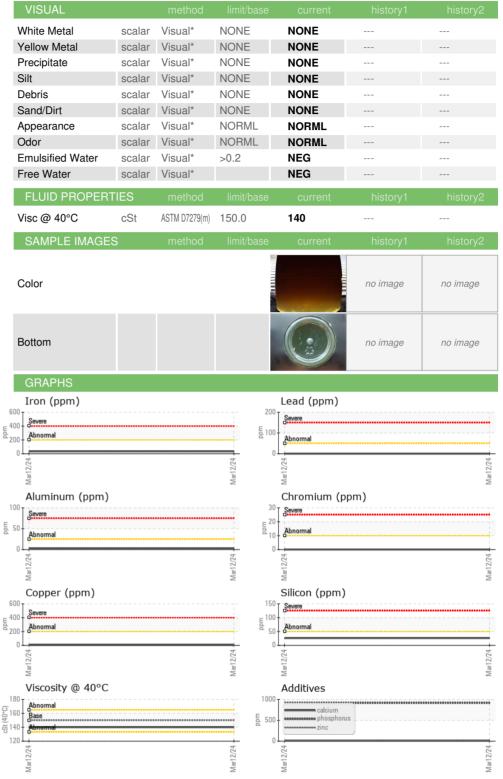





Laboratory

Laboratory Sample No.

Lab Number : 02624378 Unique Number : 5749497

: WC0899459

Received **Tested** Diagnosed

: 25 Mar 2024 : 25 Mar 2024

: 25 Mar 2024 - Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. 100 MACINTOSH BLVD VAUGHAN, ON CA L4K 4P3

> Contact: Service Team service.team@roni.ca T:

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Test Package : MOBCE (Additional Tests: Visual)

F: Validity of results and interpretation are based on the sample and information as supplied.