


OIL ANALYSIS REPORT

OZR/BD10 101913 Cap

Bearing

MOBIL MOBILGEAR SHC 460 (25 LTR)

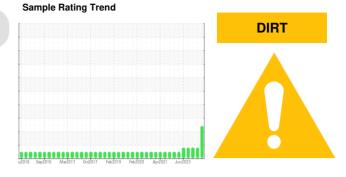

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition.

Wear

Iron ppm levels are noted. The low ferrous density (PQ) index indicates the wear metal levels are due to corrosion. All other component wear rates are normal.

Contamination

Elemental level of silicon (Si) above normal indicating ingress of seal material.


Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0889270	WC0889295	WC0855108
Sample Date		Client Info		19 Mar 2024	23 Jan 2024	16 Jan 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		30	67	63
Iron	ppm	ASTM D5185(m)	>20	<u> </u>	9 2	▲ 87
Chromium	ppm	ASTM D5185(m)	>20	0	<1	<1
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	0	<1	<1
Lead	ppm	ASTM D5185(m)	>20	0	0	0
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	<1	0
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)		0	0	<1
Calcium	ppm	ASTM D5185(m)		<1	<1	<1
Phosphorus	ppm	ASTM D5185(m)		410	416	416
Zinc	ppm	ASTM D5185(m)		5	3	3
Sulfur	ppm	ASTM D5185(m)		1701	1935	1826
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<u> </u>	9	9
Sodium	ppm	ASTM D5185(m)		<1	0	0
Potassium	ppm	ASTM D5185(m)	>20	0	<1	1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.88	0.92	0.94




OIL ANALYSIS REPORT

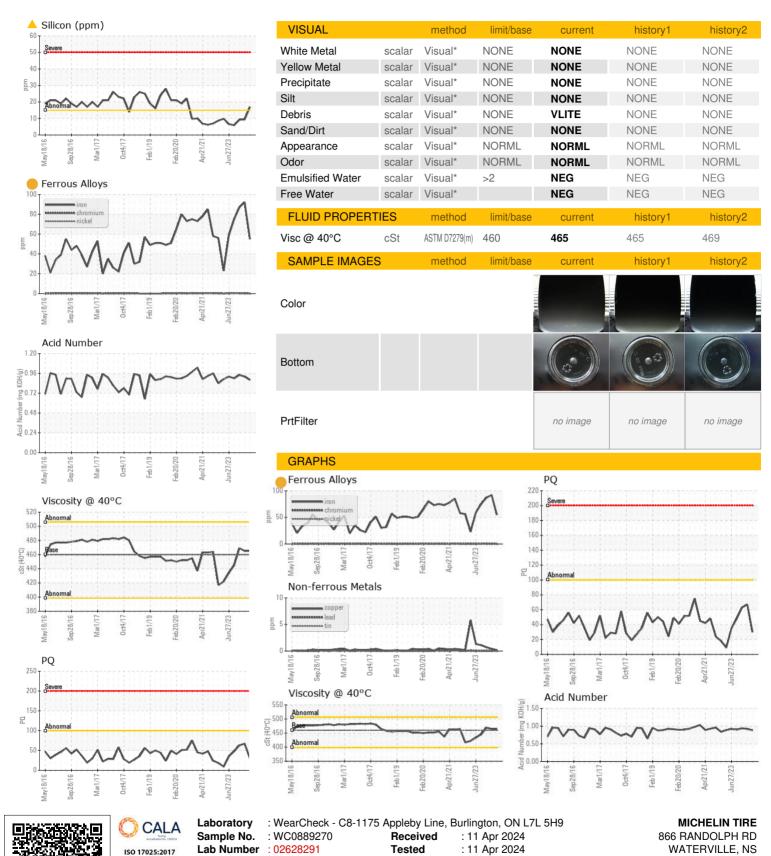

Diagnosed

: 11 Apr 2024 - Kevin Marson

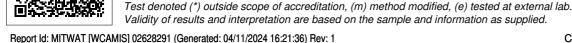

Accredited

Laboratory

Unique Number : 5761423

Test Package : IND 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.

F: x:

CA BOP 1V0

Contact: Alan Davies

T: (902)534-3590

alan.davies@michelin.com