



OIL ANALYSIS REPORT

Sample Rating Trend



ISO

Area

[02644453]

Machine Id

JOHN DEERE 160GL P-115 (S/N 1FF160GXJC0055288)

Component

Hydraulic System

Fluid

PANOLIN HLP SYNTH 46 (--- LTR)

DIAGNOSIS

Recommendation

Nous vous recommandons de vérifier la source de l'infiltration d'eau. Nous recommandons le remplacement des filtres de ce composant. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une quantité modérée de particules (de 4 à 14 microns) dans l'huile. Il y a une faible concentration (<5.0%) d'huile minérale présente dans le fluide. Concentration modérée d'eau dans l'huile. La propreté du système est supérieure à la limite acceptable pour votre objectif de propreté ISO 4406.

Fluid Condition

Le AN est acceptable pour ce fluide. l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0922687	---	---
Sample Date	Client Info	20 Jun 2024	---	---
Machine Age	hrs Client Info	5970	---	---
Oil Age	hrs Client Info	0	---	---
Oil Changed	Client Info	N/A	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm ASTM D5185(m)	>32	17	---	---
Chromium ppm ASTM D5185(m)	>9	2	---	---
Nickel ppm ASTM D5185(m)	>5	<1	---	---
Titanium ppm ASTM D5185(m)		<1	---	---
Silver ppm ASTM D5185(m)		0	---	---
Aluminum ppm ASTM D5185(m)	>9	<1	---	---
Lead ppm ASTM D5185(m)	>28	0	---	---
Copper ppm ASTM D5185(m)	>50	2	---	---
Tin ppm ASTM D5185(m)	>5	0	---	---
Antimony ppm ASTM D5185(m)		0	---	---
Vanadium ppm ASTM D5185(m)		0	---	---
Beryllium ppm ASTM D5185(m)		0	---	---
Cadmium ppm ASTM D5185(m)		0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron ppm ASTM D5185(m)	0	<1	---	---
Barium ppm ASTM D5185(m)	0	<1	---	---
Molybdenum ppm ASTM D5185(m)	0	0	---	---
Manganese ppm ASTM D5185(m)	0	0	---	---
Magnesium ppm ASTM D5185(m)	0	<1	---	---
Calcium ppm ASTM D5185(m)	0	4	---	---
Phosphorus ppm ASTM D5185(m)	1700	1314	---	---
Zinc ppm ASTM D5185(m)	0	35	---	---
Sulfur ppm ASTM D5185(m)	1350	1207	---	---
Lithium ppm ASTM D5185(m)		<1	---	---

CONTAMINANTS






method	limit/base	current	history1	history2
Silicon ppm ASTM D5185(m)	>11	3	---	---
Sodium ppm ASTM D5185(m)	>21	2	---	---
Potassium ppm ASTM D5185(m)	>20	<1	---	---
Water % ASTM D6304*	>0.05	0.050	---	---
ppm Water ppm ASTM D6304*	>500	502	---	---

INFRA-RED

method	limit/base	current	history1	history2
Soot % ASTM D7844*		0	---	---
Nitration Abs/cm ASTM D7624*		4.3	---	---
Sulfation Abs./1mm ASTM D7415*		152.4	---	---
Mineral Oil Content % ASTM D7418*	<5.0%	<5.0	---	---



OIL ANALYSIS REPORT

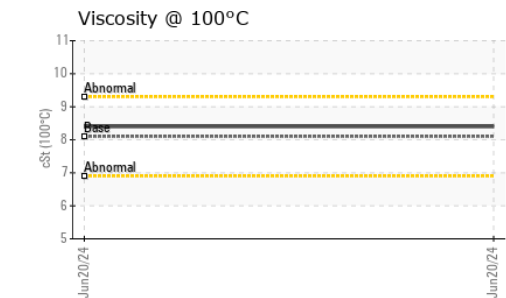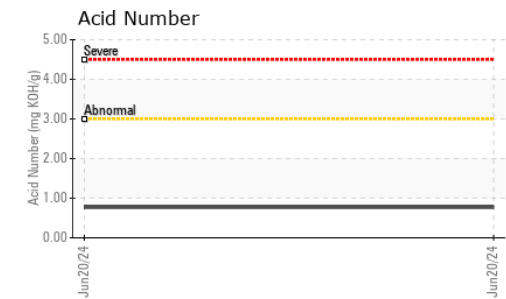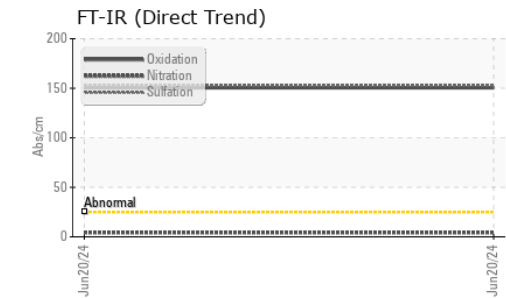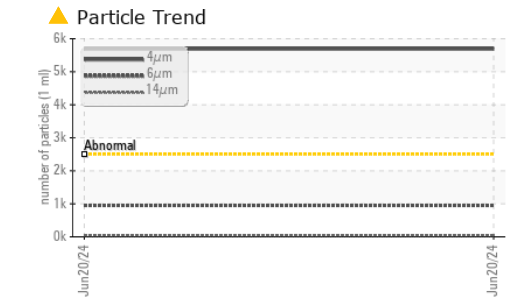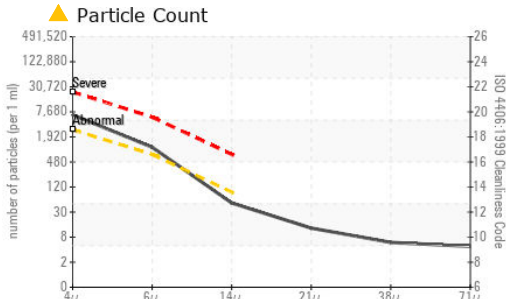

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0922687 **Received** : 27 Jun 2024
Lab Number : **02644452** **Tested** : 02 Jul 2024
Unique Number : 5801991 **Diagnosed** : 02 Jul 2024 - Bill Quesnel
Test Package : MOB 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Envirolin Canada
 520 rue Adanac
 Quebec, QC
 CA G1C 7B7
 Contact: Patrick Levesque
 patrick.levesque@envirolin.com
 T: (418)623-1216
 F: (418)660-8889

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>2500	▲ 5691	---	---
Particles >6µm	ASTM D7647	>640	● 952	---	---
Particles >14µm	ASTM D7647	>80	44	---	---
Particles >21µm	ASTM D7647	>20	11	---	---
Particles >38µm	ASTM D7647	>4	5	---	---
Particles >71µm	ASTM D7647	>3	4	---	---
Oil Cleanliness	ISO 4406 (c)	>18/16/13	▲ 20/17/13	---	---

FLUID DEGRADATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	150.4	---	---
Acid Number (AN)	mg KOH/g	ASTM D974*	0.77	---	---

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	---	---
Precipitate	scalar	Visual*	NONE	---	---
Silt	scalar	Visual*	NONE	---	---
Debris	scalar	Visual*	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	---	---
Appearance	scalar	Visual*	NORML	---	---
Odor	scalar	Visual*	NORML	---	---
Emulsified Water	scalar	Visual*	>0.05	---	---
Free Water	scalar	Visual*	NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	47.0	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	8.1	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	146	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image



MINERAL OIL CONTENT REPORT

PASS



Area

[02644453]

Machine Id

JOHN DEERE 160GL P-115 (S/N 1FF160GXJC0055288)

Component

Hydraulic System


Fluid

PANOLIN HLP SYNTH 46 (--- LTR)


SPECTRAL ANALYSIS

		method	limit/base	current	history1	history2
Zinc	ppm	ASTM D5185(m)	0	35	---	---
Mineral Oil Content	%	ASTM D7418*	<5.0%	<5.0	---	---


FT-IR - Esters I

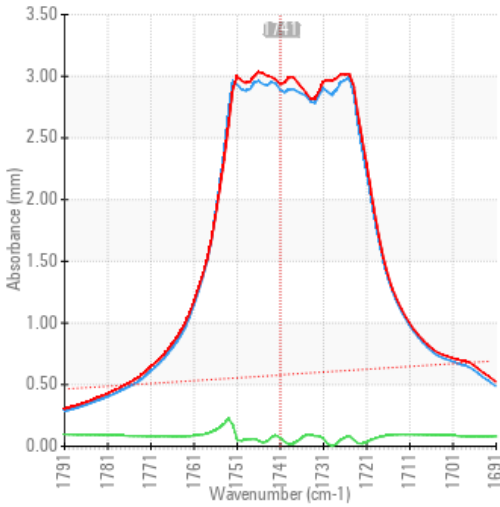

FT-IR - Esters II

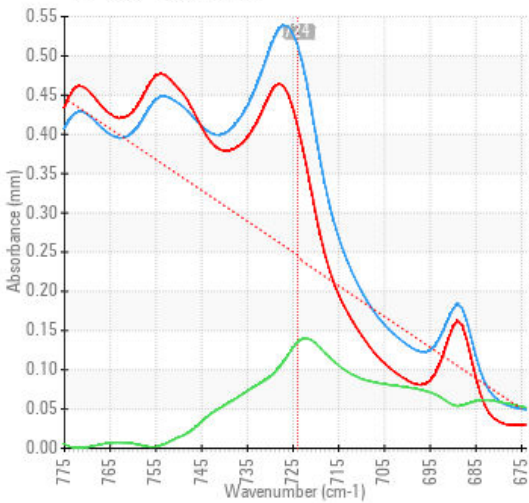

FT-IR Spectrum (Absorbance)

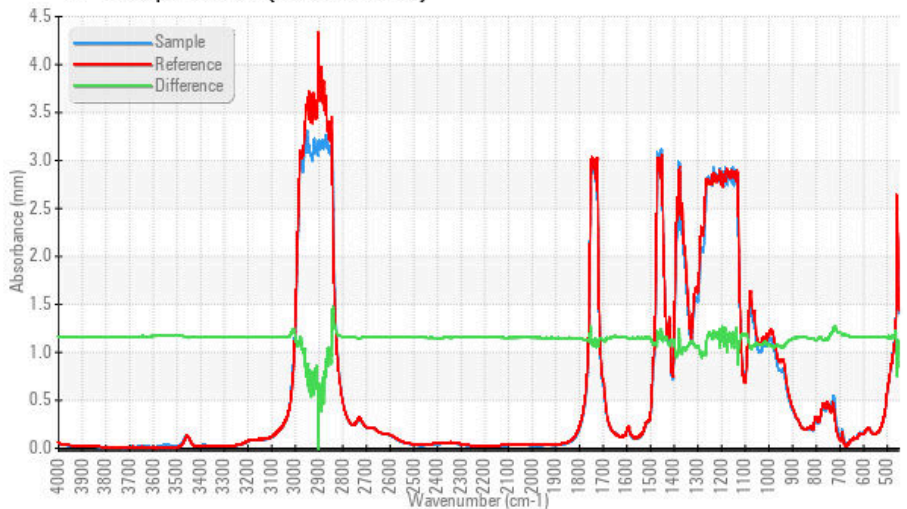

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0922687 **Received** : 27 Jun 2024
Lab Number : 02644452 **Tested** : 02 Jul 2024
Unique Number : 5801991 **Diagnosed** : 02 Jul 2024 - Bill Quesnel
Test Package : MOB 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

EnviroLin Canada

520 rue Adanac
Quebec, QC
CA G1C 7B7

Contact: Patrick Levesque
patrick.levesque@envirolin.com

T: (418)623-1216
F: (418)660-8889

This page left intentionally blank