


## **OIL ANALYSIS REPORT**

CONTAMINATION

## Sample Rating Trend



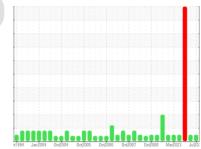



# SAB1 G1

**Thrust Bearing** 

PETRO CANADA TURBOFLO XL46 (4250 LTR)

## DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

#### Wear

Component wear rates appear to be normal (unconfirmed).

#### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC	WC0864647	WC0927745
Sample Date		Client Info		03 Jul 2024	15 May 2024	15 May 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	SEVERE

CONTAMINATIO	ЛМ	memou			HISTOLAL	HISTOLYZ
Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>85	<1	0	0
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>40	<1	0	0
Lead	ppm	ASTM D5185(m)	>60	0	0	0
Copper	ppm	ASTM D5185(m)	>7	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>40	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0	0	0
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		0	0	0
Calcium	ppm	ASTM D5185(m)		<1	<1	<1
Phosphorus	ppm	ASTM D5185(m)		3	2	2
Zinc	ppm	ASTM D5185(m)	0	1	1	1
Sulfur	ppm	ASTM D5185(m)		632	629	609
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTANUNANTO			12. 21.0		111	111

CONTAMINANT	ΓS	method				history2
Silicon	ppm	ASTM D5185(m)	>20	<1	<1	<1
Sodium	ppm	ASTM D5185(m)		0	0	0
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1

	( /				
FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	1276	590	481
Particles >6μm	ASTM D7647	>2500	312	151	154
Particles >14μm	ASTM D7647	>160	27	9	15
Particles >21µm	ASTM D7647	>40	8	3	3
Particles >38µm	ASTM D7647	>10	0	0	0
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>20/18/14	17/15/12	16/14/10	16/14/11

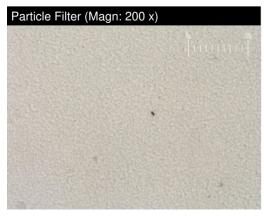


Report Id: ONTQUE [WCAMIS] 02645485 (Generated: 07/09/2024 16:54:10) Rev: 1

Contact/Location: Michael Brochu - ONTQUE



## **OIL ANALYSIS REPORT**

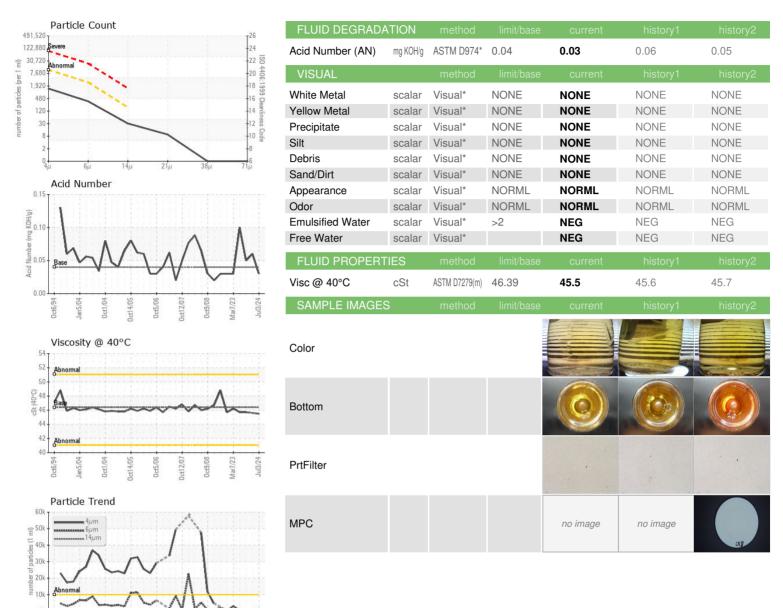





Sample No.

Laboratory

: WC Lab Number : 02645485 Unique Number : 5803024

Validity of results and interpretation are based on the sample and information as supplied.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Received : 04 Jul 2024 **Tested** : 09 Jul 2024

Diagnosed : 09 Jul 2024 - Kevin Marson Test Package : IND 2 ( Additional Tests: BottomAnalysis, FilterPatch, PrtFilter )

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. **Ontario Power Generation** 

NIAGARA PLANT GROUP,, 14000 NIAGARA PKWY NIAGARA ON THE LAKE, ON

CA LOS 1J0 Contact: Michael Brochu mike.brochu@opg.com

T: (905)357-0322 F: (905)374-5466