


OIL ANALYSIS REPORT



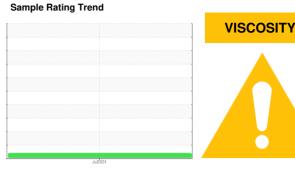

DIAGNOSIS

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition


Viscosity of sample indicates oil is within SAE 40 range, advise investigate. This plus the additive levels indicates that this is not the same brand, or type of oil as reported. The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0952476		
Sample Date		Client Info		02 Jul 2024		
Machine Age	hrs	Client Info		18405		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINATION	N	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	6		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	1		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>75	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		37		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		21		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		272		
Calcium	ppm	ASTM D5185(m)		1882		
Phosphorus	ppm	ASTM D5185(m)		671		
Zinc	ppm	ASTM D5185(m)		805		
Sulfur	ppm	ASTM D5185(m)		4464		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	5		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

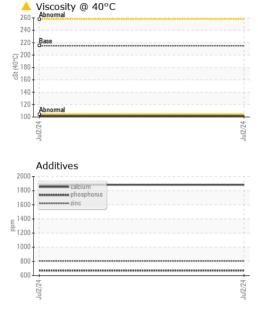

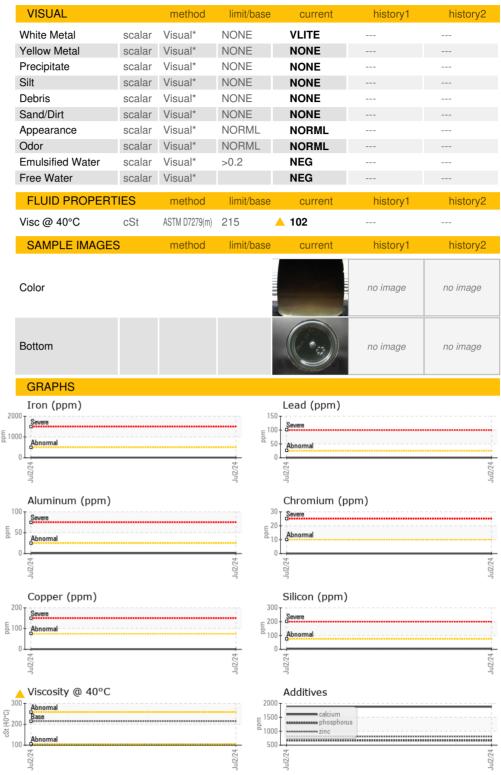



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WC0952476 Lab Number : 02645567

Unique Number : 5803106 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Received : 04 Jul 2024 **Tested** : 04 Jul 2024 Diagnosed : 05 Jul 2024 - Kevin Marson

Agnico Eagle Canada 1350 Government Rd. W, MACASSA COMPLEX Kirkland Lake, ON

CA P2N 3J1 Contact: Mitch Lamontagne AEM_KL_macassaoilsampleresults@agnicoeagle.com

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

T: (705)567-5208 F: (705)567-5221

Validity of results and interpretation are based on the sample and information as supplied. Report Id: KIR370KIR [WCAMIS] 02645567 (Generated: 07/05/2024 08:08:47) Rev: 1

Contact/Location: Mitch Lamontagne - KIR370KIR