

OIL ANALYSIS REPORT





RONI Machine Id 140 **Right Swing Drive** PETRO CANADA 30W (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


Viscosity of sample indicates oil is within SAE 20 range, advise investigate. The condition of the oil is acceptable for the time in service.

(GAL)						
SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0952936		
Sample Date		Client Info		10 Jul 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>400	34		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>50	0		
Copper	ppm	ASTM D5185(m)	>200	10		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		7		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		862		
Calcium	ppm	ASTM D5185(m)		1038		
Phosphorus	ppm	ASTM D5185(m)		1143		
Zinc	ppm	ASTM D5185(m)		1245		
Sulfur	ppm	ASTM D5185(m)		3088		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	10		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

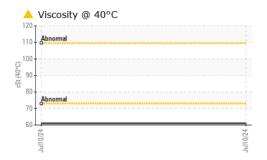

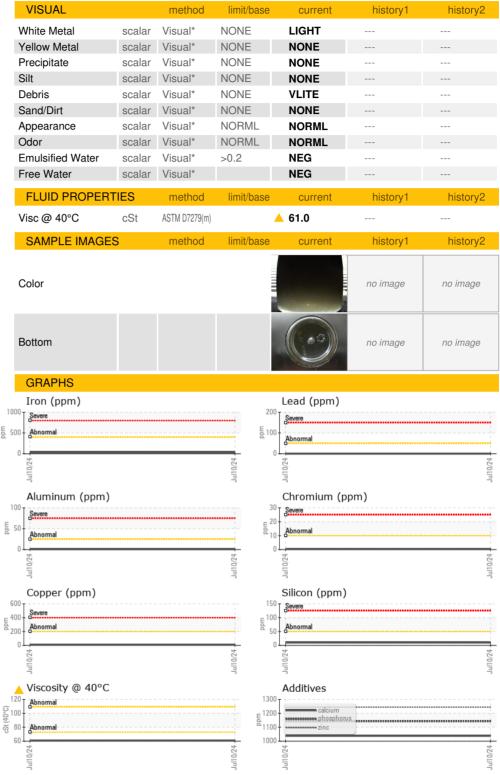



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02648495 Unique Number : 5814047 Test Package : MOBCE

: WC0952936

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. Received : 17 Jul 2024 **Tested** : 17 Jul 2024

Diagnosed : 18 Jul 2024 - Kevin Marson 100 MACINTOSH BLVD VAUGHAN, ON

CA L4K 4P3 Contact: Service Team service.team@roni.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

F: Contact/Location: Service Team - RONVAU

T: