

PROBLEM SUMMARY

Sample Rating Trend

WATER




Machine Id KAESER 7873126 (S/N 1312)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

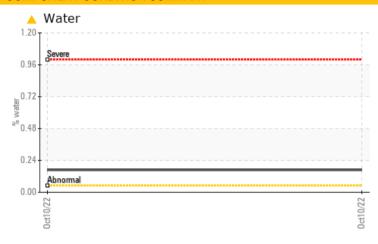

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS									
Sample Status				ABNORMAL					
Water	%	ASTM D6304	>0.05	△ 0.168					
ppm Water	ppm	ASTM D6304	>500	1680					
Debris	scalar	*Visual	NONE	▲ MODER					
Appearance	scalar	*Visual	NORML	▲ HAZY					

Customer Id: PRUSAN Sample No.: KCP47349D Lab Number: 05672309 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.		



OIL ANALYSIS REPORT



KAESER 7873126 (S/N 1312)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil. There is a light concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCP47349D		
Sample Date		Client Info		10 Oct 2022		
Machine Age	hrs	Client Info		4291		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	12		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	2		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	21		
Calcium	ppm	ASTM D5185m	0	<1		
Phosphorus	ppm	ASTM D5185m	0	11		
Zinc	ppm	ASTM D5185m	0	23		
Sulfur	ppm	ASTM D5185m	23500	17655		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	9		
Water	%	ASTM D6304	>0.05	△ 0.168		
ppm Water	ppm	ASTM D6304	>500	1680		
FLUID DEGRADAT	TION	method	limit/base	current	history1	history2
	1/011	4.0TI 4.D.00 :-				


0.32

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



OIL ANALYSIS REPORT

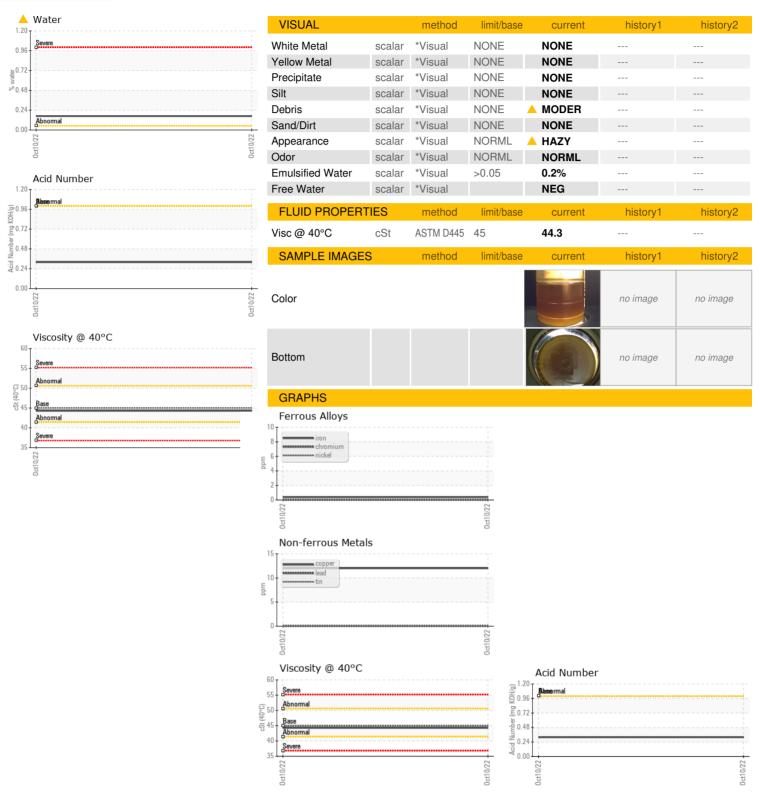





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: 05672309 : 10181879

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KCP47349D Received : 20 Oct 2022 Diagnosed

: 22 Oct 2022 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

PRUDENTIAL OVERALL SUPPLY

531 EAST PARK ST SANDSTON, VA

US 23150

Contact: Service Manager

T: F: