

## **FUEL REPORT**

## Sample Rating Trend

ISO



Diesel Fuel Fluid NOT GIVEN (--- LTR)

## DIAGNOSIS

#### A Recommendation

This is a baseline read-out on the submitted sample. We recommend you service the filters on this component.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

## Contaminants

There is a high amount of particulates present in the fuel. The water content is negligible.


### **Fuel Condition**


The condition of the fuel is acceptable for the time in service.

		-		Dec2022		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KL0011311		
Sample Date		Client Info		06 Dec 2022		
Machine Age	hrs	Client Info		0		
Sample Status				ABNORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		2.4		
SULFUR CONTEN	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		12		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	<1		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	<1		
Water	%	ASTM D6304	< 0.05	0.003		
ppm Water	ppm	ASTM D6304	<500	32.9		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		36282		
Particles >6µm		ASTM D7647	>640	<u> </u>		
Particles >14µm		ASTM D7647	>80	<b>478</b>		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	3		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>16/13	<b>A</b> 20/16		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	<1		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m		0		
SAMPLE IMAGES	6	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



# **FUEL REPORT**

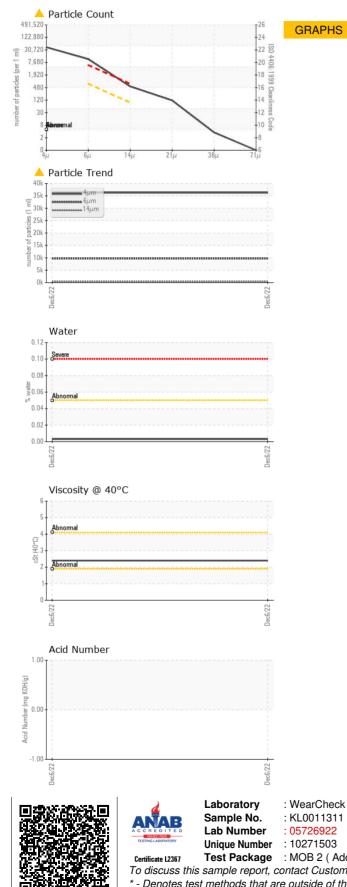

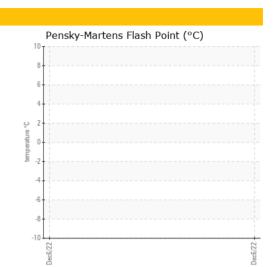

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 CONOR Received : 28 Dec 2022 JUAREZ 348 Diagnosed : 29 Dec 2022 HERMOSILLO, Diagnostician : Jonathan Hester MX 83140 Test Package : MOB 2 (Additional Tests: KF, PrtCount) Contact: EDUARDO GARCIA To discuss this sample report, contact Customer Service at 1-800-237-1369. egarcia.comsa@gmail.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (526)622-1581 x:81 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: x: