

PROBLEM SUMMARY

Sample Rating Trend VIS DEBRIS

KMGP UNIT 4

Component Inboard Bearing

ROYAL PURPLE SYNFILM GT 32 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Debris	scalar	*Visual	NONE	▲ MODER				

Customer Id: MAGHOU Sample No.: RP0028253 Lab Number: 05797614 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net


To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component if applicable.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

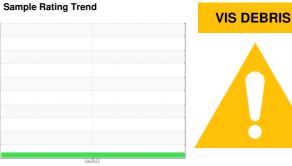

KMGP UNIT 4

Component

Inboard Bearing

ROYAL PURPLE SYNFILM GT 32 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

)				Feb 2023		
SAMPLE INFORM	/ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0028253		
·		Client Info		16 Feb 2023		
Sample Date	bro	Client Info		0		
Machine Age	hrs hrs	Client Info		0		
Oil Age Oil Changed	1115	Client Info		N/A		
Sample Status		Ciletit IIIIO		ABNORMAL		
Sample Status				ADNONWAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	<1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		68		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		<1		
Zinc	ppm	ASTM D5185m		2		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>2	0.015		
ppm Water	ppm	ASTM D6304		154.5		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.32		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	LIGHT		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	▲ MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>2	NEG		
12 Free Water	scalar	*Visual		NEG	ıtion: ŁOGAN S	EYL =-MAGHOU



OIL ANALYSIS REPORT

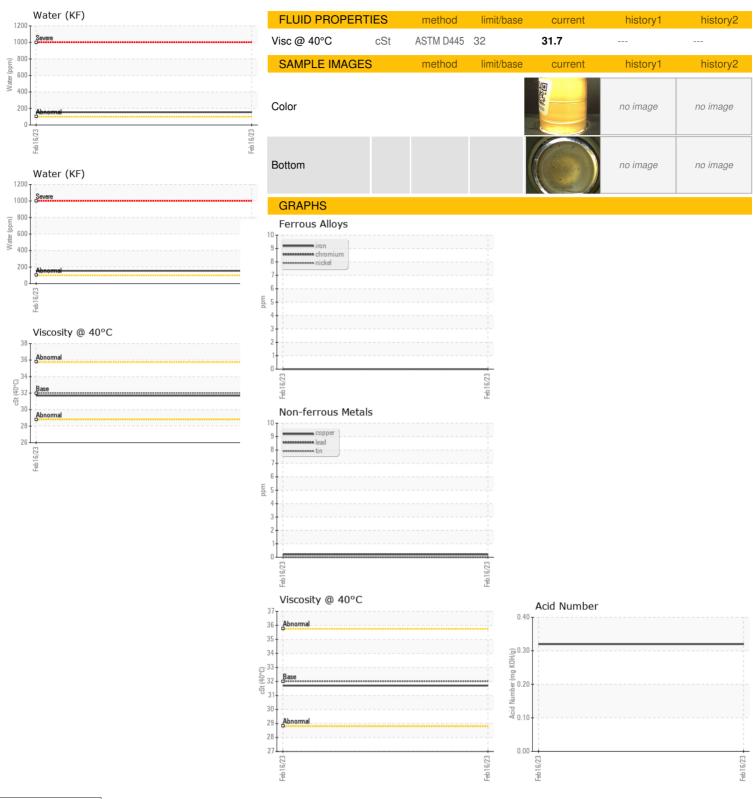



Certificate L2367

Laboratory Sample No. Lab Number

: RP0028253 : 05797614 Unique Number : 10387298 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Mar 2023 Diagnosed : 23 Mar 2023

Diagnostician : Don Baldridge

MAGELLAN MIDSTREAM - EH TERMINAL 7901 WALLISVILLE RD

HOUSTON, TX US 77029 Contact: LOGAN SEYL

logan.seyl@magellanlp.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: