




PROBLEM SUMMARY

Sample Rating Trend

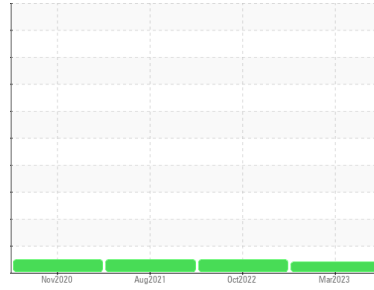

VIS DEBRIS



Machine Id
Boiler Feedwater Pump #2 (S/N M-152669)
 Component
Drive End Bearing
 Fluid
NOT GIVEN (2 GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	NORMAL	NORMAL
Debris	scalar	*Visual	NONE	▲ MODER	LIGHT	LIGHT

Customer Id: VEOCAR
 Sample No.: WC0720396
 Lab Number: 05798314
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

06 Oct 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



09 Aug 2021 Diag: Jonathan Hester

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



10 Nov 2020 Diag: Jonathan Hester

NORMAL



Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report






OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

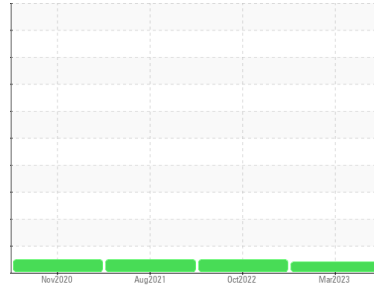

Machine Id
Boiler Feedwater Pump #2 (S/N M-152669)

Component
Drive End Bearing
Fluid
NOT GIVEN (2 GAL)

DIAGNOSIS

Recommendation

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history 1	history 2
Sample Number	Client Info			WC0720396	WC0720407	WC0539376
Sample Date	Client Info			17 Mar 2023	06 Oct 2022	09 Aug 2021
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed	Client Info			N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL

WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>20	0	0	<1
Chromium	ppm	ASTM D5185m	>20	0	0	<1
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	0	0
Lead	ppm	ASTM D5185m	>20	0	0	15
Copper	ppm	ASTM D5185m	>20	<1	<1	5
Tin	ppm	ASTM D5185m	>20	0	<1	6
Antimony	ppm	ASTM D5185m		---	---	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0

ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		1074	1093	1140
Zinc	ppm	ASTM D5185m		0	0	5
Sulfur	ppm	ASTM D5185m		0	2	10



CONTAMINANTS		method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>15	<1	<1	3
Sodium	ppm	ASTM D5185m		0	0	<1
Potassium	ppm	ASTM D5185m	>20	<1	0	11

FLUID DEGRADATION		method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.12	0.13	0.119

VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	LIGHT	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	omitted	omitted




OIL ANALYSIS REPORT



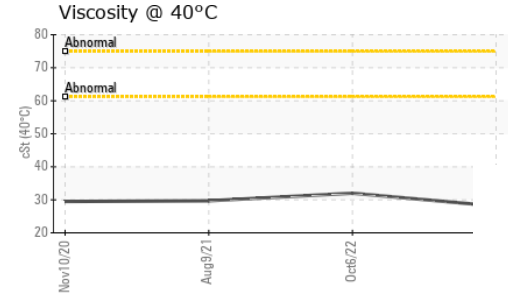
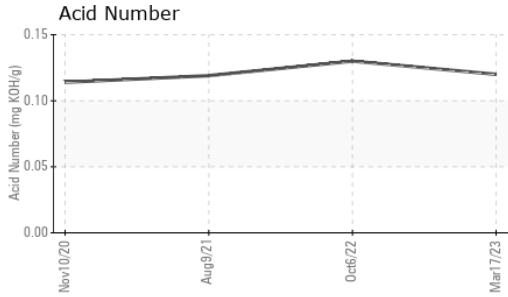


FLUID PROPERTIES	method	limit/base	current	history 1	history 2
Visc @ 40°C	cSt	ASTM D445	28.1	32.0	29.7

SAMPLE IMAGES	method	limit/base	current	history 1	history 2
---------------	--------	------------	---------	-----------	-----------

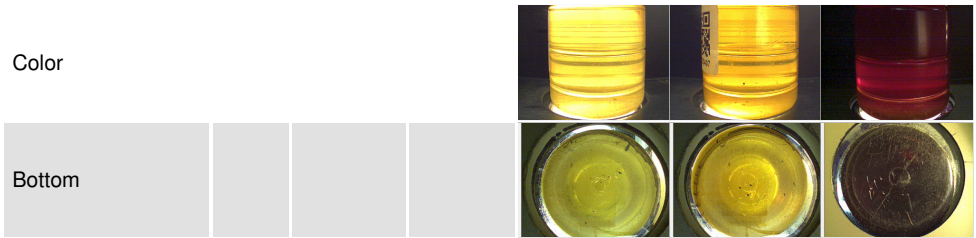

GRAPHS

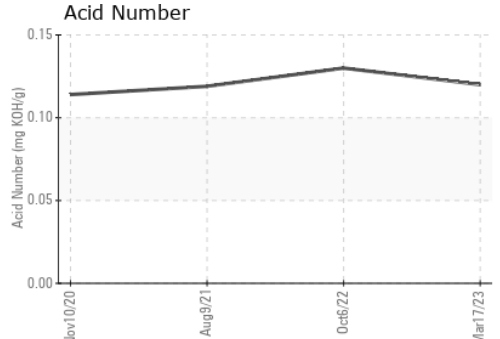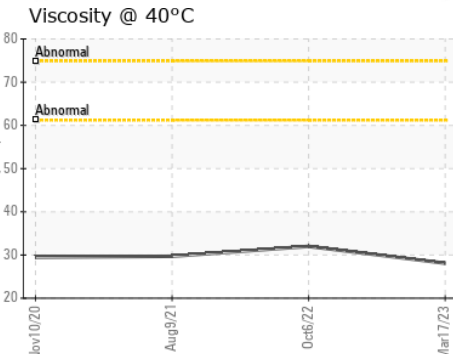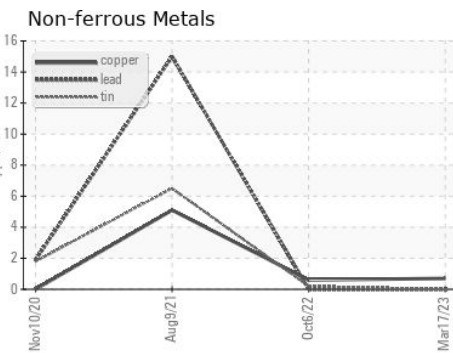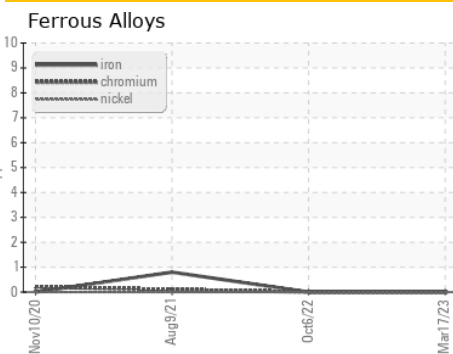

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0720396 **Received** : 21 Mar 2023
Lab Number : **05798314** **Diagnosed** : 24 Mar 2023
Unique Number : 10387998 **Diagnostician** : Jonathan Hester
Test Package : IND 2

VEOLIA ENERGY - FRANKLIN
 3465 HWY 198
 CARNESVILLE, GA
 US 30521
 Contact: DERRICK HARVEY
 derrick.harvey@veolia.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: