

PROBLEM SUMMARY


TRC 10K [13212555] Machine Id KAESER 1108 - JACOBS/CH2M HILL


Compressor

Sample Rating Trend



COMPONENT CONDITION SUMMARY

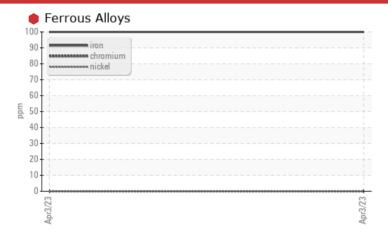

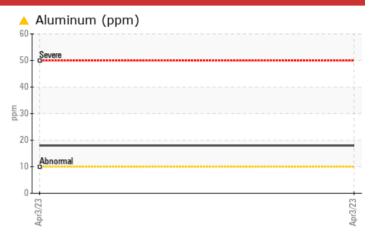

RECOMMENDATION

The filter change at the time of sampling has been noted. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				SEVERE				
Iron	ppm	ASTM D5185m	>50	100				
Aluminum	ppm	ASTM D5185m	>10	18				

Customer Id: UCTOTSAI Sample No.: UCH05821634 Lab Number: 05821634 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Inspect Wear Source			?	We advise that you inspect for the source(s) of wear.		
Resample			?	We recommend an early resample to monitor this condition.		

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

TRC 10K [13212555] Machine Id KAESER 1108 - JACOBS/CH2M HILL

Component

Compressor

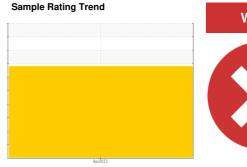



DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

Wear

The iron level is severe. The aluminum level is abnormal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05821634		
Sample Date		Client Info		03 Apr 2023		
Machine Age	hrs	Client Info		45901		
Oil Age	hrs	Client Info		2709		
Oil Changed	1110	Client Info		Not Changd		
Sample Status		Oliciti iiiio		SEVERE		
·				GEVERIE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	• 100		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<u> </u>		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		246		
Zinc	ppm	ASTM D5185m		7		
Sulfur	ppm	ASTM D5185m		798		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	4		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.45		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	NEG		
Free Water	scalar	*Visual		NEG		



OIL ANALYSIS REPORT

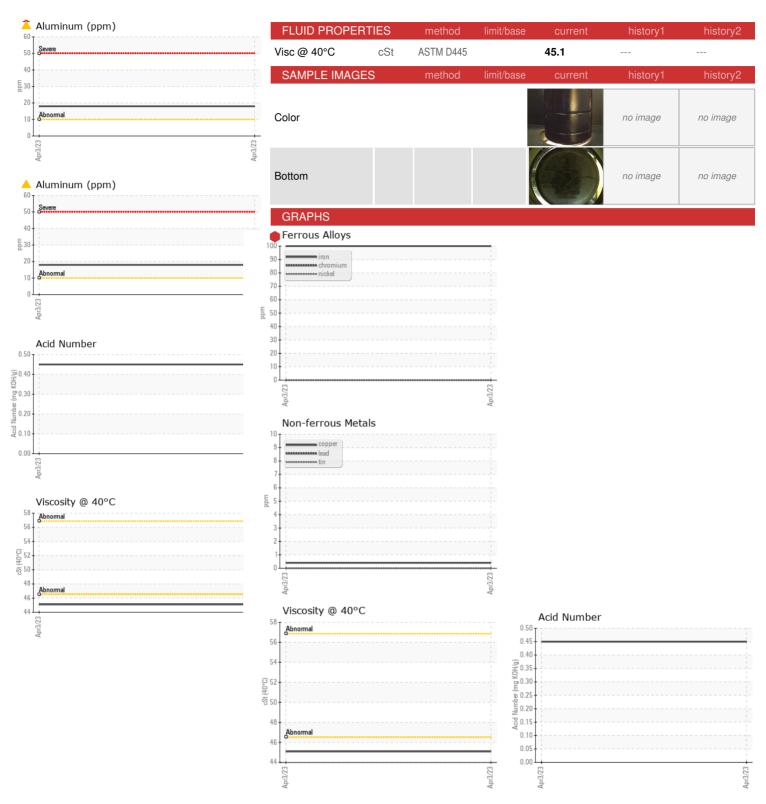



Certificate L2367

Laboratory Sample No. Lab Number

: UCH05821634 : 05821634 Unique Number : 10429717 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 17 Apr 2023 Received

: 19 Apr 2023 Diagnosed Diagnostician : Jonathan Hester **TOTAL EQUIPMENT COMPANY**

200 SMILEY DR SAINT ALBANS, WV US 25177

Contact:

T:

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)