


PROBLEM SUMMARY

VACUUM PUMP


B68618 - BATCHING SYSTEM VACUUM MIXER 1

Vacuum Pump

BUSCH R530S (--- GAL)

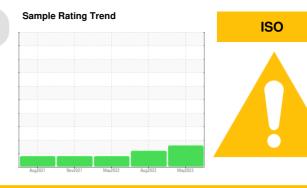

COMPONENT CONDITION SUMMARY

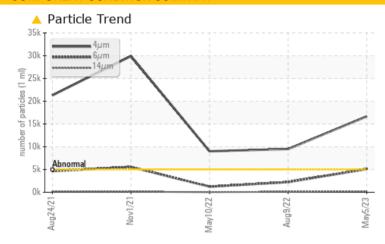

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ATTENTION	ATTENTION				
Particles >4µm	ASTM D7647	>5000	<u> </u>	△ 9506	<u>A</u> 8999				
Particles >6µm	ASTM D7647	>1300	<u>▲</u> 5122	<u>2241</u>	1232				
Particles >14µm	ASTM D7647	>160	<u>^</u> 227	117	27				
Oil Cleanliness	ISO 4406 (c)	>19/17/14	21/20/15	20/18/14	20/17/12				

Customer Id: PAPOMA **Sample No.:** WC0755363 Lab Number: 05844423 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component if applicable.

HISTORICAL DIAGNOSIS

09 Aug 2022 Diag: Doug Bogart





No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



10 May 2022 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



01 Nov 2021 Diag: Jonathan Hester

ISO



We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT


VACUUM PUMP

B68618 - BATCHING SYSTEM VACUUM MIXER 1

Component

Vacuum Pump

BUSCH R530S (--- GAL)

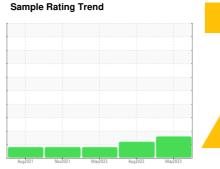



DIAGNOSIS

Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Aug2021	Nov2021	May2022 Aug2022	May2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0755363	WC0716991	WC0691587
Sample Date		Client Info		05 May 2023	09 Aug 2022	10 May 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				ABNORMAL	ATTENTION	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	<1	0
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	0	0
Lead	ppm	ASTM D5185m	>20	0	0	<1
Copper	ppm	ASTM D5185m	>20	0	0	0
Tin	ppm	ASTM D5185m	>20	0	<1	0
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	1
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	<1
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		<1	5	4
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		70	49	44
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	5	5	5
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	<1	0	<1
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	16677	△ 9506	<u> </u>
Particles >6µm		ASTM D7647	>1300	<u> 5122</u>	<u>2241</u>	1232
Particles >14μm		ASTM D7647	>160	227	117	27
Particles >21µm		ASTM D7647	>40	28	21	5
Particles >38μm		ASTM D7647	>10	1	0	0
Particles >71μm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	21/20/15	2 0/18/14	△ 20/17/12
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.056	0.06	0.049



OIL ANALYSIS REPORT

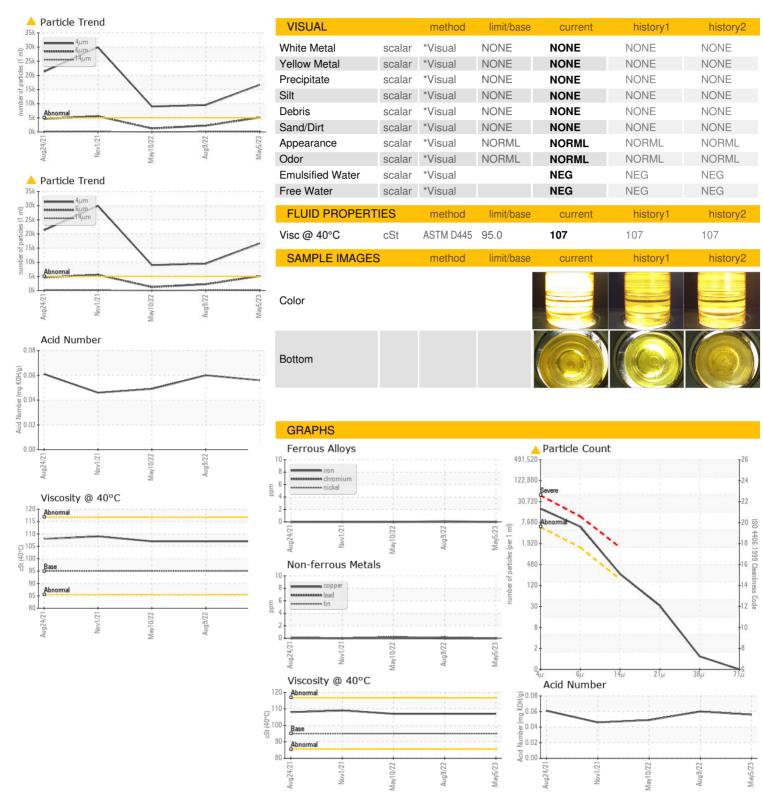





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0755363

: 05844423

Received Diagnosed : 10468530 Diagnostician : 11 May 2023

: 14 May 2023 : Don Baldridge

Test Package : IND 2 (Additional Tests: PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **PAPILLION FOODS**

10808 S 132ND ST OMAHA, NE US 68138

Contact: NEIL ARIANO njariano@hormel.com

T:

F: