




PROBLEM SUMMARY

Sample Rating Trend

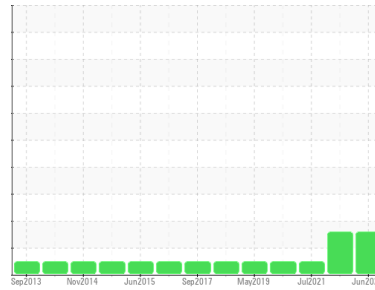


WATER



Area
RM6 [SV2304240404]
 Machine Id
MCQUAY BOA VILLA PARK 6&7 (S/N STNU06500153)
 Component
Refrigeration Compressor
 Fluid
MOBIL EAL 46 (16 GAL)

COMPONENT CONDITION SUMMARY

▲ Water

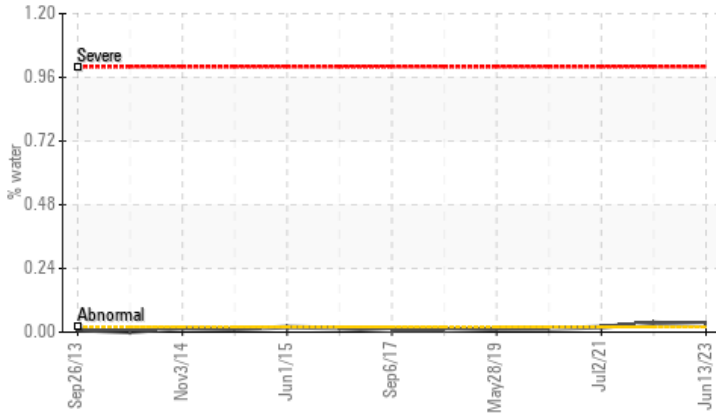

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				MARGINAL	MARGINAL	NORMAL
Water	%	ASTM D6304	>0.02	▲ 0.029	▲ 0.035	0.019
ppm Water	ppm	ASTM D6304	>250	▲ 294.9	▲ 352.5	197.0

Customer Id: MCQRIC
 Sample No.: WC0487423
 Lab Number: 05898652
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Angela Borella +1 800-237-1369
angela.borella@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

19 Apr 2022 Diag: Don Baldrige

WATER



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a trace of moisture present in the oil. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

view report



02 Jul 2021 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



25 Aug 2020 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

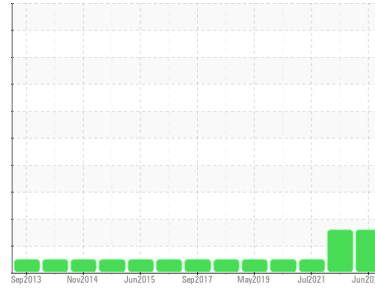

WATER



Area
RM6 [SV2304240404]
 Machine Id
MCQUAY BOA VILLA PARK 6&7 (S/N STNU06500153)
 Component
Refrigeration Compressor
 Fluid
MOBIL EAL 46 (16 GAL)

DIAGNOSIS

▲ Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a trace of moisture present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0487423	WC0487469	WC0430719
Sample Date	Client Info		13 Jun 2023	19 Apr 2022	02 Jul 2021
Machine Age	hrs	Client Info	40730	0	332400
Oil Age	hrs	Client Info	20000	0	0
Oil Changed	Client Info		Not Chngd	N/A	Not Chngd
Sample Status			MARGINAL	MARGINAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >100	<1	1	<1
Chromium	ppm	ASTM D5185m >2	0	0	0
Nickel	ppm	ASTM D5185m	<1	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m >2	0	0	0
Aluminum	ppm	ASTM D5185m >50	<1	1	1
Lead	ppm	ASTM D5185m >2	0	<1	<1
Copper	ppm	ASTM D5185m >100	<1	2	4
Tin	ppm	ASTM D5185m >4	<1	<1	<1
Antimony	ppm	ASTM D5185m	---	---	0
Vanadium	ppm	ASTM D5185m	<1	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	<1	<1	2
Barium	ppm	ASTM D5185m	2	0	0
Molybdenum	ppm	ASTM D5185m	0	0	<1
Manganese	ppm	ASTM D5185m	0	0	0
Magnesium	ppm	ASTM D5185m	0	0	0
Calcium	ppm	ASTM D5185m	0	0	0
Phosphorus	ppm	ASTM D5185m	4	3	5
Zinc	ppm	ASTM D5185m	3	3	3
Sulfur	ppm	ASTM D5185m	52	51	45

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	34	30	34
Sodium	ppm	ASTM D5185m	1	0	<1
Potassium	ppm	ASTM D5185m >20	<1	1	0
Water	%	ASTM D6304 >0.02	▲ 0.029	▲ 0.035	0.019
ppm Water	ppm	ASTM D6304 >250	▲ 294.9	▲ 352.5	197.0

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.027	0.031	0.044




OIL ANALYSIS REPORT

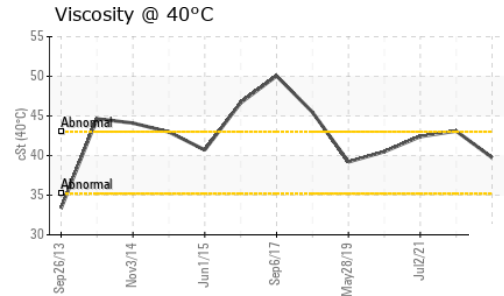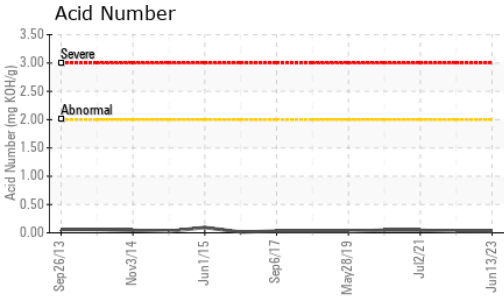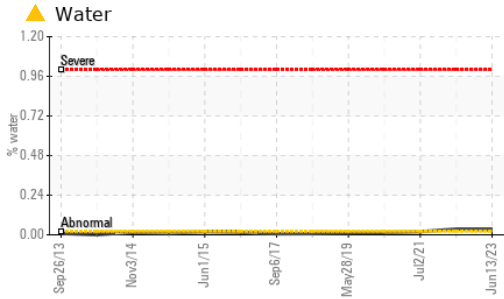





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.02	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	39.74	43.1	42.4

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

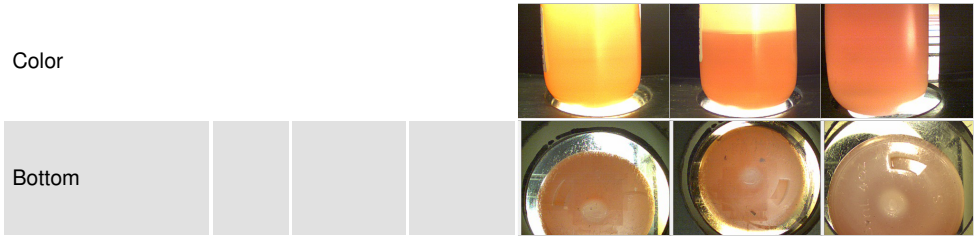

GRAPHS

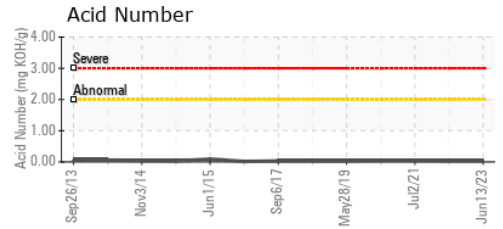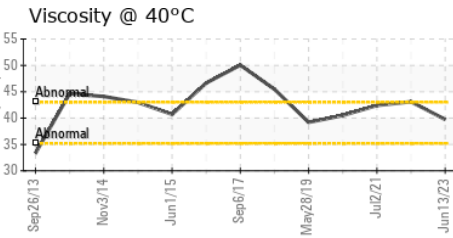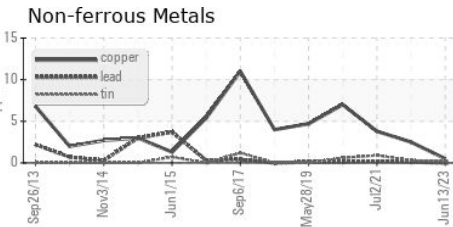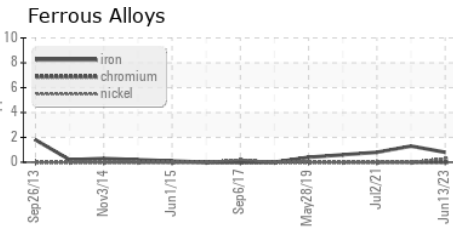

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0487423 **Received** : 14 Jul 2023
Lab Number : 05898652 **Diagnosed** : 20 Jul 2023
Unique Number : 10560008 **Diagnostician** : Angela Borella
Test Package : IND 2

DAIKIN APPLIED-RICHMOND
 3524 MAYLAND CT
 RICHMOND, VA
 US 23233

Contact: AMANDA CARRIER
 service.richmond@daikinapplied.com
 T: (804)747-4822
 F: (804)747-6686

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)