

PROBLEM SUMMARY

Sample Rating Trend


ISO



PAO FLUSHING PUMP 0827606

Component
Hydraulic System
Fluid
NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

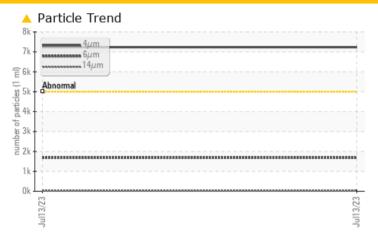

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ATTENTION						
Particles >4µm	ASTM D7647	>5000	7233						
Particles >6µm	ASTM D7647	>1300	1678						
Oil Cleanliness	ISO 4406 (c)	>19/17/14	20/18/12						

Customer Id: TAGBAL Sample No.: WC0827606 Lab Number: 05899501 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO



PAO FLUSHING PUMP 0827606

Hydraulic System

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Discrete particle counts [100 ml] 5-15µm = 165400, $15-25\mu m = 2000, 25-50\mu m = 400, 50-100\mu m = 0,$ $>100\mu m = 0$. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

	Jui/023					
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0827606		
Sample Date		Client Info		13 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed	1115	Client Info		N/A		
		Ciletit IIIIO		ATTENTION		
Sample Status						
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
_ead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	<1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium		ASTM D5185m		0		
-	ppm			0		
Calcium	ppm	ASTM D5185m		-		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		7		
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.002		
opm Water	ppm	ASTM D6304	>500	20.3		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	7233		
Particles >6µm		ASTM D7647	>1300	1678		
Particles >14µm		ASTM D7647	>160	24		
Particles >21µm		ASTM D7647	>40	4		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u>^</u> 20/18/12		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
. LOID DEGITINDA		motinou	mmedasc	- Junioni	Thotory	1113101 92


Acid Number (AN)

mg KOH/g ASTM D8045

0.046



OIL ANALYSIS REPORT

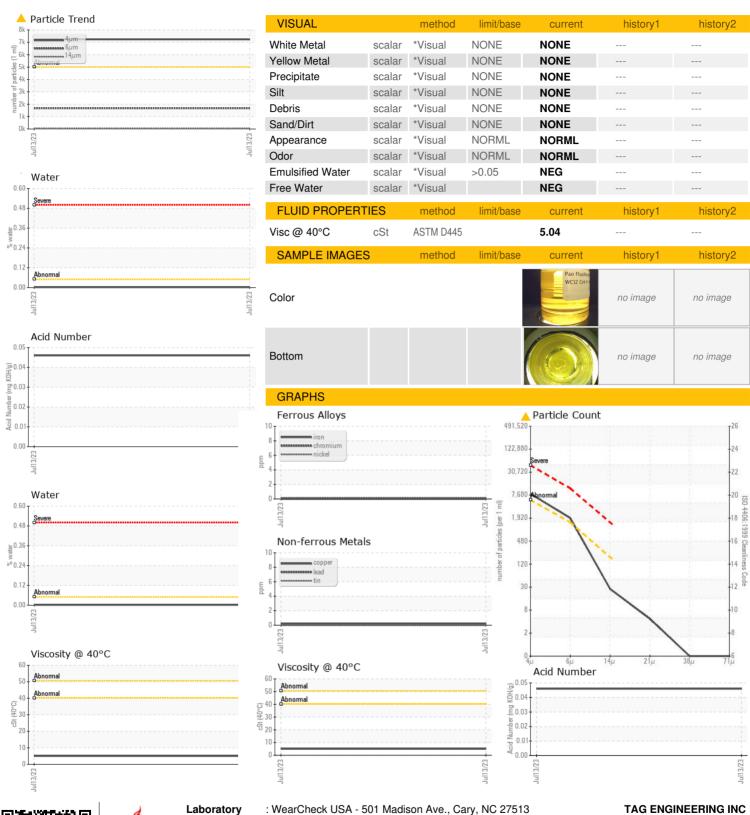





Certificate L2367

Laboratory Sample No.

Lab Number **Unique Number**

: WC0827606 : 05899501 : 10560857

Received Diagnosed

: Jonathan Hester Diagnostician Test Package : IND 2 (Additional Tests: KF)

: 14 Jul 2023

: 18 Jul 2023

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

6707 WHITESTONE RD BALTIMORE, MD US 21207

Contact: MIKE STEVENSON mike@tagengineering.com

Contact/Location: MIKE STEVENSON - TAGBAL

T: (410)265-8686

F: (410)265-8690