

PROBLEM SUMMARY

KAESER 8541477


Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

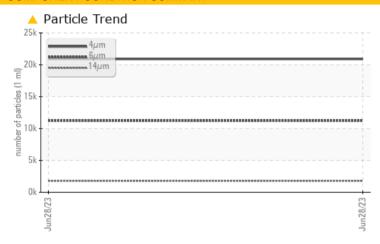

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL							
Particles >6µm	ASTM D7647	>1300	<u> </u>							
Particles >14μm	ASTM D7647	>80	1784							
Particles >21µm	ASTM D7647	>20	△ 522							
Particles >38µm	ASTM D7647	>4	<u> </u>							
Oil Cleanliness	ISO 4406 (c)	>/17/13	22/21/18							

Customer Id: MIDGREKC Sample No.: KC05900715 Lab Number: 05900715 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

KAESER 8541477

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

Sample Rating Trend ISO

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jun 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC05900715		
Sample Date		Client Info		28 Jun 2023		
Machine Age	hrs	Client Info		650		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	5		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	38		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		13		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		7		
Potassium	ppm	ASTM D5185m	>20	10		
Water	%	ASTM D6304	>0.05	0.016		
ppm Water	ppm	ASTM D6304	>500	161.5		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		20909		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	1784		
Particles >21µm		ASTM D7647	>20	<u>▲</u> 522		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>22/21/18</u>		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.28		



OIL ANALYSIS REPORT

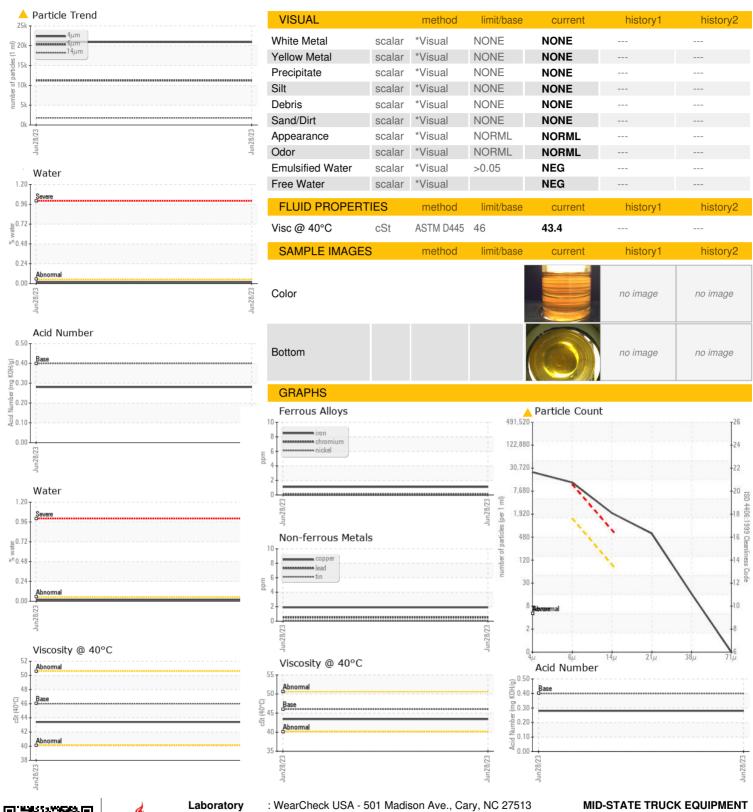





Certificate L2367

Sample No. Lab Number **Unique Number** Test Package

: KC05900715

: 05900715 : 10562071 : IND 2

: 17 Jul 2023 Received Diagnosed : 19 Jul 2023 Diagnostician

: Don Baldridge

4287 E US 40 GREENFIELD, IN US 46140

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: