

# **PROBLEM SUMMARY**

Sample Rating Trend

**VIS DEBRIS** 

7410620 (S/N 1042)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

**COMPONENT CONDITION SUMMARY** 

No relevant graphs to display

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS						
Sample Status				ABNORMAL	NORMAL	ABNORMAL
Debris	scalar	*Visual	NONE	MODER	LIGHT	LIGHT

**Customer Id: PURWIX** Sample No.: KC111224 Lab Number: 05901318 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

#### **RECOMMENDED ACTIONS**

Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

## HISTORICAL DIAGNOSIS

# 24 Aug 2022 Diag: Don Baldridge

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

# view report

# 18 Apr 2022 Diag: Don Baldridge

#### ISO



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

# view report

#### 23 Dec 2021 Diag: Jonathan Hester

# VIS DEBRIS




No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**

Sample Rating Trend

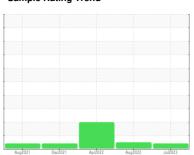

VIS DEBRIS



Machine Id

# 7410620 (S/N 1042)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

# DIAGNOSIS

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

#### Wear

All component wear rates are normal.

### Contamination

Moderate concentration of visible dirt/debris present in the oil.


## **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		Aug2021	Dec2021	Apr2022 Aug2022	Jul2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC111224	KC107351	KC104374
Sample Date		Client Info		07 Jul 2023	24 Aug 2022	18 Apr 2022
Machine Age	hrs	Client Info		15229	11475	8872
Oil Age	hrs	Client Info		4175	8000	5400
Oil Changed		Client Info		Not Changd	Changed	Not Changd
Sample Status				ABNORMAL	NORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	0	<1
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	2
Aluminum	ppm	ASTM D5185m	>10	2	0	<1
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	12	8	8
Tin	ppm	ASTM D5185m	>10	0	0	<1
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m	90	9	<1	9
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		<1	0	0
Zinc	ppm	ASTM D5185m		0	0	7
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	0	<1
Sodium	ppm	ASTM D5185m		7	0	5
Potassium	ppm	ASTM D5185m	>20	2	1	0
Water	%	ASTM D6304	>0.05	0.009	0.004	0.008
ppm Water	ppm	ASTM D6304	>500	95.9	49.9	85.9
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			1949	20404
Particles >6µm		ASTM D7647	>1300		496	▲ 5877
Particles >14μm		ASTM D7647	>80		68	▲ 382
Particles >21µm		ASTM D7647	>20		24	<b>4</b> 96
Particles >38μm		ASTM D7647	>4		3	<u> </u>
Particles >71μm		ASTM D7647	>3		0	0
Oil Cleanliness		ISO 4406 (c)	>/17/13		18/16/13	<b>22/20/16</b>
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.36	0.35	0.35





# **OIL ANALYSIS REPORT**

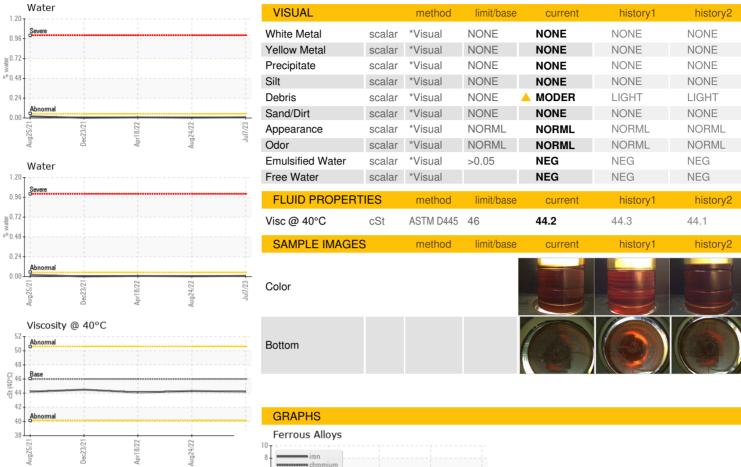

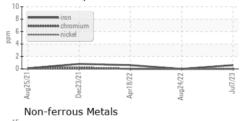

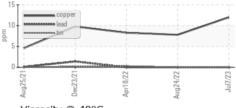

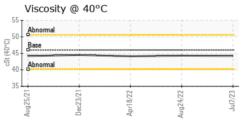

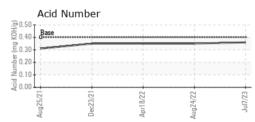





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package

: KC111224 : 05901318

: 10562674 : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 18 Jul 2023 Received Diagnosed : 20 Jul 2023

: Don Baldridge Diagnostician

**PUREM NOVI INC** 

30220 OAK CREEK DR WIXOM, MI US 48393

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: