

PROBLEM SUMMARY

Sample Rating Trend

WATER




KAESER 7463960

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

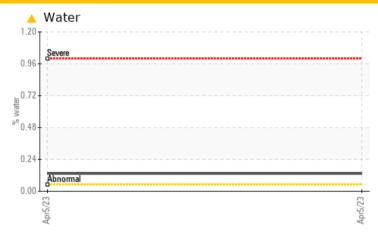

RECOMMENDATION

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status		ABNORMAL						
Water	%	ASTM D6304	>0.05	△ 0.133				
ppm Water	ppm	ASTM D6304	>500	1330				
Debris	scalar	*Visual	NONE	MODER				
Appearance	scalar	*Visual	NORML	HAZY				
Emulsified Water	scalar	*Visual	>0.05	0.2%				
Free Water	scalar	*Visual		1.0				

Customer Id: STAYPS Sample No.: KCPA000295 Lab Number: 05901319 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



WATER



KAESER 7463960

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil. There is a light concentration of water present in the oil. Free water present.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
	ATION		IIIIIIIIIIIIII		,	,
Sample Number		Client Info		KCPA000295		
Sample Date		Client Info		05 Apr 2023		
Machine Age	hrs	Client Info		2306		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	2		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		3		
Zinc	ppm	ASTM D5185m		20		
Sulfur	ppm	ASTM D5185m		22120		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	△ 0.133		
ppm Water	ppm	ASTM D6304	>500	1330		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


0.15

Acid Number (AN)

mg KOH/g ASTM D8045 0.4



OIL ANALYSIS REPORT

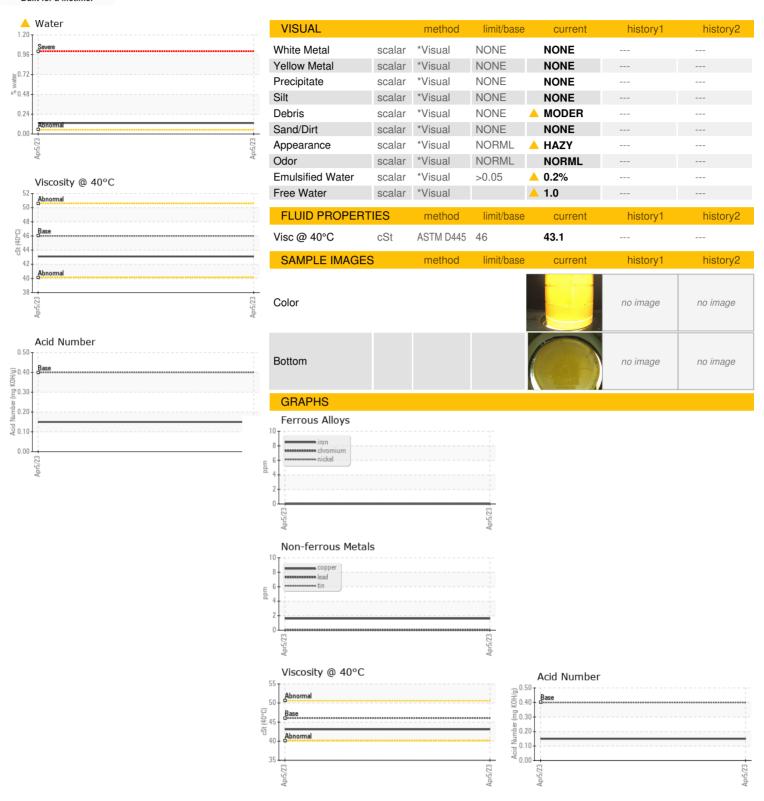





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 05901319 : 10562675

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Jul 2023 : KCPA000295 Diagnosed

: 20 Jul 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

STAG INVESTMENTS 8960 BACK ACRES DR

YPSILANTI, MI US 48197

Contact: Service Manager

T: F: