

PROBLEM SUMMARY

Sample Rating Trend

WATER



SUTTER 20070630024 - NUTRIEN

Component

Compressor

GF-32 (--- GAL)

COMPONENT CONDITION SUMMARY



RECOMMENDATION

We advise that you follow the water drain-off procedure for this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Water	%	ASTM D6304	>0.1	△ 0.551				
nnm Water	nnm	ASTM D6304	>1000	△ 5510				

Customer Id: AIRGREWC Sample No.: WC0673394 Lab Number: 05902436 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED	ACTIONS			
Action	Status	Date	Done By	Description
Water Drain-off			?	We advise that you follow the water drain-off procedure for this component.
HISTORICAL DIA	GNOSIS			



OIL ANALYSIS REPORT

Sample Rating Trend



SUTTER 20070630024 - NUTRIEN

Component

Compressor

GF-32 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you follow the water drain-off procedure for this component. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a moderate concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0673394		
Sample Date		Client Info		17 Jul 2023		
Machine Age	hrs	Client Info		24983		
Oil Age	hrs	Client Info		4000		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		64		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		433		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3		
Sodium	ppm	ASTM D5185m		43		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.1	<u> </u>		
ppm Water	ppm	ASTM D6304	>1000	<u></u> 5510		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
	1/01::	4.0TH D.04 :-				


1.04

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

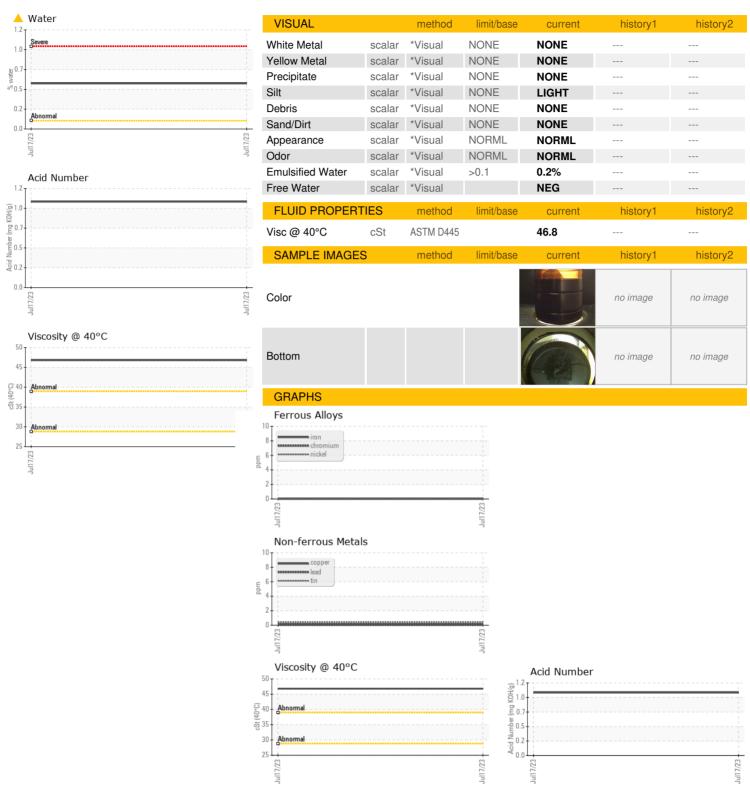





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: WC0673394 : 05902436 : 10563792

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 19 Jul 2023 : 21 Jul 2023

Diagnostician : Jonathan Hester

Test Package : IND 2 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact: Dallas Burcham dallas.burcham@fs-compression.com T: (336)605-9622

FS-COMPRESSION CO, LLC

203 AERO COURT

F: (336)605-9844

GREENSBORO, NC

Report Id: AIRGREWC [WUSCAR] 05902436 (Generated: 07/21/2023 13:44:57) Rev: 1

Contact/Location: Dallas Burcham - AIRGREWC

US 27409