

PROBLEM SUMMARY


EL SAUZ Q01WEA90066 (S/N W-123020)

Wind Turbine Gearbox

FUCHS RENOLIN CLP ISO 320 (--- LTR)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

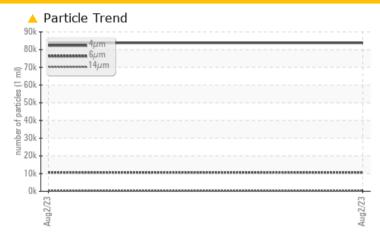

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6μm	ASTM D7647	>2500	10636						
Particles >14μm	ASTM D7647	>320	458						
Particles >21µm	ASTM D7647	>80	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>/18/15	24/21/16						

Customer Id: NORDEX Sample No.: NX014571 Lab Number: 05924848 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

EL SAUZ Q01WEA90066 (S/N W-123020)

Wind Turbine Gearbox

FUCHS RENOLIN CLP ISO 320 (--- LTR)

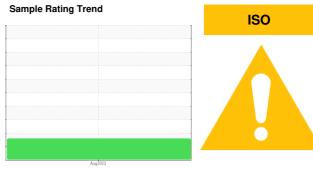

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		<u>, </u>	,	Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		NX014571		
Sample Date		Client Info		02 Aug 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184	>80	17		
Iron	ppm	ASTM D5185m	>150	28		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m	>10	0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>20	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>3	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		16		
Phosphorus	ppm	ASTM D5185m		212		
Zinc	ppm	ASTM D5185m		6		
Sulfur	ppm	ASTM D5185m		4932		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	6		
Sodium	ppm	ASTM D5185m	>20	<1		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.004		
ppm Water	ppm	ASTM D6304	>500	41.7		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		83799		
Particles >6µm		ASTM D7647	>2500	10636		
Particles >14µm		ASTM D7647	>320	458		
Particles >21μm		ASTM D7647	>80	<u> </u>		
Particles >38µm		ASTM D7647	>20	6		
Particles >71μm		ASTM D7647	>4	0		
Oil Cleanliness		ISO 4406 (c)	>/18/15	<u>4</u> 24/21/16		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

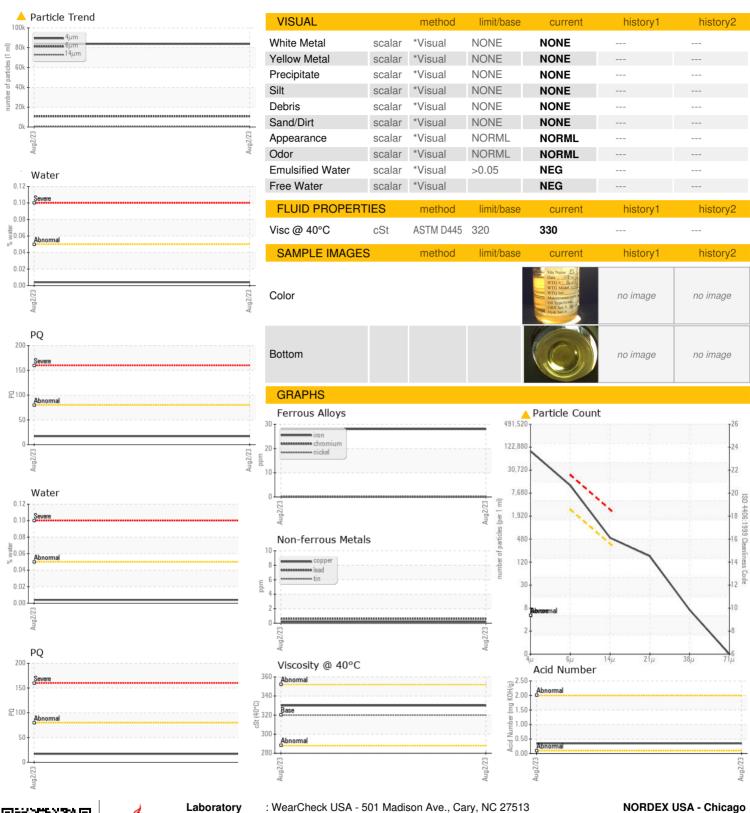



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: NX014571 : 05924848 : 10604795

Received

Diagnosed Diagnostician : Jonathan Hester **Test Package**: IND 2 (Additional Tests: KF, PQ, PrtCount)

: 15 Aug 2023 : 16 Aug 2023

CHICAGO, IL US 60606 Contact: DEVIN LINEHAN DLinehan@nordex-online.com

300 SOUTH WACKER DRIVE, SUITE 1500

T: (312)386-4124 F: (312)386-7102

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)