


# **PROBLEM SUMMARY**

Machine Id KAESER 8118689

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- QTS)

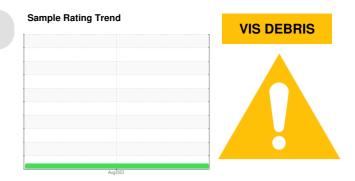

### **COMPONENT CONDITION SUMMARY**

No relevant graphs to display

### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC T	EST RE	SULTS			
Sample Status				ABNORMAL	 
Debris	scalar	*Visual	NONE	▲ HEAVY	 

Customer Id: MONLAM Sample No.: KCPA004943 Lab Number: 05926730 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net


To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED A	CTIONS			
Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

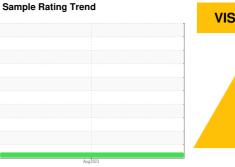

**VIS DEBRIS** 



# **KAESER 8118689**

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- QTS)

### **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

#### Wear

All component wear rates are normal.

### Contamination

High concentration of visible dirt/debris present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA004943		
Sample Date		Client Info		08 Aug 2023		
Machine Age	hrs	Client Info		4604		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	11		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	3		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	3		
Zinc	ppm	ASTM D5185m	0	<1		
Sulfur	ppm	ASTM D5185m	23500	22373		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.009		
ppm Water	ppm	ASTM D6304	>500	90.6		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
A	1/011/	AOTH BOOK	4.0	0.40		


0.46

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



## **OIL ANALYSIS REPORT**

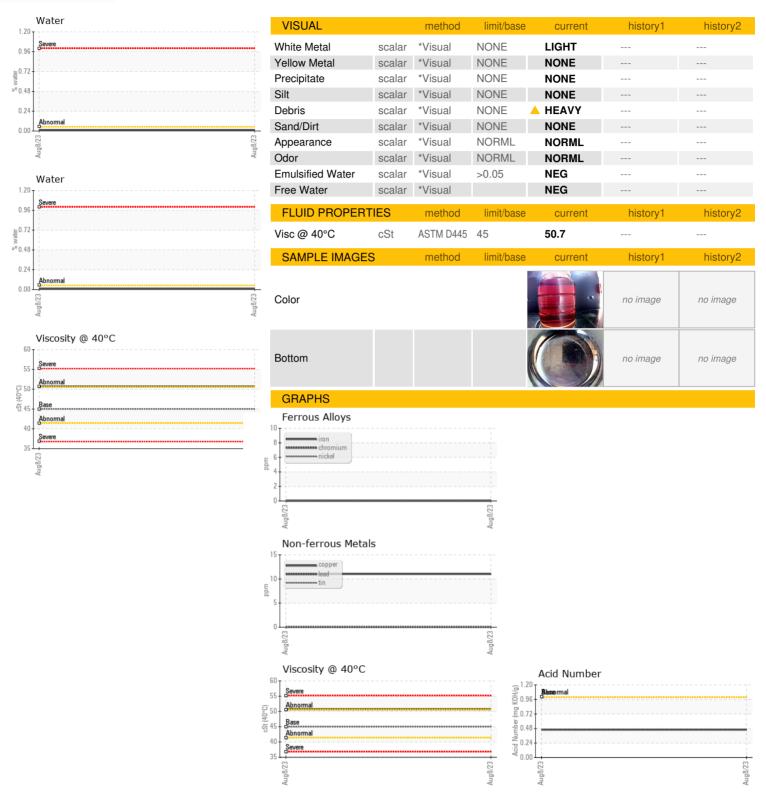





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** 

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: 05926730 : 10606677

: KCPA004943

Received : 16 Aug 2023 : 18 Aug 2023 Diagnosed Diagnostician : Don Baldridge

Test Package : IND 2 ( Additional Tests: KF, PrtCount )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**MONTEBELLO CONTAINER** 

14333 MACAW ST LA MIRADA, CA US 90638

Contact: Service Manager

T:

F: