

PROBLEM SUMMARY

Sample Rating Trend

VISCOSITY




WANN 1545 U 16335

Component

Compressor Fluid

INGERSOLL-RAND TURBOBLEND 46 (--- GAL)

COMPONENT CONDITION SUMMARY

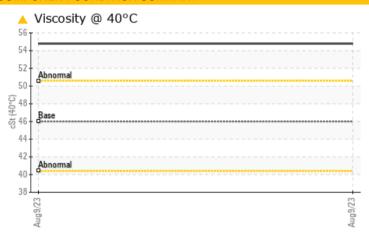

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status				ATTENTION					
Visc @ 40°C	cSt	ASTM D445	46	54.8					

Customer Id: SUEMINMN
Sample No.: WC0843076
Lab Number: 05927407
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com


To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDE	RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

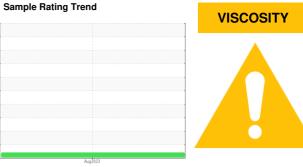

VNN1545U16335

Component

Compressor

INGERSOLL-RAND TURBOBLEND 46 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The oil viscosity is higher than normal. Confirm oil type. The AN level is acceptable for this fluid.

iAL)				Aug 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0843076		
Sample Date		Client Info		09 Aug 2023		
Machine Age	hrs	Client Info		57057		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	1		
_ead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Γin	ppm	ASTM D5185m	>15	<1		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		890		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
//agnesium	ppm	ASTM D5185m		3		
Calcium	ppm	ASTM D5185m		8		
Phosphorus	ppm	ASTM D5185m		9		
Zinc	ppm	ASTM D5185m		14		
Sulfur	ppm	ASTM D5185m		413		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		49		
Potassium	ppm	ASTM D5185m	>20	4		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.57		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
ellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
ree Water	scalar	*Visual		NEG		
55:02) Rev: 1			Co	ntact/Location:	Service Manage	er - SUEMINM



OIL ANALYSIS REPORT

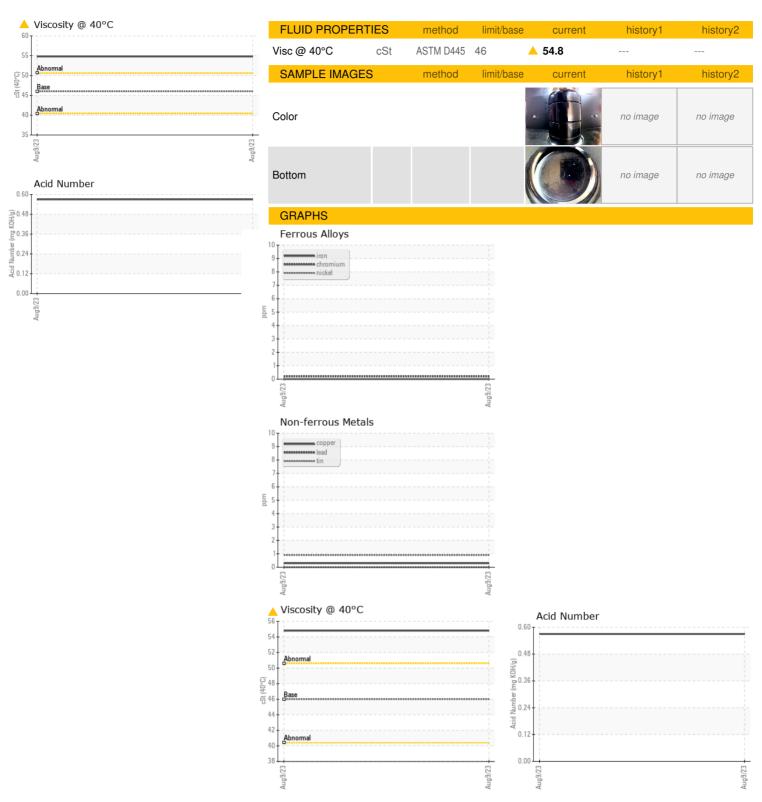





Certificate L2367

Laboratory Sample No.

Lab Number

: WC0843076 : 05927407 Unique Number : 10607354 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Aug 2023 : 22 Aug 2023 Diagnosed

Diagnostician : Jonathan Hester

SUEZ WTS 5951 CLEARWATER DR MINNETONKA, MN US 55343

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: