

PROBLEM SUMMARY


Sample Rating Trend

VIS DEBRIS

BUSCH VM4 / VP-2 (S/N 2512909)

Pump Fluid

USPI VAC 100 (--- GAL)

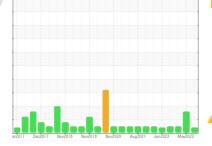



COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				ABNORMAL	ABNORMAL	NORMAL
Debris	scalar	*Visual	NONE	MODER	NONE	NONE

Customer Id: IBPDAK01 Sample No.: USPM29259 Lab Number: 05928260 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

11 May 2023 Diag: Doug Bogart

ISO



We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



26 Jan 2023 Diag: Jonathan Hester

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



03 Oct 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

BUSCH VM4 / VP-2 (S/N 2512909)

Component

Pump

USPI VAC 100 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		an 2017 Dec 2	017 Nov2018 Nov2019	Nov2020 Aug2021 Jun2022	May2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USPM29259	USPM28918	USPM26256
Sample Date		Client Info		19 Aug 2023	11 May 2023	26 Jan 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	2	<1	<1
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>3	0	0	0
Aluminum	ppm	ASTM D5185m	>7	1	<1	2
Lead	ppm	ASTM D5185m	>12	0	0	0
Copper	ppm	ASTM D5185m	>30	0	0	0
Tin	ppm	ASTM D5185m	>9	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	0
Barium	ppm	ASTM D5185m	0	0	2	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	0	0	<1	0
Calcium	ppm	ASTM D5185m	0	2	2	2
Phosphorus	ppm	ASTM D5185m	1800	1905	1552	1625
Zinc	ppm	ASTM D5185m	0	0	5	5
Sulfur	ppm	ASTM D5185m	0	21	10	30
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	2	2	2
Sodium	ppm	ASTM D5185m		<1	0	0
Potassium	ppm	ASTM D5185m	>20	1	2	0
Water	%	ASTM D6304		0.054	0.068	0.035
ppm Water	ppm	ASTM D6304	>.1	546.9	687.9	353.4
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000		<u> 10474</u>	2618
Particles >6µm		ASTM D7647	>1300		<u>^</u> 2036	403
Particles >14µm		ASTM D7647	>160		<u>▲</u> 173	22
Particles >21µm		ASTM D7647	>40		37	4
Particles >38µm		ASTM D7647	>10		3	1
Particles >71µm		ASTM D7647	>3		0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14		<u>\$\rightarrow\$ 21/18/15</u>	19/16/12
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)

0.404


0.27

mg KOH/g ASTM D8045 0.05


0.33





OIL ANALYSIS REPORT

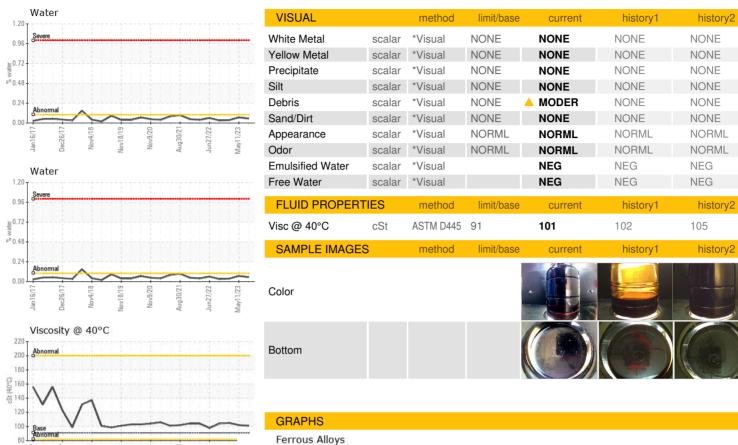

60 Non-ferrous Metals

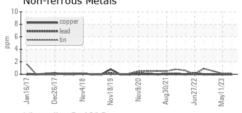

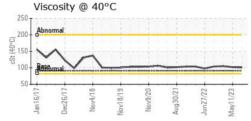

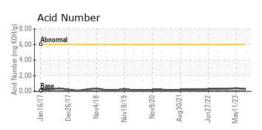





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: USPM29259 : 05928260 : 10608207 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Aug 2023 Diagnosed : 21 Aug 2023

: Doug Bogart Diagnostician

TYSON-DAKOTA CITY-USP

P.O. BOX 515 DAKOTA CITY, NE US 68731

T: (605)235-2396

F: (605)235-2960

Contact: RICHARD KOCH

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)