


PROBLEM SUMMARY


Area [2896460] 77AY02

Component **Hydraulic System**

KLUBER KLUBEROIL 4 UH1-68 N (5 GAL)

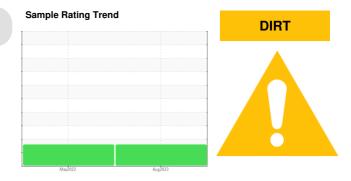

COMPONENT CONDITION SUMMARY

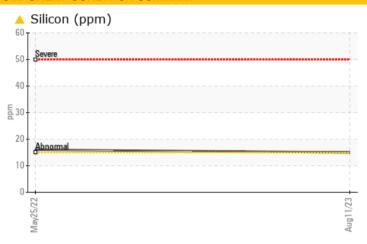

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status				MARGINAL	MARGINAL					
Silicon	ppm	ASTM D5185m	>15	15	<u></u> 16					

Customer Id: TALCLA Sample No.: WC0840221 Lab Number: 05928788 Test Package: IND 2 To manage this report scan the QR code To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

25 May 2022 Diag: Doug Bogart

DIRT



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. Elemental level of silicon (Si) above normal indicating ingress of seal material. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

^{Area} [2896460] 77AY02

Hydraulic System

KLUBER KLUBEROIL 4 UH1-68 N (5 GAL)

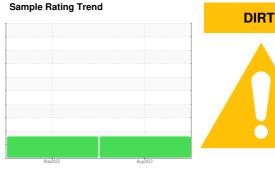

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elemental level of silicon (Si) above normal indicating ingress of seal material. The amount and size of particulates present in the system are acceptable.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			May2022	Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0840221	WC0688438	
Sample Date		Client Info		11 Aug 2023	25 May 2022	
Machine Age	yrs	Client Info		0	0	
Oil Age	yrs	Client Info		0	0	
Oil Changed		Client Info		Not Changd	N/A	
Sample Status				MARGINAL	MARGINAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	1	<1	
Chromium	ppm	ASTM D5185m	>20	0	0	
Nickel	ppm	ASTM D5185m	>20	0	<1	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	<1	
Aluminum	ppm	ASTM D5185m	>20	<1	0	
Lead	ppm	ASTM D5185m	>20	1	0	
Copper	ppm	ASTM D5185m	>20	0	0	
Tin	ppm	ASTM D5185m	>20	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		<1	0	
Calcium	ppm	ASTM D5185m		0	0	
Phosphorus	ppm	ASTM D5185m		912	631	
Zinc	ppm	ASTM D5185m		5	0	
Sulfur	ppm	ASTM D5185m		1128	540	
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<u> </u>	<u> </u>	
Sodium	ppm	ASTM D5185m		<1	0	
Potassium	ppm	ASTM D5185m	>20	0	0	
Water	%	ASTM D6304	>0.05	0.002	0.00	
ppm Water	ppm	ASTM D6304	>500	22.3	0.00	
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	2779	318	
Particles >6µm		ASTM D7647	>1300	438	67	
Particles >14µm		ASTM D7647	>160	25	9	
Particles >21µm		ASTM D7647	>40	7	2	
Particles >38µm		ASTM D7647	>10	0	0	
Particles >71µm		ASTM D7647	>3	0	0	
Oil Cleanliness		ISO 4406 (c)	>19/17/14	19/16/12	15/13/10	
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		1.14	0.83	



OIL ANALYSIS REPORT

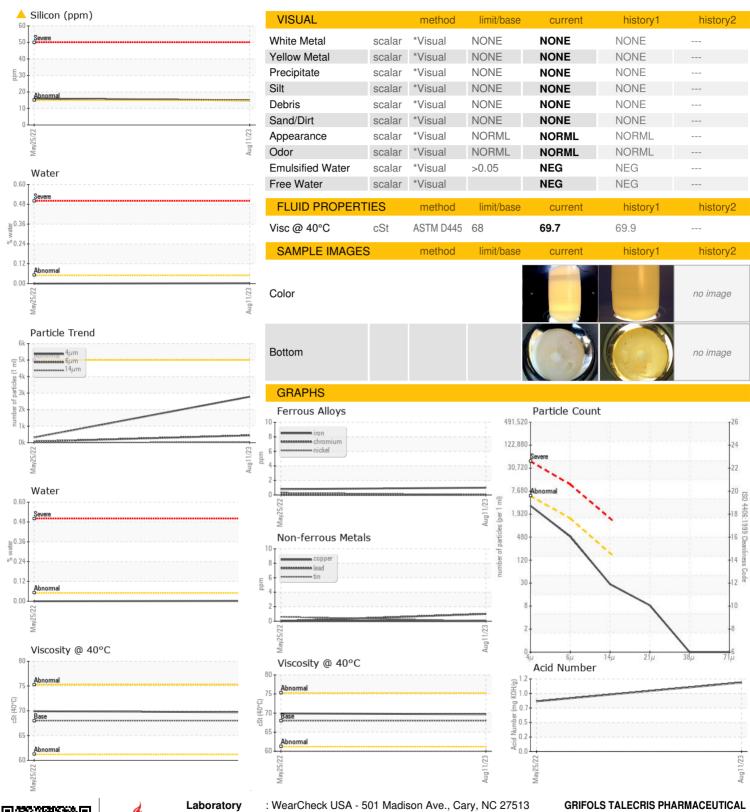





Certificate L2367

Sample No. Lab Number **Unique Number**

: WC0840221 : 05928788

Received : 10608735

Diagnosed Diagnostician : Don Baldridge

: 18 Aug 2023 : 22 Aug 2023

Test Package : IND 2 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

8368 US 70 WEST CLAYTON, NC US 27520

Contact: KEN TERRY kenneth.terry@grifols.com

T: (919)359-4362 F: (919)359-4767

Report Id: TALCLA [WUSCAR] 05928788 (Generated: 08/22/2023 11:32:02) Rev: 1

Contact/Location: KEN TERRY - TALCLA