

## **PROBLEM SUMMARY**

Sample Rating Trend

VIS DEBRIS

A

# Machine Id KAESER SFC110S 6702208 (S/N 1012)

Compressor

Fluid

NOT GIVEN (--- GAL)

#### COMPONENT CONDITION SUMMARY

No relevant graphs to display

#### RECOMMENDATION

Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL			
Debris	scalar	*Visual	NONE	▲ MODER			

Customer Id: MONDENCA Sample No.: KCPA004147 Lab Number: 05929580 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.		

## HISTORICAL DIAGNOSIS



## **OIL ANALYSIS REPORT**

Sample Rating Trend

VIS DEBRIS

Machine Id

## KAESER SFC110S 6702208 (S/N 1012)

Component

Compressor

**NOT GIVEN (--- GAL)** 

#### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

#### Wear

All component wear rates are normal.

#### Contamination

Moderate concentration of visible dirt/debris present in the oil.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA004147		
Sample Date		Client Info		20 Aug 2023		
Machine Age	hrs	Client Info		18092		
Oil Age	hrs	Client Info		18010		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	3		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	7		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	8		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		211		
Zinc	ppm	ASTM D5185m		62		
Sulfur	ppm	ASTM D5185m		6431		
CONTAMINANTS	8	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	800.0		
ppm Water	ppm	ASTM D6304	>500	86.3		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2


0.78

Acid Number (AN)

mg KOH/g ASTM D8045



### **OIL ANALYSIS REPORT**

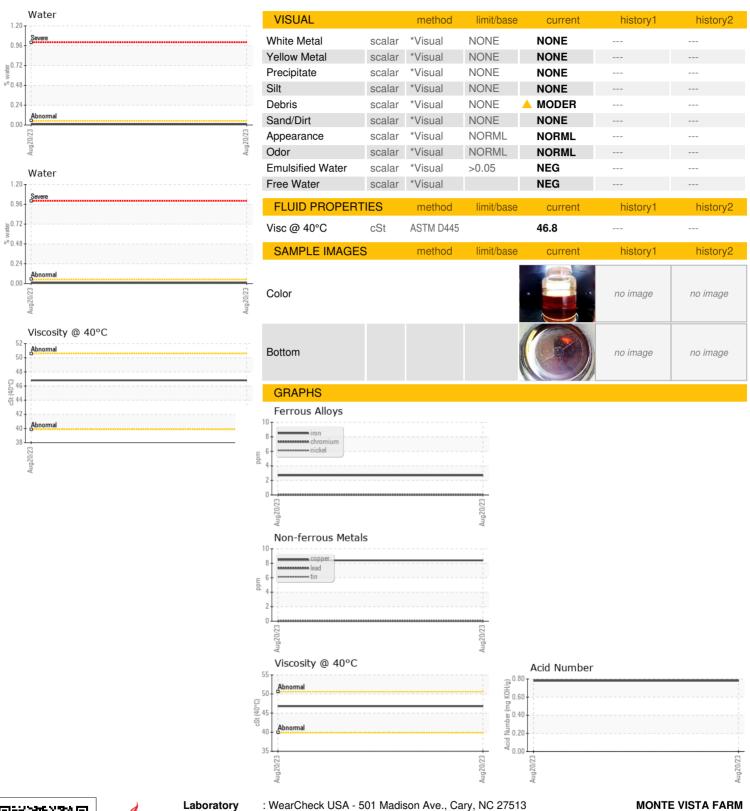





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** 

: 05929580 : 10609527

: KCPA004147

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 21 Aug 2023

: 22 Aug 2023 Diagnostician : Angela Borella

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact: J BEAVEN JBEAVEN@MONTEVISTAFARMING.COM

5043 N MONTPELIER RD

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

DENAIR, CA

US 95316

T: F: