


PROBLEM SUMMARY

Sample Rating Trend

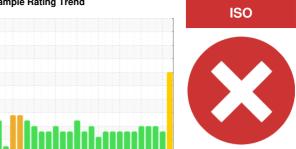


SM312/007 - EDGER (S/N 0238-32130-00090-04802)

Hydraulic System

AW HYDRAULIC OIL ISO 68 (--- GAL)

COMPONENT CONDITION SUMMARY

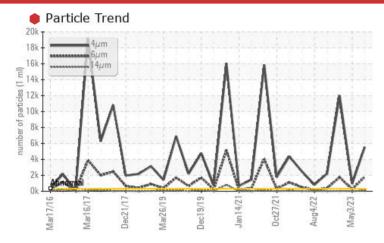

RECOMMENDATION

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use offline filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Customer Id: FLUMAR Sample No.: FC0000564 Lab Number: 05932114 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

PROBLEMATIC TEST RESULTS							
Sample Status		SEVERE	ABNORMAL	ABNORMAL			
Particles >4µm	ASTM D7647 >3	20 6 5552	4 942	<u>▲</u> 11992			
Particles >6µm	ASTM D7647 >8	0 1799	<u>▲</u> 270	<u></u> 1748			
Particles >14μm	ASTM D7647 >1	0 ^ 77	▲ 11	<u></u> 41			
Particles >21μm	ASTM D7647 >3	1 21	1	<u>^</u> 7			
Oil Cleanliness	ISO 4406 (c) >1	5/13/10 0 20/18/13	<u>▲</u> 17/15/11	<u>^</u> 21/18/13			

RECOMMENDED ACTIONS					
Action	Status	Date	Done By	Description	
Change Filter			?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.	
Resample			?	Resample in 30-45 days to monitor this situation.	
Alert			?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.	
Information Required			?	Please specify the brand, type, and viscosity of the oil on your next sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.	
Check Breathers			?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.	
Check Dirt Access			?	We advise that you check all areas where contaminants can enter the system.	
Filter Fluid			?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.	

HISTORICAL DIAGNOSIS



03 May 2023 Diag: Wes Davis

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.



26 Jan 2023 Diag: Jonathan Hester





We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



03 Nov 2022 Diag: Don Baldridge





We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

Machine Id

SM312/007 - EDGER (S/N 0238-32130-00090-04802)

Component

Hydraulic System

AW HYDRAULIC OIL ISO 68 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use offline filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates (2 to 100 microns in size) present in the oil. The system cleanliness code is much higher than the acceptable limit for the target ISO 4406 cleanliness code.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

		ar2016 Mar20	17 Dec2017 Mar2019 D	ec2019 Jan2021 Oct2021 Aug202	22 May2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		FC0000564	FC0000469	FC0000429
Sample Date		Client Info		15 Aug 2023	03 May 2023	26 Jan 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				SEVERE	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	<1	<1
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	0	<1	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	<1	0	0
Lead	ppm	ASTM D5185m	>20	0	<1	0
Copper	ppm	ASTM D5185m	>20	8	7	10
Tin	ppm	ASTM D5185m	>20	0	<1	0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	0	0
Barium	ppm	ASTM D5185m	5	0	0	0
Molybdenum	ppm	ASTM D5185m	5	<1	<1	<1
Manganese	ppm	ASTM D5185m		<1	<1	0
Magnesium	ppm	ASTM D5185m	25	3	7	2
Calcium	ppm	ASTM D5185m	200	67	63	53
Phosphorus	ppm	ASTM D5185m	300	332	360	325
Zinc	ppm	ASTM D5185m	370	419	444	400
Sulfur	ppm	ASTM D5185m	2500	2942	3318	2851
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	2	2
Sodium	ppm	ASTM D5185m		0	4	<1
Potassium	ppm	ASTM D5185m	>20	<1	1	0
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>320	5552	△ 942	<u> </u>
Particles >6µm		ASTM D7647	>80	1799	<u>▲</u> 270	<u>▲</u> 1748
Particles >14µm		ASTM D7647	>10	<u>^</u> 77	<u> 11</u>	▲ 41
Particles >21µm		ASTM D7647	>3	2 1	1	▲ 7
Particles >38µm		ASTM D7647	>3	1	0	1
Particles >71μm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>15/13/10	20/18/13	▲ 17/15/11	△ 21/18/13
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	та КОЦ/а	ACTM DODAE	0.57	0.20	0.20	0.00

Acid Number (AN)

mg KOH/g ASTM D8045 0.57


0.28


0.29


0.28



OIL ANALYSIS REPORT

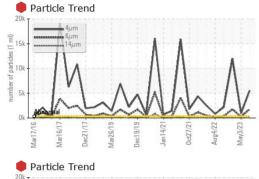


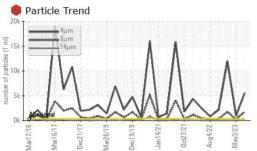

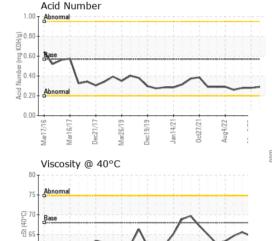

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IFS	method	limit/base	current	history1	history2
1 2015 1 1101 2111	0	momod	mmubacc	oan one	111010171	111010172
Visc @ 40°C	cSt	ASTM D445	68	63.8	64.6	65.6

SAIVIFLE IIVIAGES	memou	IIIIII/Dase	Cuii
Color		,	
Bottom			6

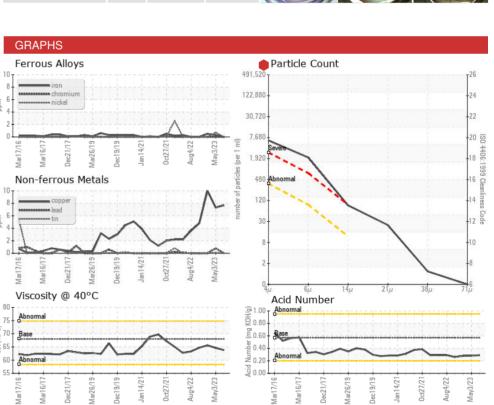





Laboratory Sample No. Lab Number **Unique Number**

: FC0000564 : 05932114 : 10617385

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 23 Aug 2023 : 24 Aug 2023 : Wes Davis

Diagnosed Diagnostician

Test Package : IND 2 Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

FLUID CONTROL SERVICES, INC.

1155 ALLGOOD ROAD, SUITE 15 MARIETTA, GA

US 30062 Contact: Duane Smith

dsmith.fcs@sealsaver.com

T: (770)509-5833

F: (770)509-5832 Contact/Location: Duane Smith - FLUMAR