



PROBLEM SUMMARY

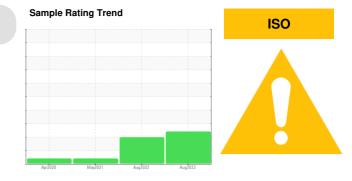

Machine Id 6914136 (S/N 1353) Component

Compressor Fluid KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

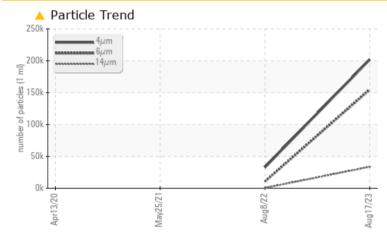

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

THOBEEM THO TEOT TE	00210				
Sample Status			ABNORMAL	ABNORMAL	ABNORMAL
Particles >6µm	ASTM D7647	>1300	🔺 154717	1 0541	
Particles >14µm	ASTM D7647	>80	🔺 33669	4 74	
Particles >21µm	ASTM D7647	>20	<u> </u>	1 65	
Particles >38µm	ASTM D7647	>4	人 177	4 34	
Particles >71µm	ASTM D7647	>3	<mark> 8</mark>	3	
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u> </u>	🔺 22/21/16	

Customer Id: FROBURNC Sample No.: KCPA002835 Lab Number: 05935394 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 <u>don.b505@comcast.net</u>

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

08 Aug 2022 Diag: Don Baldridge



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


25 May 2021 Diag: Don Baldridge



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





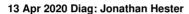



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.All component wear rates are normal. High concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





view report

Report Id: FROBURNC [WUSCAR] 05935394 (Generated: 08/28/2023 14:39:29) Rev: 1



OIL ANALYSIS REPORT

Sample Rating Trend ISO

Machine Id 6914136 (S/N 1353) Component

Compressor Fluid KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA002835	KC102822	KC93555
Sample Date		Client Info		17 Aug 2023	08 Aug 2022	25 May 2021
Machine Age	hrs	Client Info		9387	7200	4380
Oil Age	hrs	Client Info		0	1900	0
Oil Changed		Client Info		N/A	Changed	Changed
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	16	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	<1
Aluminum	ppm	ASTM D5185m	>10	0	0	0
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	13	17	15
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m				0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	9
Barium	ppm	ASTM D5185m	90	0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	90	3	<1	<1
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		0	3	<1
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		19145	13573	12961
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m		0	<1	0
Sodium		ASTM D5185m	>25	3	<1	2
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water	ppm %	ASTM D516511		0.013	0.017	0.003
ppm Water	ppm	ASTM D0304 ASTM D6304		138.0	175.9	28.8
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		201589	32519	
Particles >6µm		ASTM D7647	>1300	<u> </u>	1 0541	
Particles >14µm		ASTM D7647	>80	A 33669	4 74	
Particles >21µm		ASTM D7647		A 7984	1 65	
Particles >38µm		ASTM D7647	>4	177	▲ 34	
Particles >71µm		ASTM D7647	>3	<u> </u>	3	
Oil Cleanliness		ISO 4406 (c)	>/17/13	25/24/22	▲ 22/21/16	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Report Id: FROBURNC [WUSCAR] 05935394 (Generated: 08/28/2023 14:39:30) Rev: 1

Contact/Location: S. GLADDEN - FROBURNC



0.00

1.20

0.9

_늘0.72

a²0.48

0.24

0.00

52

5

48 ()-46 ()-46 44

47


4(

38

Й


nr1

OIL ANALYSIS REPORT

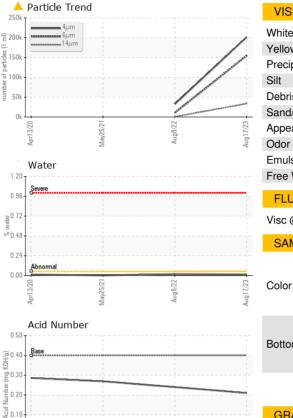



Bottom

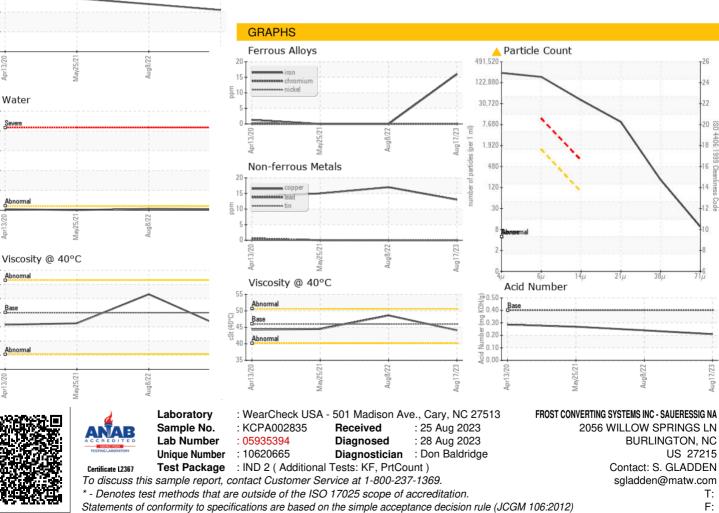

Contact/Location: S. GLADDEN - FROBURNC