

PROBLEM SUMMARY

8556439 (S/N 1858)


Component

Compressor

KAESER SIGMA (OEM) M-460 (--- QTS)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

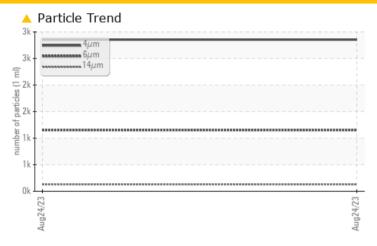

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ATTENTION						
Particles >14µm	ASTM D7647	>80	130						
Particles >21µm	ASTM D7647	>20	28						
Oil Cleanliness	ISO 4406 (c)	>/17/13	19/17/14						

Customer Id: RAYCORCA Sample No.: KCPA004924 Lab Number: 05938281 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

8556439 (S/N 1858)

Compressor

KAESER SIGMA (OEM) M-460 (--- QTS)

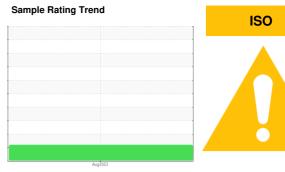

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA004924		
Sample Date		Client Info		24 Aug 2023		
Machine Age	hrs	Client Info		4623		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	6		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium		ASTM D5185m	>10	0		
	ppm			-		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	3		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	21		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	15		
Sulfur	ppm	ASTM D5185m	23500	23113		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.013		
opm Water	ppm	ASTM D6304	>500	132.6		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		2855		
Particles >6µm		ASTM D7647	>1300	1153		
Particles >14µm		ASTM D7647	>80	130		
Particles >21µm		ASTM D7647	>20	28		
Particles >38μm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	▲ 19/17/14		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)				0.37		


Acid Number (AN)

mg KOH/g ASTM D8045 1.0

0.37



OIL ANALYSIS REPORT

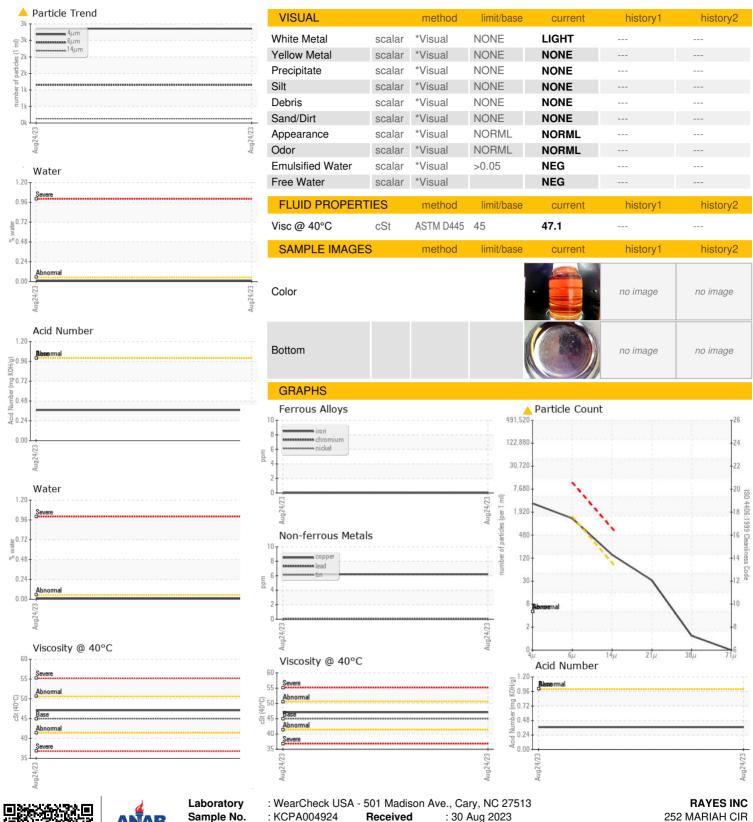



Sample No. Lab Number **Unique Number**

: 05938281

: KCPA004924

Received Diagnosed

: 30 Aug 2023 : 31 Aug 2023

Diagnostician : Don Baldridge

US 92879 Contact: Service Manager

: 10628893 Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F:

CORONA, CA