


PROBLEM SUMMARY

A10-46-005 Machine Id GARDNER DENVER S510113 - MORCON

Compressor



COMPONENT CONDITION SUMMARY

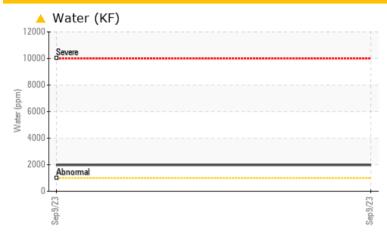

RECOMMENDATION

We advise that you follow the water drain-off procedure for this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Water	%	ASTM D6304	>0.1	△ 0.198				
ppm Water	ppm	ASTM D6304	>1000	1980				

Customer Id: UCLEWCHA Sample No.: UCH05962954 Lab Number: 05962954 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Water Drain-off			?	We advise that you follow the water drain-off procedure for this component.			
HISTORICAL DIA	AGNOSIS						



OIL ANALYSIS REPORT

Area A10-46-005 **GARDNER DENVER S510113 - MORCON**

Compressor





DIAGNOSIS

Recommendation

We advise that you follow the water drain-off procedure for this component. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a light concentration of water present in the

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
SAMPLE INFORMA	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05962954		
Sample Date		Client Info		09 Sep 2023		
Machine Age	hrs	Client Info		41817		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	12		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	9		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		580		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		34		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.1	△ 0.198		
ppm Water	ppm	ASTM D6304	>1000	1980		
FLUID DEGRADAT	ION	method	limit/base	current	history1	history2
		4 O T 1 4 D O O : -				


0.53

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

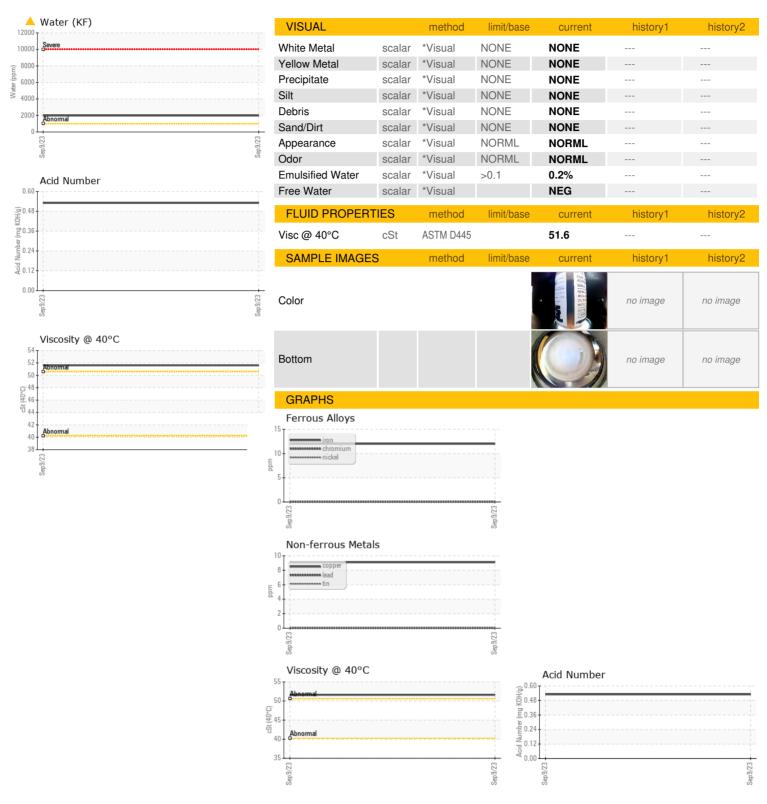





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: 05962954 : 10669505 Test Package : IND 2 (Additional Tests: KF)

: UCH05962954

Received : 27 Sep 2023 Diagnosed

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: 28 Sep 2023 Diagnostician : Doug Bogart

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

LEWIS SYSTEMS & SERVICE CO INC

9300 STOCKPORT PL CHARLOTTE, NC US 28273

Contact: JOE KERLEY jkerley@lewissystemsinc.com

T: (704)588-2299

F: