

PROBLEM SUMMARY

Sample Rating Trend

WEAR




8587184 (S/N 1008)


Component

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

COMPONENT CONDITION SUMMARY

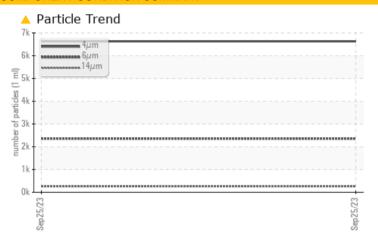

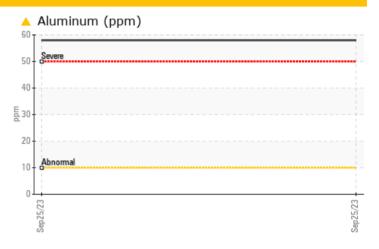

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status				ABNORMAL						
Aluminum	ppm	ASTM D5185m	>10	△ 58						
Particles >6μm		ASTM D7647	>1300	2357						
Particles >14µm		ASTM D7647	>80	251						
Particles >21µm		ASTM D7647	>20	65						
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/15						

Customer Id: MOUPETCA Sample No.: KCPA006253 Lab Number: 05964184 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

8587184 (S/N 1008)

Component

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

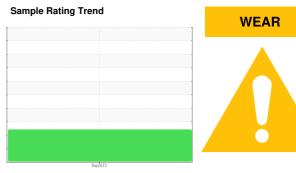

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

The aluminum level is abnormal. All other component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA006253		
Sample Date		Client Info		25 Sep 2023		
Machine Age	hrs	Client Info		72272		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	8		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<u> </u>		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	6		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		2		
Phosphorus	ppm	ASTM D5185m	500	172		
Zinc	ppm	ASTM D5185m		155		
Sulfur	ppm	ASTM D5185m		5941		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	21		
Water	%	ASTM D6304	>0.05	0.00		
ppm Water	ppm	ASTM D6304		0.00		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		6633		
Particles >6µm		ASTM D7647	>1300	2357		
Particles >14µm		ASTM D7647	>80	<u>^</u> 251		
Particles >21µm		ASTM D7647		<u>^</u> 65		
Particles >38µm		ASTM D7647	>4	2		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/15		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.5	0.38		



OIL ANALYSIS REPORT

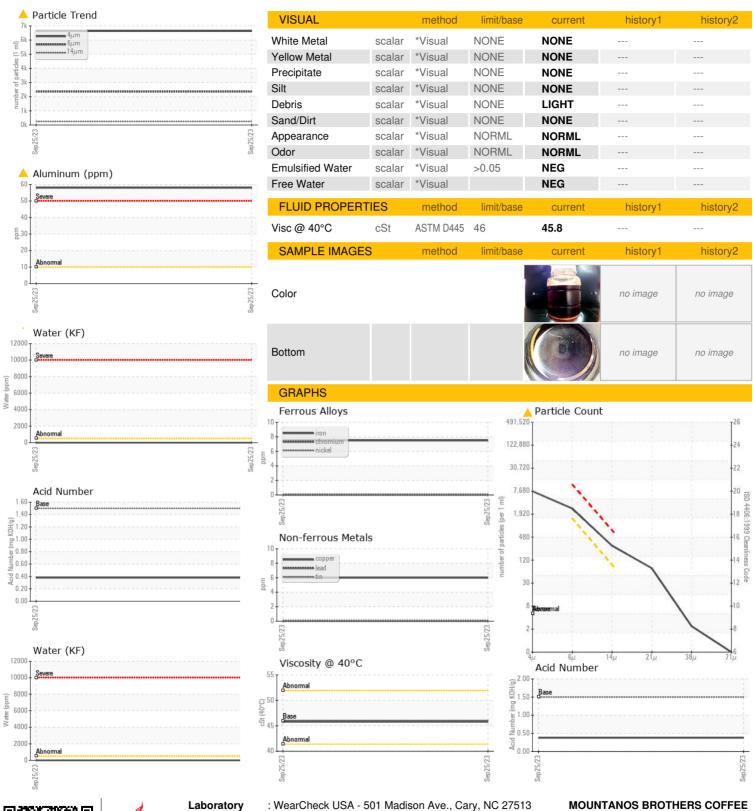





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCPA006253 : 05964184

Received : 28 Sep 2023 : 01 Oct 2023 Diagnosed Diagnostician : Don Baldridge

: 10670735 Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

1331 COMMERCE ST PETALUMA, CA

US 94954

Contact: Service Manager

T:

F: