

# **PROBLEM SUMMARY**

Sample Rating Trend

ISO


# KAESER 5420735

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

### **COMPONENT CONDITION SUMMARY**

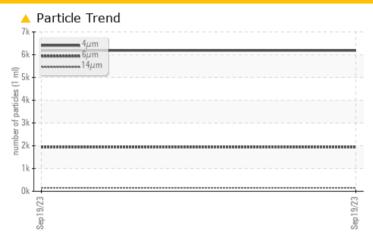

### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST	T RESULTS			
Sample Status			ATTENTION	 
Particles >6µm	ASTM D7647	>1300	<b>1935</b>	 
Particles >14µm	ASTM D7647	>80	<b>150</b>	 
Particles >21µm	ASTM D7647	>20	<u></u> 31	 
Oil Cleanliness	ISO 4406 (c)	>/17/13	<b>20/18/14</b>	 

Customer Id: ALRTON Sample No.: KCPA006428 Lab Number: 05964203 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

### RECOMMENDED ACTIONS

There are no recommended actions for this sample.

### HISTORICAL DIAGNOSIS




## **OIL ANALYSIS REPORT**

# **KAESER 5420735**

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

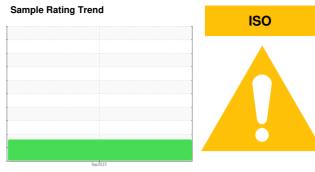

### **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

### Contamination

There is a moderate amount of particulates present in the oil.


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA006428		
Sample Date		Client Info		19 Sep 2023		
Machine Age	hrs	Client Info		21232		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	4		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	25		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	<1		
Zinc	ppm	ASTM D5185m	0	26		
Sulfur	ppm	ASTM D5185m	23500	19135		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.00		
ppm Water	ppm	ASTM D6304	>500	0.00		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		6182		
Particles >6μm		ASTM D7647	>1300	<u> </u>		
Particles >14μm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u>▲</u> 31		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/14		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.38		



### **OIL ANALYSIS REPORT**

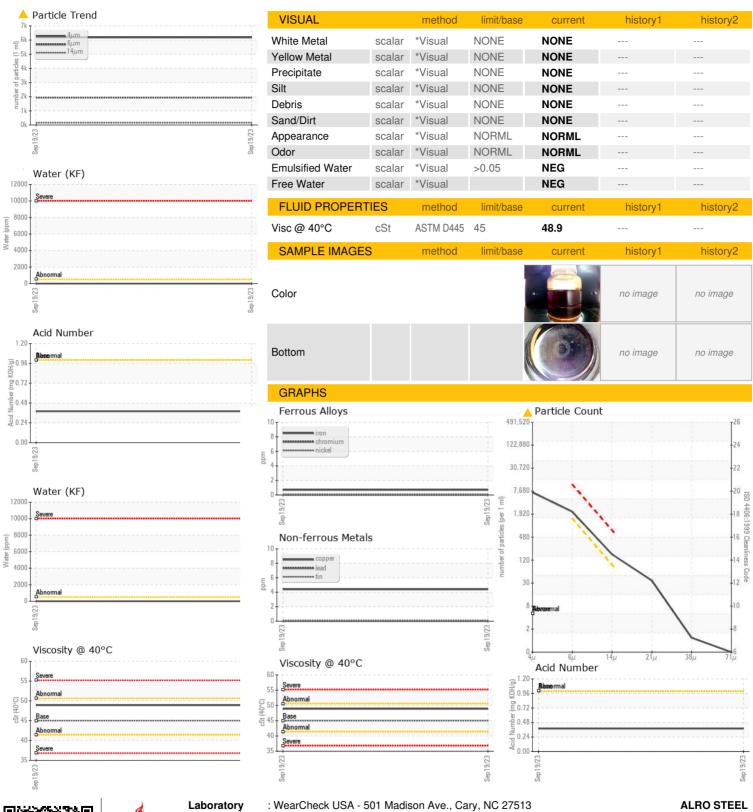



Certificate L2367

Sample No. Lab Number **Unique Number** 

: 05964203

: KCPA006428 : 10670754

Received : 28 Sep 2023 : 01 Oct 2023 Diagnosed Diagnostician : Don Baldridge

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

50 ENSMINGER RD

Contact: Service Manager

TONAWANDA, NY

US 14150

T: F: