

PROBLEM SUMMARY


Sample Rating Trend ISO

TRYOUT TRYOUT

Component **Lube System**

NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

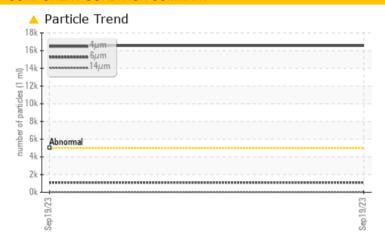

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL					
Particles >4µm	ASTM D7647	>5000	<u> </u>					
Oil Cleanliness	ISO 4406 (c)	>19/17/14	21/17/12					

Customer Id: TESAUSTLC Sample No.: TLC05964594 Lab Number: 05964594 Test Package: PLANT



To manage this report scan the QR code


To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS								
Action	Status	Date	Done By	Description				
Information Required			?	Please specify the brand, type, and viscosity of the oil on your next sample.				
HISTORICAL DIAGN	IOSIS							



OIL ANALYSIS REPORT

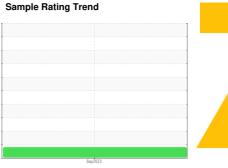

ISO



TRYOUT TRYOUT

Component

Lube System

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		TLC05964594		
Sample Date		Client Info		19 Sep 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	5		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	<1		
Copper	ppm	ASTM D5185m	>20	10		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		1		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		11		
Calcium	ppm	ASTM D5185m		36		
Phosphorus	ppm	ASTM D5185m		274		
Zinc	ppm	ASTM D5185m		30		
Sulfur	ppm	ASTM D5185m		8168		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	16547		
Particles >6µm		ASTM D7647	>1300	1097		
Particles >14µm		ASTM D7647	>160	22		
Particles >21µm		ASTM D7647	>40	4		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u>^</u> 21/17/12		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g ASTM D8045

0.43



OIL ANALYSIS REPORT

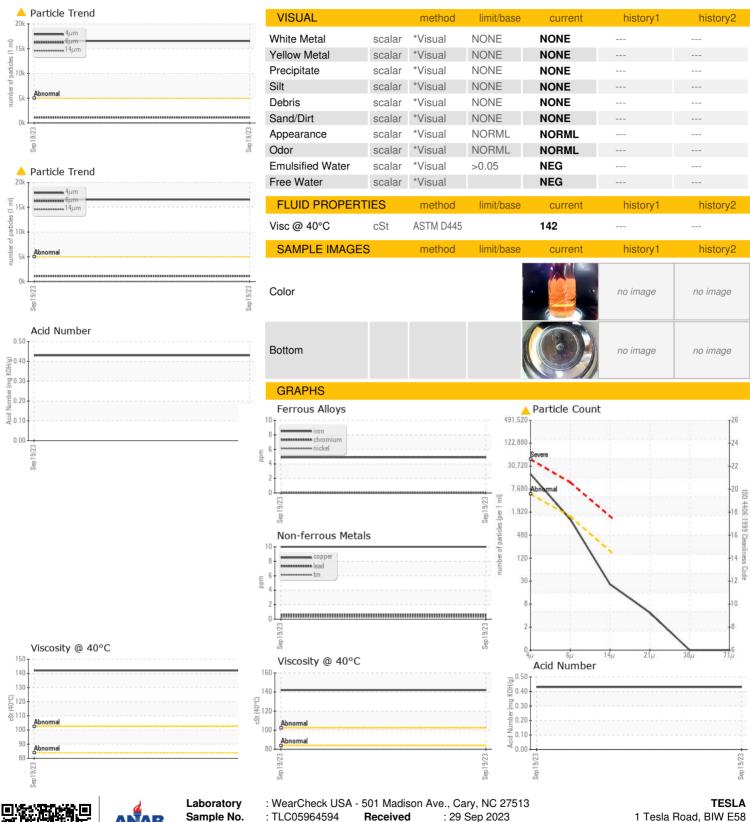



Certificate L2367

Sample No. Lab Number **Unique Number** Test Package : PLANT

: TLC05964594 : 05964594 : 10671145

Received Diagnosed Diagnostician

: 29 Sep 2023 : 03 Oct 2023 : Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

davmitchell@tesla.com T: (260)226-1968 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Dave Mitchell - TESAUSTLC

Austin, TX

US 78725

F:

Contact: Dave Mitchell